

MEMO

TO: Water Right File
FROM: James Cefalo JRC
DATE: December 10, 2012
RE: Field Examination for Water Right 13-4203

I conducted a field exam for water right 13-4203 on Friday, September 28, 2012. I found very little evidence of irrigation. There is no existing functional diversion structure at the head of the ditch. I found the remnants of an old diversion dam (photos 1-3). However, the diversion dam is non-functional. The way the structure was positioned suggests that the stream channel used to flow through the area differently. I would guess that the stream channel was changed when the road culvert was last replaced. The diversion dam does not even sit in the natural channel anymore and is now useless for diverting water.

The old ditches are still visible across some of the property. I took gps readings along the main ditch as far as it was visible. (photos 5-9) There was also a lateral ditch that split off to the west. (photos 10-12) The map attached to this email shows the extent that I could visually confirm the existence of ditches (shown in blue). Beyond the blue lines the ground is flat. The ditches are in poor condition. Many areas of the ditch are flattened out or filled in. Fifty feet down ditch from the old diversion structure, the ditch is completely filled in for a 50-foot stretch. Even if there were a functioning headgate/diversion structure, it would be impossible to irrigate the property without serious work to recondition (re-dig) the ditch.

Based on the ditches that were still visible, I created a shape of ground that could have been irrigated through the old ditch system. The area highlighted in red constitutes 5 acres. One indication that irrigation has not taken place for a long time is the size of the sagebrush plant growing in the middle of the 50-foot section of filled-in ditch. (photos 5 and 6) There are no sign of any pasture grasses. The area has been primarily vegetated by sagebrush and desert grasses. The spring flow is very good. It is flowing at much more than 0.3 cfs. (photo 4)

Given the current condition of the diversion structure and irrigation ditches, it is highly unlikely that there has been irrigation at this site for many years.

13-4203
Sept 28, 2012



#2



#1

13-4203
Sept 28, 2012



h#



3#

13-4203
Sept 28, 2012



#6



#5

13-4203
Sept 28, 2012



8 #



7 #

13-4203
Sept 28, 2012



#10



#9

13-4203
Sept 28, 2012




21#




11#

13-4203 (Sagebrush Steppe Land Trust)

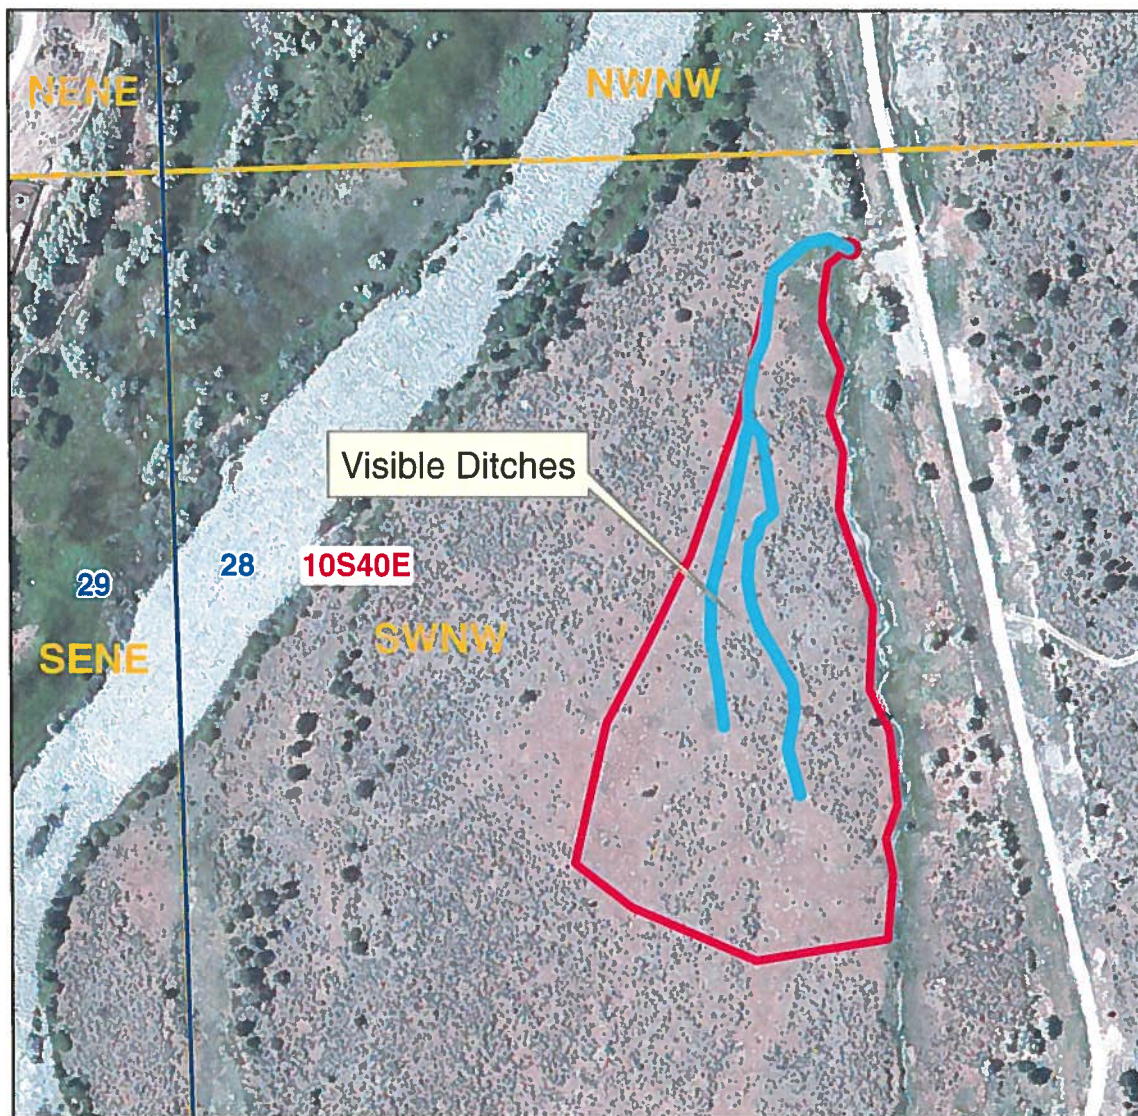

Legend

- Apparent POD
- Apparent POU
- Township/Range
- Sections
- QQ

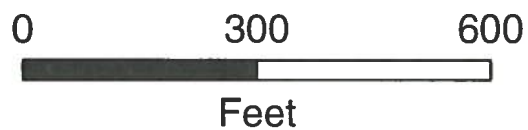

2010 Aerial Photography