FISHER SURVIVOR'S TRUST

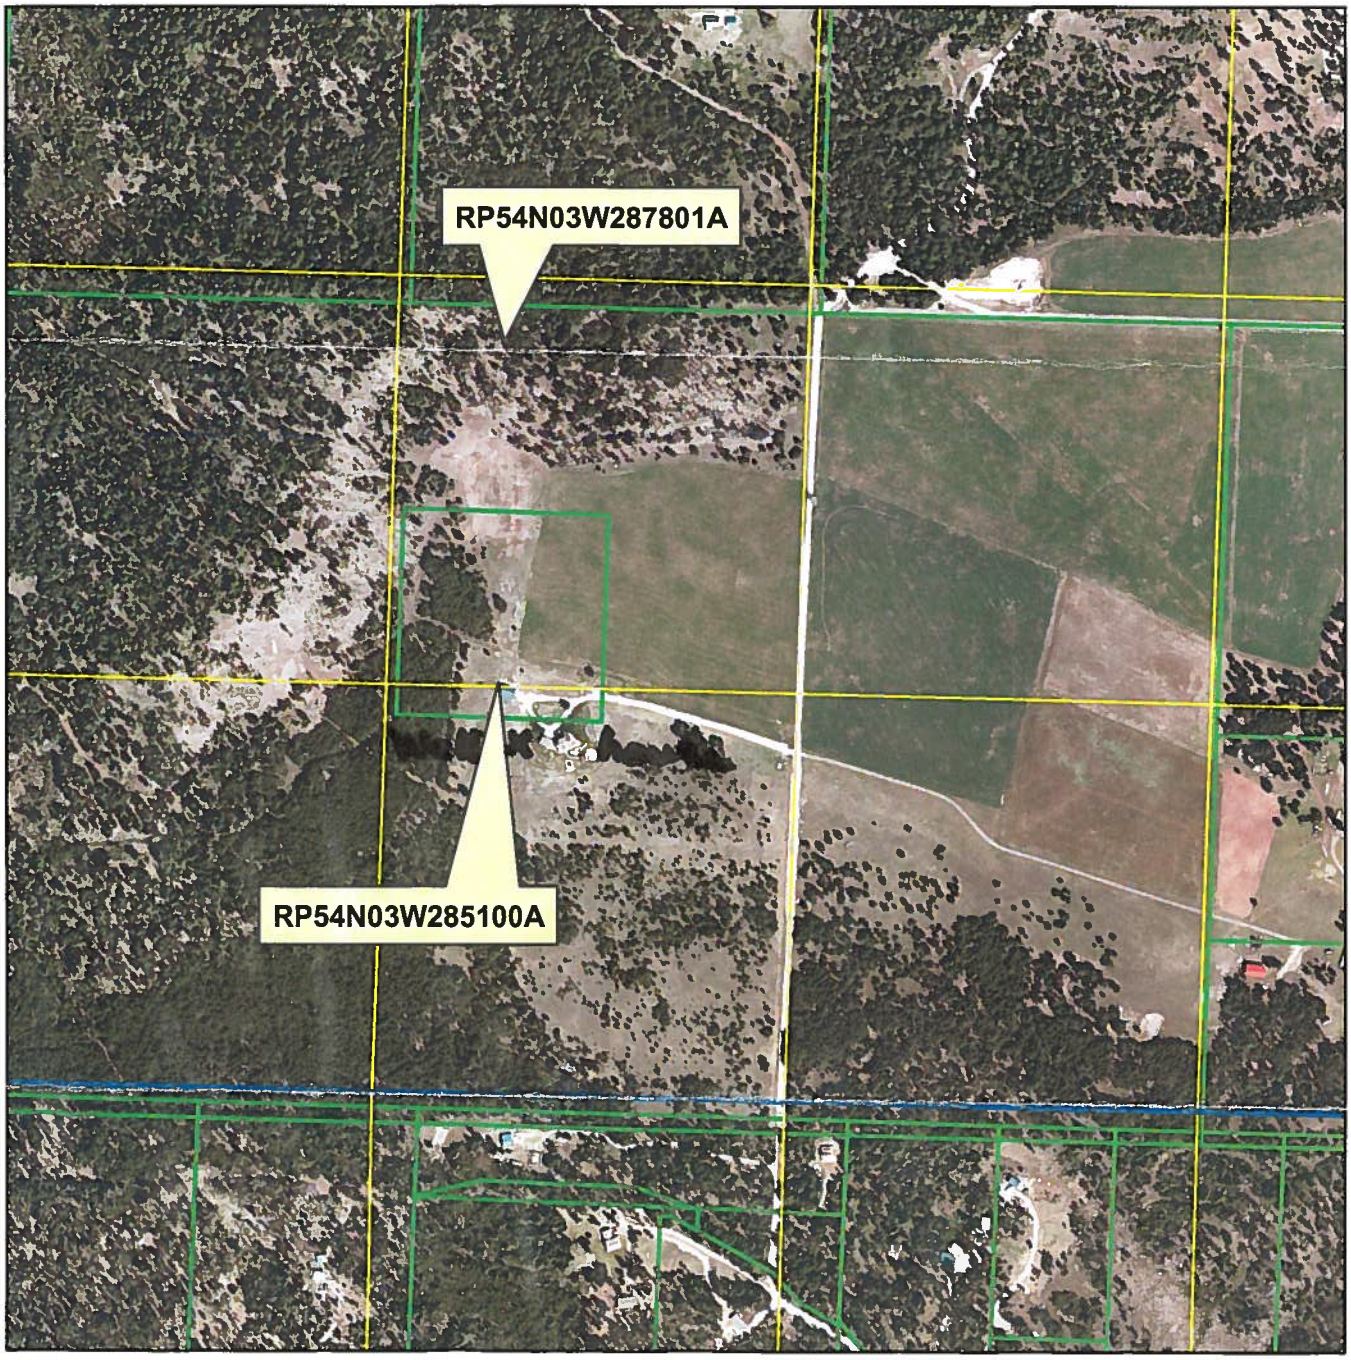

NOV - 3 2011

RECEIVED
SEP 24 1998
NORTHERN REGION
IDWR

Form 238-7

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Use Typewriter or Ballpoint Pen

Office Use Only
Inspected by _____
Twp____ Rge____ Sec ____
____1/4 ____1/4 ____1/4
Lat: : : Long: : :

78091

1. DRILLING PERMIT NO. ~~96-98-N-184~~ D0005344
Other IDWR No. _____

2. OWNER:
Name Duane M. Fisher
Address 764 Cider Rd
City Athol State ID Zip 83801

3. LOCATION OF WELL by legal description:
Sketch map location must agree with written location.

POSTED

N / W / E / S

Twp. 54 North ☒ or South ☐
Rge. 3 East ☐ or West ☒
Sec. 28, ____ 1/4 (10 acres) NE 1/4 (40 acres) SW 1/4 (160 acres)
Gov't Lot ____ County Bonner
Lat: : : Long: : :
Address of Well Site 1 Mile from Hwy 95
Same as Above City _____
(Give at least name of road + Distance to Road or Landmark)

Lt. _____ Blk. _____ Sub. Name _____

4. USE:
☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)
☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD
☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK Material	From	To	AMOUNT Sacks or Pounds	METHOD
Bentonite	0	20+	12	overbore
casing Seal				

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 160'
Was drive shoe seal tested? ☒ Y ☐ N How? Air Pressure

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+1½	160'	¼"	Steel	☒	☐	☒	☐
4"	-7	827'	Sch 80	PVC	☐	☒	☒	☐
					☐	☐	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS
☒ Perforations Method Saw Cut
☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
807	827	3/16x6"	30	4"	PVC	☐	☒
707	727	"	30	4"	PVC	☐	☒
507	527	"	30	4"	PVC	☐	☒
307	327	"	30	4"	PVC		☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:
123 ft. below ground Artesian pressure _____ lb.
Depth flow encountered _____ ft. Describe access port or control devices: Bolted well cap

54N 3W 28

11. WELL TESTS:
☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
8½ GPM Est.			

Water Temp. Cold Bottom hole temp. Cold
Water Quality test or comments: looks Clear + Good
Depth first Water Encountered 325

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Water Y	Water N
8½	0	40	Gravel + Boulders		
8"	40	50	Gravel + Boulders		
"	50	129	Cemented Gravel		
"	129	130	Boulder		
"	130	143	Decomposed Granite + Gravel Mix		
"	143	156	Soft Granite		
"	156	160	Granite Firm		
6"	160	325	Granite Firm (Quart per minute minus)	X	
"	325	500	Granite 2 GPM	X	
"	500	705	Granite 1½ GPM	X	
"	705	827	Granite 5 GPM	X	