




Idaho Department of Water Resources

Adjudication Claim
95-10238
(DOMESTIC)

Legend

-  Point of Diversion
-  Place of Use
-  State Outline
-  Townships
-  PLS Sections
-  Quarter Quarters

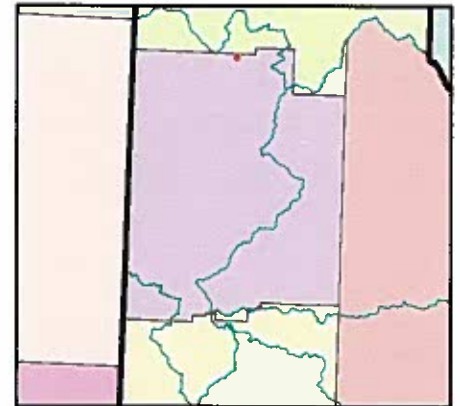

Kootenai County
IDWR Basin 95

R03W

T53N



Prepared by Bob Haynes
On March 25, 2009
2004 Aerial Photography

0 0.025 0.05 0.1 Miles

WELL DRILLER'S REPORT

RECEIVED

Office Use Only	
Inspected by <u>RGH</u>	
Twp <u>53N</u> Rge <u>3W</u> Sec <u>3</u>	
<u>1/4 NW 1/4 SW 1/4</u>	
Lat: : : Long: : :	

1. WELL TAG NO. D0022021 27 2002

Drilling Permit No: 772-867

Other IDWR No. DWPN/North

2. OWNER


Name LARRY SPENCER Well Number: 355

Address 10276 CAMP COURT

City HAYDEN State ID Zip 83835

3. LOCATION OF WELL by legal description

sketch map location must agree with written location

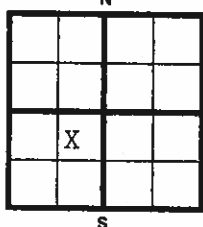

Twp. 53N ☒ North or ☐ South
Rge. 3W ☐ East or ☒ West
Sec. 3 NE 1/4 SW 1/4 1/4

Gov't Lot _____ County KOOTENAI

Lat: : : Long: : :

Address of Well Site

City ATHOL

(Give at least name of road + Distance to Road or Landmark)

Lt. _____ Blk. _____ Sub. Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
BENTONITE	0	18	8 BAGS	OVERBORE

Was drive shoe used? ☐ Y ☒ N Shoe Depth(s) RIN

Was drive shoe seal tested? ☐ Y ☐ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner Welded	Threaded
6	+2	380	.250	STEEL	☒	☐	☒

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☐ Perforations Method _____

☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

300 ft. below ground Artesian pressure _____ lb.

Depth flow encountered 360 ft. Describe access port or control devices: _____

11. WELL TESTS:

☐ Pump ☐ Bailor ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
15			1 HR.

Water Temp. COLD Bottom Hole Temp COLD

Water Quality test or comments: CLEAR

Depth first Water encountered 360

12. LITHOLOGIC LOG:(Describe repairs or abandonment)

				Water	
Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Y	N
10	0	3	Top Soil	☐	☐
10	3	18	Gravels Sand, Clay	☐	☐
8	18	170	Gravels, Sand	☐	☐
8	170	178	Boulder	☐	☐
8	178	183	Gravels	☐	☐
8	183	197	Gravels, Tan Clay	☐	☐
8	197	203	Gravels Gray Clay	☐	☐
8	203	297	Gravels, Sand	☐	☐
8	297	320	Gravels, Sand Some H2O	☒	☐
8	320	380	Gravels, Sand w/H2O	☒	☐

OFFICE USE ONLY

Inspected by RGH

Twp 53N Rge 3W Sec 3

1/4 NW 1/4 SW 1/4

SCANNED

JAN 14 2003

Completed Depth 380 (Measurable)

Date: Started 1/14/02 Completed 1/16/02

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name H2O WellService, Inc. Firm No. 448

Firm Official [Signature] Date 1-20-02

and Supervisor or Operator [Signature] Date 1-20-02

(Sign Once if Firm Official and Operator)

Mark Penick

53N 3W 3