


BROWN PIN 0-2290-001-002-0

RECEIVED

DEC 23 2009

IDWR/NORTH

D 0040165
Well TAG No.

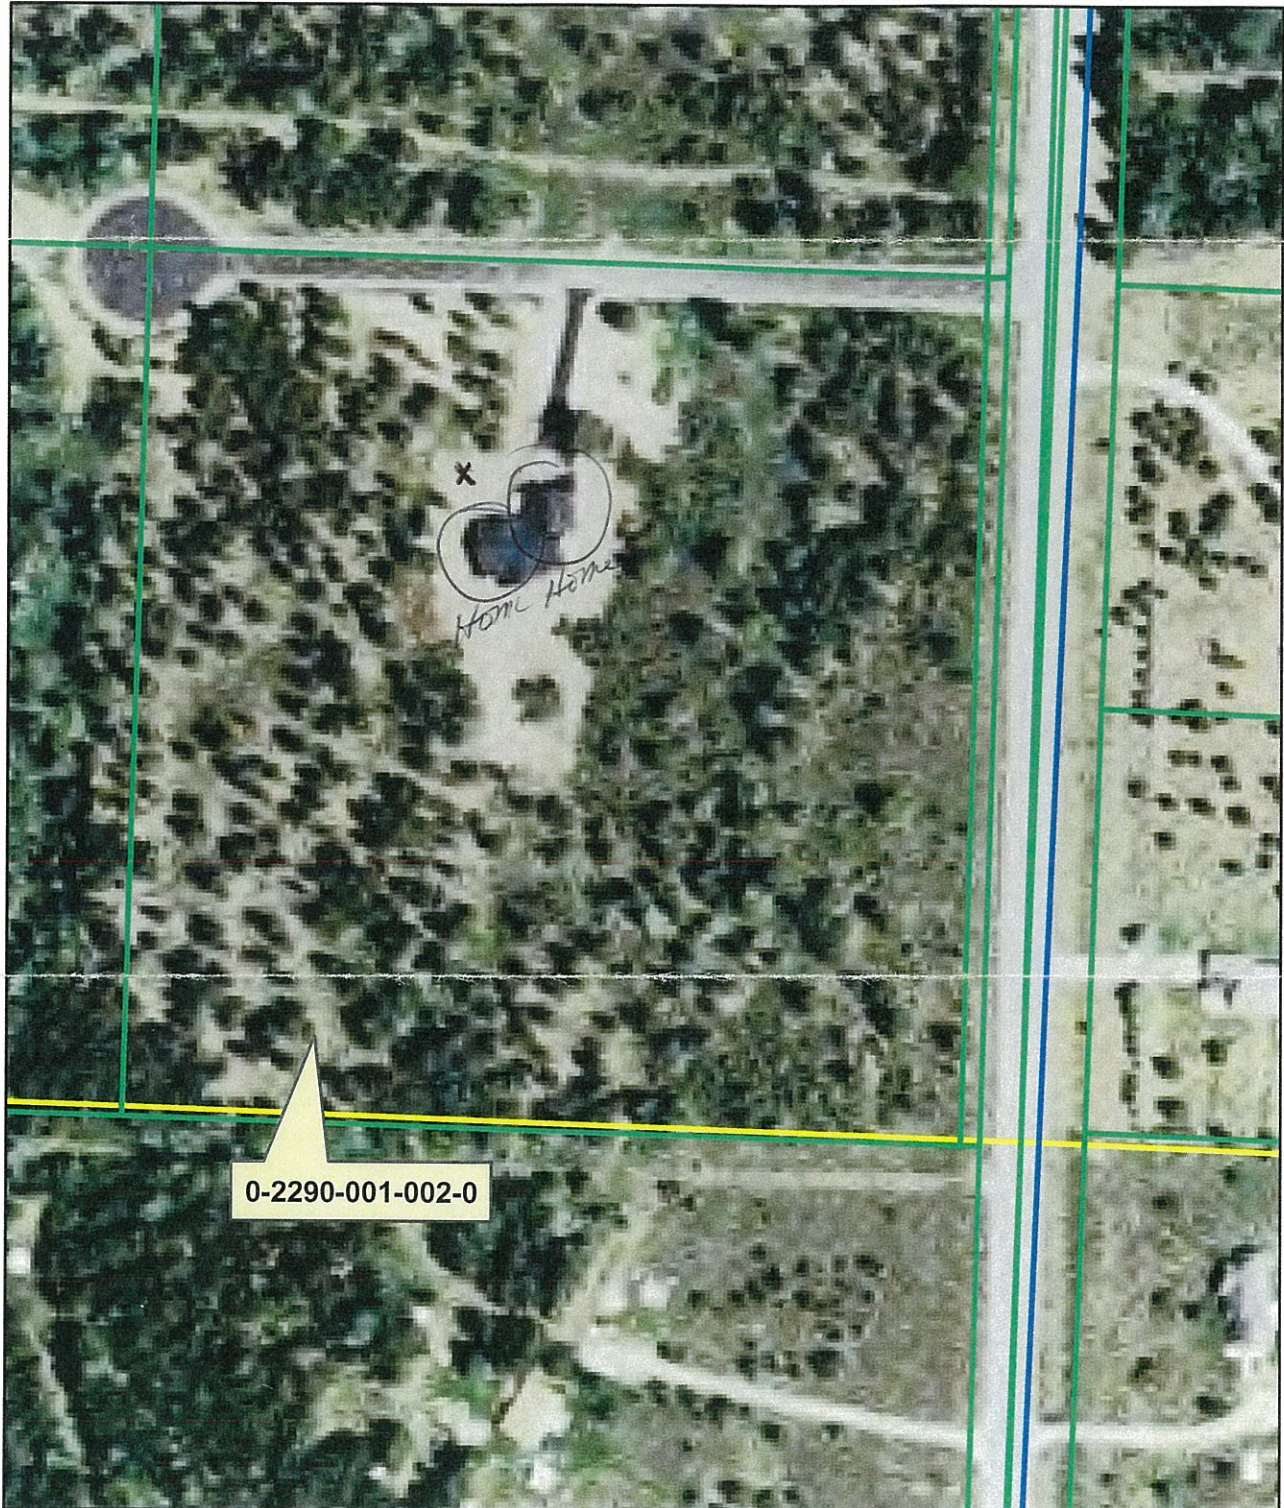

IDAHO DEPARTMENT OF WATER RESOURCES
- WELL DRILLER'S REPORT

Office Use Only					
Inspected by _____					
Twp _____		Rge _____		Sec _____	
1/4 _____		1/4 _____		1/4 _____	
Lat: : :		Long: : :			

2. OWNER:

2. OWNER:
Name Grosselauer Corp #1
Address P.O. Box 3082 State ID Zip 83835
City Hayden

City Hayden State WY

3. LOCATION OF WELL by legal description:
Sketch map location must agree with written location

W 
 E Twp. 53 North ☒ or South ☐
Rge. 3 East ☐ or West ☒
Sec. 30 $\frac{1}{4}$ SE 1/4 NE 1/4
 10 acres 40 acres 160 acres

Gov't lot Country Kootenai

Lat: 47:54:770 _____ Long: 116:44:645 _____

Address of Well Site Claymore Rd South of
Season's Rd City Athol
(Print or hand address of road & distance to local or landmark)

Blk. _____ Sub. Name _____

4. USE:

SE: ☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Infection ☐ Other

5. TYPE OF WORK check all that apply (Replacement etc.)
☒ New Well ☐ Modify ☐ Abandonment ☐ Other

6. DRILL METHOD
☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
Resonantite	0	20	2500lb	Dry granular

Was drive shoe used? ☐ Y ☒ N Shoe Depth (in) _____
Was drive shoe seal tested? ☐ Y ☒ N How? _____

8. CASING LITER:

3. CASING/LINER					
Diameter	From	To	Depth	Material	Casing Liner Welded Threaded
6"	+2	43R	250	Steel	☒ ☐ ☒ ☐
					☐ ☐ ☐ ☐
					☐ ☐ ☐ ☐

Length of Headpipe _____ Length of Tailpipe _____

9 PERFORATIONS/SCREENS

☐ Perforations Method _____

☐ Screens Screen Type _____

From	To	Elm Size	Number	Diameter	Material	Casing	Lines
						☐	☐
						☐	☐
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

123 ft. below ground
Depth flow encountered _____ ft.
device _____

Arterial Pressure _____ lb
Describe access port or control _____

11. WELL TESTS:

ALL TESTS:
☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield (gal/min)	Diameter (in)	Pressure (psi)	Time (min)
30 ±			2 Hrs

Water Temp. _____ Bottom hole temp. _____
 Water Quality test or comment: Cold and Clear
 Depth first Water Encountered 430'

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

WILEY

Water			Remarks/Lithology, Water Quality & Temp.	Y	N
Bore Dia.	From	To			
10"	0	1	Top soil		
	1	20	Gravel, coarse, silt, brown		
8"	20	46	Gravel, coarse		
	46	73	Gravel, cobbles		
	73	86	Boulders		
	86	112	Gravel, cobbles		
	112	120	Sand, gray, gravel		
	120	147	Gravel, coarse, sand, grey		
	147	169	Gravel, medium		
	169	196	Gravel, silt, brown		
	196	199	Clay, gravel		
	199	232	Gravel, sand		
	232	278	Gravel, coarse		
	278	286	Boulders, cobbles		
	286	287	Boulder		
	287	312	Gravel, sand		
	312	326	Clay, brownish-tan, gravel		
	326	346	Gravel, sand, grey		
	346	359	Gravel, coarse		
	359	378	Gravel, sand, grey, brown		
	378	390	Gravel, coarse, silt, brown		
	390	416	Gravel, coarse, sand		
	416	428	Gravel, sand, coarse		
	428	432	Clay, tan, sand, gravel		
	432	438	Gravel, sand, coarse		
	438	440	Gravel, coarse		

Completed Depth: 438 (Measurable)
Date Started 5/23/05 Completed 5/24/05

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name McCarty Drilling & Pump Inc

File No. 586

From Officials

Date 5/25/05

Supervisor or Operator

Date

(Sign once if Flare Official & Operator)

COPY