

RECEIVED

IDAHO DEPARTMENT OF WATER RESOURCES

OCT 10 1997

WELL
POSTED

DRILLER'S REPORT

Use Typewriter or Ballpoint Pen

097045

Office Use Only			
Inspected by <u>TAK</u>			
Twp. <u>SE 1/4</u>	Rge. <u>SE 1/4</u>	Sec. <u>SE 1/4</u>	
Lat. <u>SE 1/4</u>	Long. <u>SE 1/4</u>		


1. DRILLING PERMIT NO. 00003238Other IDWR No. IDWR

2. OWNER

Name OSWALD, BOBWell Number: 607Address PO BOX 3201City HAYDEN LAKE State ID Zip 83835

3. LOCATION OF WELL by legal description

sketch map location must agree with written location

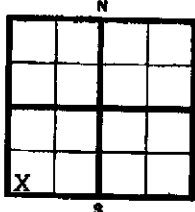

Twp. 53 ☒ North or ☐ South
 Rge. 02 ☐ East or ☒ West
 Sec. 16 1/4 SW 1/4 SW 1/4

Gov't Lot _____ County KOOTENAI

Lat: _____ Long: _____

Address of Well Site TWETE RD.City ATHOL

(Give at least name of road + Distance to Road or Landmark)

Bk. _____ Sub. Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To		
BENTONITE	0	28	8 SACKS	DRY

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 28Was drive shoe seal tested? ☐ Y ☐ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6	+2	-28	.250	STEEL	☒	☐	☒	☐
4	-20	-200	.160	PVC	☒	☐	☒	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☒ Perforations Method SKILLSAW☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
-180	-200	1/8X6	44	4	PVC	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

45 ft. below ground Artesian pressure _____ lb.

Depth flow encountered _____ ft. Describe access port or control devices: _____

11. WELL TESTS:

☐ Pump	☐ Bailer	☒ Air	☐ Flowing Artesian
Yield gal./min.	Drawdown	Pumping Level	Time
14			

Water Temp. _____ Bottom Hole Temp _____

Water Quality test or comments: _____

Depth first Water encountered _____

12. LITHOLOGIC LOG:(Describe repairs or abandonment)

Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Water	
				Y	N
8	0	3	TOPSOIL	☐	☒
8	3	28	Granite Brown Decomposed	☐	☒
6	28	80	Granite Brown Soft	☒	☐
6	80	140	Granite Gray Black & white	☐	☒
6	140	160	Granite Gray soft	☒	☐
6	160	200	Granite Gray Black & White	☐	☒

Completed Depth 200' (Measurable)Date: Started 9/29/97 Completed 9/29/97

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the pig was removed.

Firm Name H2O WellService, Inc. Firm No. 448Firm Official [Signature] Date 9/29/97

and

Supervisor or Operator [Signature] Date 9/29/97

(Sign Once if Firm Official and Operator)

(Jim McLeslie)

SWSW 16 53N 2W

SCANNED

JUL - 6 2009