Form 238-7
3/95

POSTED

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Use Typewriter or Ballpoint Pen

097131

Office Use Only
Inspected by _____
Twp____ Rge____ Sec____
____1/4 ____1/4 ____1/4
Lat: : : Long: : :

1. DRILLING PERMIT NO. 95 - 96 - N 172 - 000
Other IDWR No. _____

2. OWNER:
Name BRIT BURNS #2
Address 1127 MARIE #21
City Coeur d'Alene State ID Zip 83814

3. LOCATION OF WELL by legal description:
Sketch map location must agree with written location.

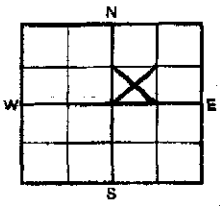

Twp 51N North ☒ or South ☐
Rge 5W East ☐ or West ☒
Sec 10, ____ 1/4 S/W 1/4 N/E 1/4
(10 acres, 40 acres, 160 acres)
Gov't Lot ____ County Kootenai
Lat: : : Long: : :
Address of Well Site CHASE RD TO THE NORTH OF 53
(Give at least name of road + Distance to Road or Landmark) City _____

Lt. _____ Blk. _____ Sub. Name _____

4. USE:
☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)
☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD
☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
Bentonite	0	-20	9 sacks	pour in

Was drive shoe used? ☒Y ☐ N Shoe Depth(s) 60'
Was drive shoe seal tested? ☐Y ☒N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+1	-60	.625	steel	☒	☐	☒	☐
4"	-40	-200		PVC	☐	☒	☐	☐
					☐	☐	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS
☐ Perforations Method drill
☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
-140	-200		200	3/8"	PVC	☐	☒
						☐	☐
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:
45 ft. below ground Artesian pressure _____ lb.
Depth flow encountered 85/120 ft. Describe access port or control devices: steel cap welded

SW NE 10 51N 5W

11. WELL TESTS:
☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
40-45 gpm	100%	200'	2 hrs.

Water Temp. cold Bottom hole temp. cold
Water Quality test or comments: clear, cold, no smell
Depth first Water Encountered 65'

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Water Y	Water N
8"	0	4	topsoil		X
8"	4	12	Topsoil & clay		X
8"	12	17	sand & clay & gravel		X
8"	17	25	decomposed granite		X
8"	25	50	decomposed granite - very broken		X
8"	50	62	brown & white granite - medium to soft		X
8"	62	63	brown & white granite - soft (water 2.5 gpm)	X	
8"	63	65	brown & white granite - medium		X
8"	65	120	purple & white granite - medium		X
8"	120	121	purple & white granite - soft - (water 40 gpm)	X	
8"	121	200	purple & white granite - medium to soft		X

mine

RECEIVED
JAN 02 1998
NORTH... REGION
IDWR

Completed Depth 200' (Measurable)
Date: Started 11/14/98 Completed 11/15/98

13. DRILLER'S CERTIFICATION
I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name United Drilling Inc. Firm No. 414
Firm Official _____ Date 11/15/98
and
Supervisor or Operator Jason C. Beckham Date 11/15/98
(Sign once if Firm Official & Operator)

EDWARD HAITE CO., INC. WATER RESOURCES