

RECEIVED

IDAHO DEPARTMENT OF WATER RESOURCES

## WELL DRILLER'S REPORT

097800

Use Typewriter or Ballpoint Pen

Office Use Only

Inspected by \_\_\_\_\_

Twp \_\_\_\_\_ Rge \_\_\_\_\_ Sec \_\_\_\_\_

1/4 1/4 1/4

Lat: \_\_\_\_\_ Long: \_\_\_\_\_

## 1. DRILLING PERMIT NO. 95-96-N-028-000

Other IDWR No. \_\_\_\_\_

## 2. OWNER

Name STEADY, TIM

Well Number:

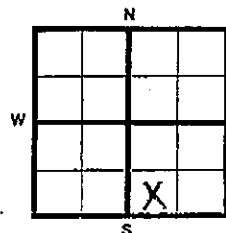
377

Address W 6715 HIGHLAND DR

City CDA State ID Zip 83814

## 3. LOCATION OF WELL by legal description

sketch map location must agree with written location

Twp. 50 ☒ North or ☐ SouthRge. 04 ☐ East or ☒ West

Sec. 07 1/4 SW 1/4 SE 1/4

Gov't Lot \_\_\_\_\_ County KOOTENAI

Lat: \_\_\_\_\_ Long: \_\_\_\_\_

Address of Well Site W 6715 HIGHLAND DR.

City CDA

(Give at least name of road + Distance to Road or Landmark)

Lt. \_\_\_\_\_ Blk. \_\_\_\_\_ Sub. Name \_\_\_\_\_

## 4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation  
☐ Thermal ☐ Injection ☐ Other \_\_\_\_\_

## 5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other \_\_\_\_\_

## 6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other \_\_\_\_\_

## 7. SEALING PROCEDURES

| SEAL/FILTER PACK |      |    | AMOUNT          | METHOD       |
|------------------|------|----|-----------------|--------------|
| Material         | From | To | Sacks or Pounds |              |
| BENTONITE        | 0    | 18 | 10 BAGS         | OVERBORE DRY |
|                  |      |    |                 |              |
|                  |      |    |                 |              |

Was drive shoe used? ☐ Y ☐ N Shoe Depth(s) \_\_\_\_\_Was drive shoe seal tested? ☐ Y ☐ N How? \_\_\_\_\_

## 8. CASING/LINER:

| Diameter | From | To  | Gauge | Material | Casing                              | Liner                               | Welded                              | Threaded                 |
|----------|------|-----|-------|----------|-------------------------------------|-------------------------------------|-------------------------------------|--------------------------|
| 6        | +2   | 18  | .250  | STEEL    | <input checked="" type="checkbox"/> | <input type="checkbox"/>            | <input checked="" type="checkbox"/> | <input type="checkbox"/> |
| 4        | -9   | 124 | .160  | PSI/PVC  | <input type="checkbox"/>            | <input checked="" type="checkbox"/> | <input type="checkbox"/>            | <input type="checkbox"/> |
|          |      |     |       |          |                                     |                                     |                                     |                          |

Length of Headpipe \_\_\_\_\_ Length of Tailpipe \_\_\_\_\_

## 9. PERFORATIONS/SCREENS

☒ Perforations Method SKILLSAW☐ Screens Screen Type \_\_\_\_\_

| From | To  | Slot Size | Number | Diameter | Material | Casing                   | Liner                               |
|------|-----|-----------|--------|----------|----------|--------------------------|-------------------------------------|
| 84   | 124 | 1/8X4     | 140    | 4        | PVC      | <input type="checkbox"/> | <input checked="" type="checkbox"/> |
|      |     |           |        |          |          |                          |                                     |
|      |     |           |        |          |          |                          |                                     |

## 10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

45 ft. below ground Artesian pressure \_\_\_\_\_ lb.

Depth flow encountered \_\_\_\_\_ ft. Describe access port or control devices:

SWSE 7 50N 4W

## 11. WELL TESTS:

☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

| Yield gal./min. | Drawdown | Pumping Level | Time |
|-----------------|----------|---------------|------|
| 7 GPM           |          |               |      |
|                 |          |               |      |
|                 |          |               |      |

Water Temp. \_\_\_\_\_ Bottom Hole Temp \_\_\_\_\_

Water Quality test or comments: \_\_\_\_\_

Depth first Water encountered \_\_\_\_\_

## 12. LITHOLOGIC LOG:(Describe repairs or abandonment)

|              |      |     |                                                | Water                               |                                     |
|--------------|------|-----|------------------------------------------------|-------------------------------------|-------------------------------------|
| Bore<br>Diam | From | To  | Remarks: Lithology, Water Quality, Temperature | Y                                   | N                                   |
| 10           | 0    | 1   | Fill                                           | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 10           | 1    | 6   | Boulders                                       | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 10           | 6    | 9   | Soils                                          | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 10           | 9    | 18  | Soils                                          | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 18   | 24  | Granite Copper W/White                         | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 24   | 28  | Granite White & Green                          | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 28   | 37  | Granite White & Copper                         | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 37   | 40  | Granite White & Green                          | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 40   | 42  | Granite Black & Copper W/Green                 | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 42   | 56  | Granite White Black & Copper                   | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 56   | 67  | Granite Black Some Copper                      | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 67   | 70  | Granite White                                  | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 70   | 97  | Granite Black & Copper                         | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |
| 6            | 97   | 99  | Granite Black & Copper W/Water 7gp             | <input checked="" type="checkbox"/> | <input type="checkbox"/>            |
| 6            | 99   | 124 | Granite Black & Copper                         | <input type="checkbox"/>            | <input checked="" type="checkbox"/> |

Completed Depth 124' (Measurable)

Date: Started 04/24/96 Completed 04/24/96

## 13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name H2O WellService, Inc. Firm No. 448

Firm Official John Whelan Date 4-30-96

and Supervisor or Operator J.E. Date 4-30-

(Sign Once if Firm Official and Operator)