


DENNY CHAD & MARIE PIN RP46N04W30660BA

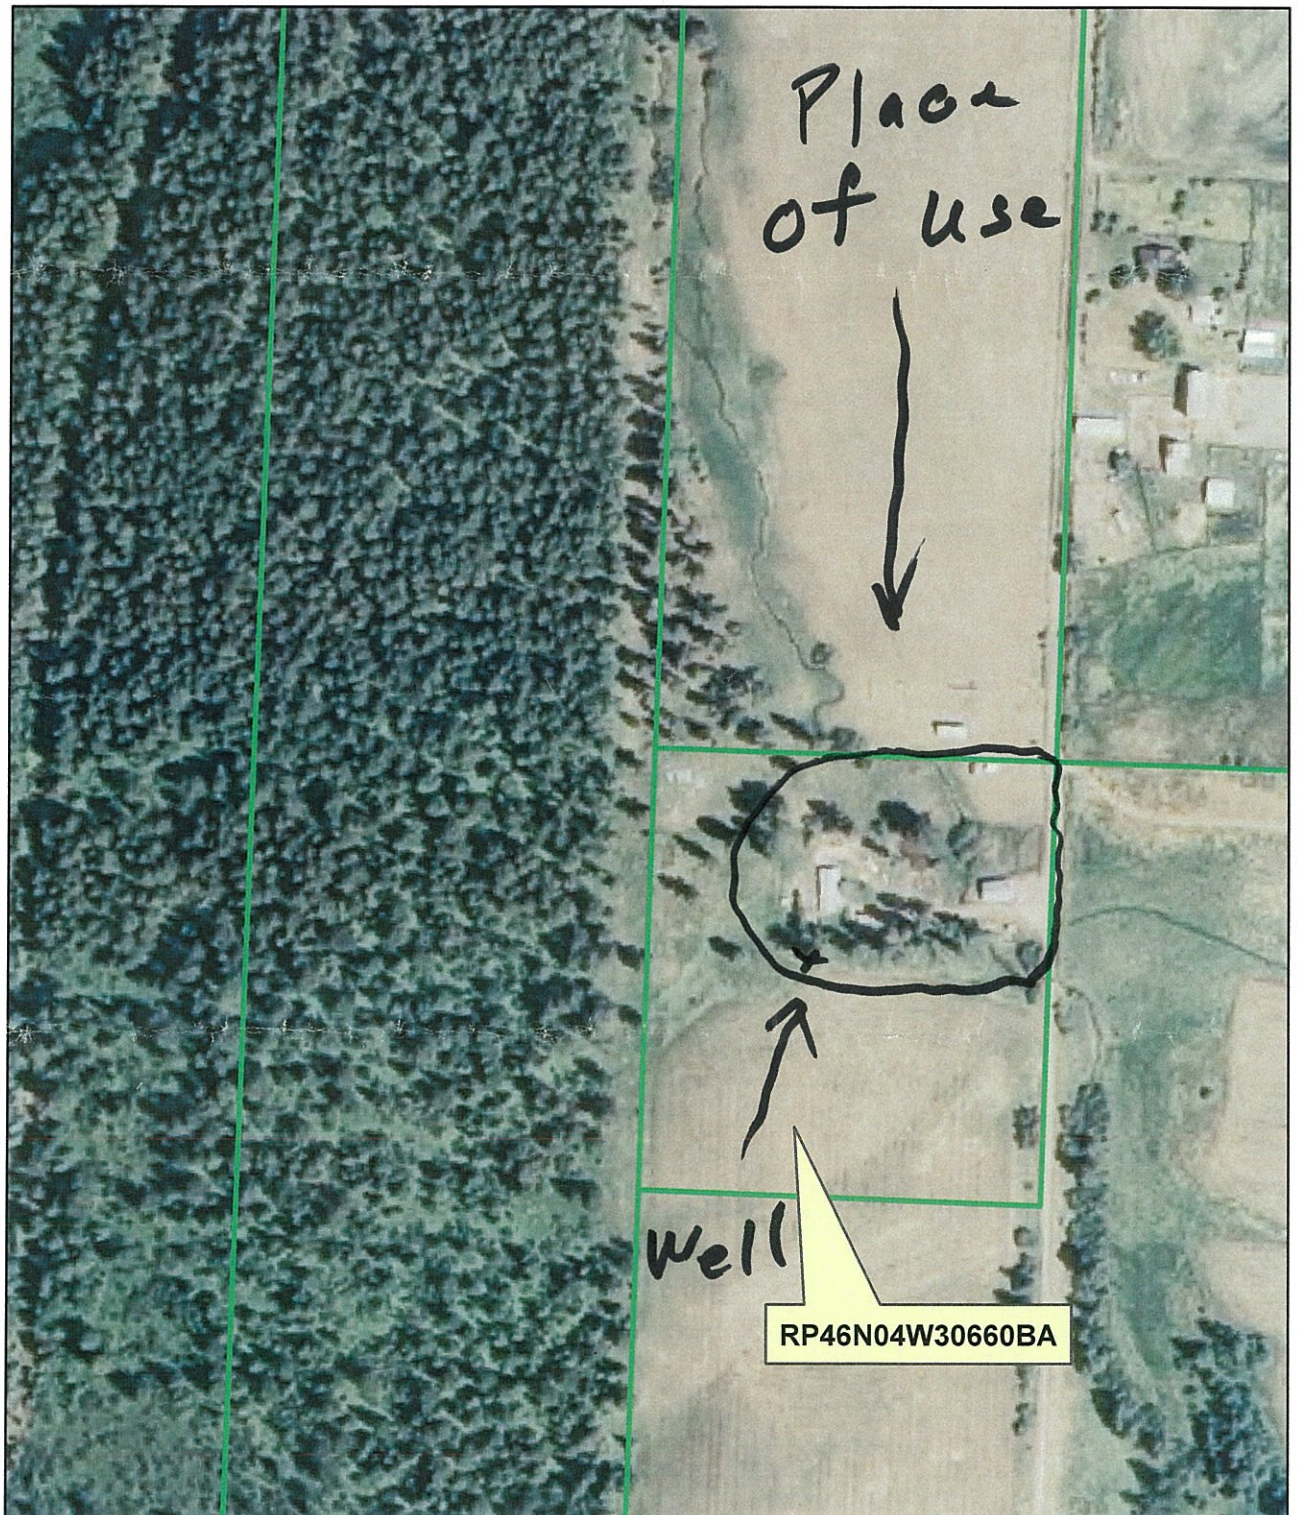

RECEIVED

Form 238
11/97

JUL 06 2000

IDAHO DEPARTMENT OF WATER RESOURCES

IDWR/North

WELL DRILLER'S REPORT

1. WELL TAG NO. D D0013268

DRILLING PERMIT NO. _____

Other IDWR No. 764877

2. OWNER:

Name Chad Denny
Address 499 Johnson Lane
City Plummer State ID Zip 83851

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

N		Twp. <u>46</u>		North ☒ or South ☐	
W		Rge. <u>4</u>		East ☐ or West ☒	
E		Sec. <u>30</u>		1/4 <u>S/W</u> 1/4 <u>S/W</u> 1/4	
S		Gov't Lot _____		County _____	
		Lat: _____		Long: _____	
		Address of Well Site <u>499 Johnson Lane</u>			
		<u>1 mile up Johnson Lane</u>		City <u>Plummer</u>	

(Give at least name of road + distance to road or landmark)

Lt. _____ Blk. _____ Sub. Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT		METHOD
Material	From	To	Sacks or Pounds		
Bentonite	0	138	14		Pour around pipe

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 138

Was drive shoe seal tested? ☐ Y ☒ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6	2	138		Steel	☒	☐	☒	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

Perforations Method Drill
Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
140	180	1/2"	40	4	PVC	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

39 ft. below ground Artesian pressure _____ lb.

Depth flow encountered _____ ft. Describe access port or

control devices: Well Cap

46N 4W 30

FORWARD WHITE COPY TO WATER RESOURCES

Office Use Only			
Inspected by _____			
Twp _____	Rge _____	Sec _____	
_____ 1/4	_____ 1/4	_____ 1/4	
Lat: _____	Long: _____		

11. WELL TESTS:

☐ Pump ☐ Bailor ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
15 gal/min	air lift	from 200'	

Water Temp. 53° Bottom hole temp. _____

Water Quality test or comments: _____

Depth first Water Encounter 140

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Water
8"	0	5	Top Soil	☒
	5	17	Clay Tan Sandy	☒
	17	53	Clay Tan w/ Basalt	☒
	53	60	Sand Stone - Tan	☒
	60	200	Sand Stone - Brown	☒
			15 g.p.m. from 140 to 200	

Completed Depth 200 (Measurable)
Date: Started 6-21-2000 Completed 6-23-2000

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name Altman Drilling Inc Firm No. 560
Firm Official Steve R. Woff Date 6-30-00
and Altman Corrao Date 6-23-2000
Driller or Operator

(Sign once if Firm Official & Operator)