Form 238-7
7/98
Starships Consulting and Management Services

IDAHO DEPARTMENT OF WATER RESOURCES

WELL DRILLER'S REPORT

POSTED


94105

Office Use Only
Inspected by_____
Twp_____Rge_____Sec_____
_____1/4_____1/4_____1/4
Lat: : : Long: : :

1. WELL TAG NO. D10508
Drilling Permit No: 95-99-N-146-000
Other IDWR No.

2. OWNER **Well Number:** 928
Name ELSTON, RICHARD #2
Address W 3312 CONNAUGHT
City SPOKANE State WA Zip 99205

3. LOCATION OF WELL by legal description
sketch map location must agree with written location

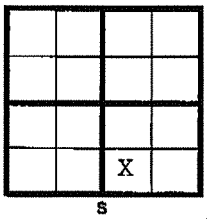

Twp. 51 ☑ North or ☐ South
Rge. 03 ☐ East or ☑ West
Sec. 22 1/4 SW 1/4 SE 1/4
Gov't Lot_____ County KOOTENAI
Lat: : : Long: : :
Address of Well Site 8508 S Hayden Lake
City Hayden
(Give at least name of road + Distance to Road or Landmark)
Lt._____ Blk._____ Sub. Name _____

4. USE:
☑ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement, etc.)
☑ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD
☑ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK Material	From	To	AMOUNT Sacks or Pounds	METHOD
BENTONITE	0	50	5 bags	30' overbore

Was drive shoe used? ☑ Y ☐ N Shoe Depth(s) 55
Was drive shoe seal tested? ☐ Y ☐ N How?_____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
0					☐	☐	☐	☐
6	+2	55	.250	STEEL	☑	☐	☑	☐
4	-5	320	.160	PVC	☐	☑	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS
☑ Perforations Method SKILLSAW
☐ Screens Screen Type_____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
283	323	1/8X4	170	4	PVC	☐	☑

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:
160 ft. below ground Artesian pressure_____ lb.
Depth flow encountered_____ ft. Describe access port or control devices: _____

5/N 3W 22

11. WELL TESTS:
☐ Pump ☐ Bailer ☑ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
4 GPM		320	1 HR

Water Temp._____ Bottom Hole Temp _____
Water Quality test or comments: _____
_____ Depth first Water encountered_

12. LITHOLOGIC LOG:(Describe repairs or abandonment)

Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Water Y	Water N
8	0	55	Granite Soft W/Quartz Cobble	☐	☑
6	55	287	Granite Salt & Pepper Medium	☐	☑
6	287	295	Granite Salt & Pepper W/Green W/Wat	☑	☐
6	295	320	Granite Salt & Pepper Medium	☐	☑

RECEIVED
FEB 11 2000
IDWR/North

Completed Depth 320' (Measurable)
Date: Started 8/27/99 Completed 8/27/99

13. DRILLER'S CERTIFICATION
I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name H20 WellService, Inc. Firm No. 448
Firm Official John Wheeler Date 08/27/99
and
Supervisor or Operator Louie Hanner Date 08/27/99
(Sign Once if Firm Offical and Operator)

SCANNED
NOV 16 2009