


State of Idaho
Department of Water Resources
Adjudication Claim
95-11687

Water Service Area Boundary for Douglas Delano

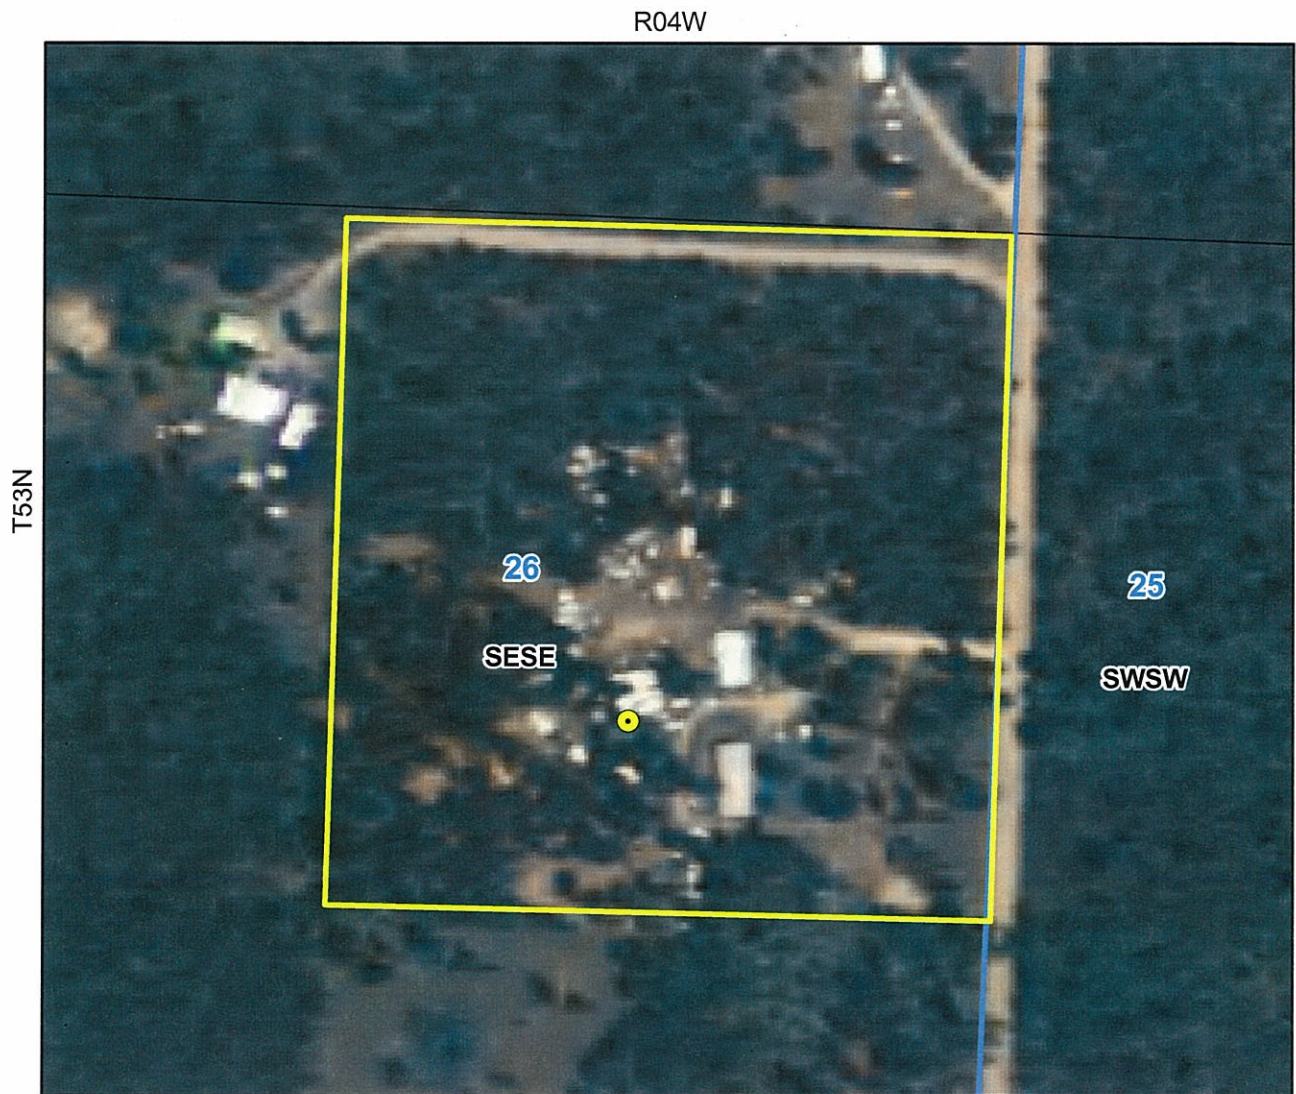

Legend

-  Point of Diversion
-  Place Of Use Boundary
-  Townships
-  PLS Sections
-  Quarter Quarters

0 0.02 0.04 0.08 Miles



2/9/95 do
RECEIVED

Form 255-1
1/94

JAN 19 1995

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

OFFICE USE ONLY

Use Typewriter
Inspected by TPA
Ball Point Pen
Top 53N 26 4W Sec 2
USE 14 SE 14

1. DRILLING PERMIT NO.

96 - 94 - N - 467

Other IDWR No.

2. OWNER:

Name BOB DELANO

Address 25905 Weir Rd.

City Athol, ID 83801 State Idaho Zip 83801

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

Sketch map location must agree with written location.

N
W
E
S

Top 53N 26 4W Sec 2
Gov't Lot 10 County Blaine

Address of Well Site 25905 WEIR RD.

(Give at least name of road + Distance to Road or Landmark)

Lt. 10 Blk. 10 Sub. Name 10

4. PROPOSED USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other

5. TYPE OF WORK

☒ New Well ☐ Modify or Repair ☐ Replacement ☐ Abandonment

6. DRILL METHOD

☐ Mud Rotary ☒ Air Rotary ☐ Cable ☐ Other

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT		METHOD
Material	From	To	Sacks or Pounds		
Benny	0	40	30		sacks

Was drive shoe used? ☒ Y ☐ N

Was drive shoe seal tested? ☐ Y ☐ N How?

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+2	463	.250	steel	☐	☐	☒	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☒ Perforations Method Down Hole Perforator
☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
443	463	1/8x2	300			☒	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

_____ ft. below ground Artesian pressure _____ lb.
Depth flow encountered _____ ft. Describe access port or control devices: SWSW 26 53N 4W

11. WELL TESTS:

☐ Pump ☐ Bailor ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
20			

Water Temp. _____ Bottom hole temp. _____

Water Quality test or comments: _____

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Wat
10"	0	1	Topsoil	
	1	4	Dirt gravel	
	4	43	Cobbles gravel	
	43	77	Boulders	
	77	84	Sand gravel	
	84	113	Boulders gravel	
	113	124	Boulders	
	124	218	Cobbles gravel	
	218	230	Boulders	
	230	254	Cobbles gravel	
	254	268	Gravel	
	268	273	Cobbles	
	273	345	Boulders cobbles	
6"	345	355	Boulders	
	355	373	Gravel	
	373	380	Boulders	
	380	463	Gravel	X

009023

MICROFILMED

DEC 29 1998

Completed Depth 463 (Measurable)
Date Started 1/12/95 Completed 1/12/95

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with the time the rig was removed.

Firm Name PONDEROSA DRILLING & DEVELOPMENT

Firm Official Brad Foreman Date 1/16/96

Supervisor or Operator BRAD FOREMAN Date 1/13/95

(Sign once if Firm Official & Operator)

95-11687

	HP	Efficiency as a decimal	System pressure in PSI	Pumping lift in feet	H in feet
$Q = \text{HP} \cdot 8.8 \cdot \text{Eff} / H$	10	0.7	45	430	534.0816327
$Q =$	0.116 cfs				