

BROWNING, PIN 50N02W16-7000



IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Office Use Only			
Inspected by			
Twp	Rge	Sec	
1/4	1/4	1/4	1/4
Lat	:	Long	:

1. DRILLING PERMIT NO. _____

Other IDWR No. D0040315

2. OWNER:

835130

Name Carol Browning

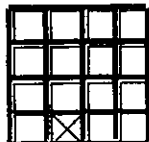
Address 1145 S Wolf Lodge Creek Rd

City Coeur d'Alene State ID Zip 83814

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location

N

W		E	Twp. <u>50</u> North ☒ or South ☐
			Rge. <u>2</u> East ☐ or West ☒
			Sec. <u>16</u> 1/4 SE 1/4 SW 1/4 10 acres 40 acres 160 acres

Gov't lot _____ County Kootenai

Lat: 47:40:592 Long: 116:36:187

Address of Well Site 1145 S Wolf Lodge Creek Rd

City Coeur d'Alene

(Give at least name of road + Distance to Road or Landmark)

Lt. _____ Blk. _____ Sub. Name _____

4. USE:

- ☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other

5. TYPE OF WORK check all that apply (Replacement etc.)

- ☒ New Well ☐ Modify ☐ Abandonment ☐ Other

6. DRILL METHOD

- ☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
Bentonite	0	18	400lbs	Dry granular

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 103

Was drive shoe seal tested? ☐ Y ☒ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+3	106	250	Steel	☒	☐	☒	☐
					☐	☐	☐	☐
					☐	☐	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☐ Perforations Method _____

☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
						☐	☐
						☐	☐
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

3 ft. below ground

Artesian Pressure _____ lb

Depth flow encountered _____ ft. Describe access port or control devices: _____

11. WELL TESTS:

- ☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal/min.	Drawdown	Pumping Level	Time
30+ GPM			2 HRS

Water Temp. _____ Bottom hole temp. _____

Water Quality test or comments: Cold and Clear

Depth first Water Encountered 16'

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Water				Y	N
Bore Dia	From	To	Remarks: Lithology, Water Quality & Temp.		
10"	0	6	Clay, brown		
	6	12	Clay, Gravel		
	12	18	Clay, Gravel, wet	☒	
8"	18	28	Clay, reddish brown		
	28	33	Clay, Sand, Gravel, brown		
	33	49	Quicksand, tan		
	49	68	Clay, Gravel		
	68	73	Gravel, Clay	☒	
	73	78	Clay, reddish brown		
	78	88	Gravel, tan, Clay, brown	☒	
	88	96	Clay, gravel		
	96	100	Gravel, Clay	☒	
	100	104	Gravel, tan w/silt	☒	

RECEIVED
SEP 06 2005
IDWR/North

RECEIVED
AUG 20 2005
IDWR/North

RECEIVED
NOV 04 2005
IDWR/North

Completed Depth: 104

(Measurable)

Date: Started 8/4/05

Completed 8/4/05

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name McCarty Drilling & Pump Inc

Firm No. 586

Firm Official: _____

Date 8/5/05

Supervisor or Operator _____

Date _____

(Sign once if Firm Official & Operator)

50 N 2W 16