


WELL DRILLER'S REPORT

Office Use Only		
Inspected by		
Twp	Rge	Sec
1/4	1/4	1/4
Lat:	:	Long:

1. WELL TAG NO. D0028146
Drilling Permit No: 793146
Other IDWR No. IDWB/North

2. OWNER Well Number:
Name DARRELL REYNOLDS / GUYER CO 546
Address 5005 W. COUGAR EST. RD.
City COEUR D' ALENE State ID Zip 83814

3. LOCATION OF WELL by legal description
sketch map location must agree with written location

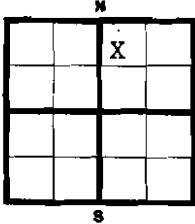

Twp. 50 North or South
Rge. 5 East or West
E Sec. 10 NW 1/4 NE 1/4
Gov't Lot County KOOTENAI
Lat: Long:

Address of Well Site THERESA TERRACE
City POST FALLS

(Give at least name of road + Distance to Road or Landmark)

Lt. Blk. Sub. Name

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other

5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To		
Material	From	To	Sacks or Pounds	
DRY GRANULE				
BENTONITE	0	18	4 BAGS	OVERBORE

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 18

Was drive shoe seal tested? ☐ Y ☒ N How?

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6	0	18	.250	STEEL	☒	☐	☒	☐

Length of Headpipe Length of Tailpipe

9. PERFORATIONS/SCREENS

☐ Perforations Method

☐ Screens Screen Type

From	To	Slot Size	Number	Diameter	Material	Casing	Liner

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

0 ft. below ground Artesian pressure lb.
Depth flow encountered 0 ft. Describe access port or control devices:

50 N 5 W 10

11. WELL TESTS:

☐ Pump ☐ Bailer ☐ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
0			0

Water Temp. N/A Bottom Hole Temp. N/A

Water Quality test or comments: N/A

Depth first Water encountered 0

12. LITHOLOGIC LOG:(Describe repairs or abandonment)

Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Water	
				Y	N
8	0	18	Granite White w/ Black	☐	☒
6	18	64	Granite White w/ Black	☐	☒
6	64	91	Granite Grayish White	☐	☒
6	91	176	Granite White w/ Black	☐	☒
6	176	189	Granite Black	☐	☒
6	189	261	Granite White w/ Black	☐	☒
6	261	290	Granite Black	☐	☒
6	290	401	Granite White w/ Black	☐	☒
6	401	440	Granite Grayish White	☐	☒
6	440	601	Granite White w/ Black	☐	☒
6	601	626	Granite Black	☐	☒
6	626	682	Granite White w/ Black	☐	☒
6	682	704	Granite Grayish White	☐	☒
6	704	719	Granite Black	☐	☒
6	719	841	Granite White w/ Black	☐	☒

Completed Depth 841 (Measurable)

Date: Started 3/3/03 Completed 3/6/03

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name H2O Well Service, Inc. Firm No. 448
Firm Official [Signature] Date 3-12-03
and
Supervisor or Operator [Signature] Date 3-10-03
(Sign Once if Firm Official and Operator)

(Todd Morgan)



Northwest
Hydro-Fracturing
Increasing Water Well Yield

796634
Permit No. D-0028146
NWHF Tag No. D 0028248

RECEIVED
APR 11 2003
IDWR/North



FRACTURING LOG

1. OWNER NAME: Darrel Reynolds/ Guyer Construction
Address: 5005 W Cougar Est. Rd Coeur d'Alene, ID 83814

Total depth 841' Diameter 6"

2. TYPE OF WORK: Hydrofracturing

3. WELL TESTS:

Yield: gal./min. with ft. drawdown after Hrs.
Pre-frac: _____

Post-frac: _____

4. HYDRO-FRACTURING LOG

63- 168
168 - 273
273 - 378
378 - 483
483 - bottom

5. FRACTURER'S STATEMENT:

This well was hydro-fractured under my jurisdiction and this report is true to the best of my knowledge and belief.

Company Name Northwest Hydro-Fracturing
Address 13812 W Lincoln Rd Spokane, WA 99224
Signed [Signature]
Date Job was done 3/27/03

6. LOCATION OF WELL: County Kootenai
NW 1/4 NE 1/4 Sec. 10 T 50N N, R 5W WM