

WELL DRILLER'S REPORT

Office Use Only		
Inspected by		
Twp	Rge	Sec
1/4	1/4	1/4
Lat	Long	


1. WELL TAG NO. D0017065

Drilling Permit No: 763228
Other IDWR No. _____

2. OWNER Well Number: 196
Name Mike & Tina Kuhnline

Address 3900 Hudlow Road
City Hayden Lake State ID Zip 83835

3. LOCATION OF WELL by legal description
sketch map location must agree with written location

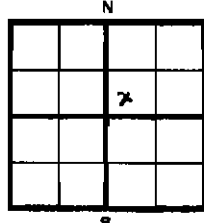

Twp. 52 ☒ North or ☐ South
Rge. 03 ☐ East or ☒ West
Sec. 29 1/4 NE 1/4 SW 1/4

Gov't Lot _____ County KOOTENAI

Lat: _____ Long: _____

Address of Well Site 3900 Hudlow Road
City Hayden Lake

(Give at least name of road + Distance to Road or Landmark)

Lt. _____ Blk. _____ Sub. Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
Casing Seal	0	18	7 sacks	temporary casing

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) _____

Was drive shoe seal tested? ☐ Y ☐ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
8	+2	-71	.250	steel	☒	☐	☒	☐
4	-10	-183	.160	PVC	☐	☒	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☒ Perforations Method skill saw

☒ Screens Screen Type PVC

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
-103	-178	1/8x6	150	4	pvc	☐	☒
-71	-81	10		4	pvc	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

10 ft. below ground Artesian pressure _____ lb.

Depth flow encountered _____ ft. Describe access port or

control devices: weld on cap

MAR 22 2001

IDWR North



11. WELL TESTS:

☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
estimate 20			1/2 hour

Water Temp. cold Bottom Hole Temp. cold

Water Quality test or comments: cloudy

Depth first Water encountered 70

12. LITHOLOGIC LOG:(Describe repairs or abandonment)

				Water	
Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Y	N
12	0	2	Top soil	☐	☒
12	2	8	Clay w/gravels	☐	☒
12	8	15	Clay w/gravels	☒	☐
12	15	18	Clay orange	☐	☒
10	18	37	Clay orange	☐	☒
10	37	70	Clay tan	☐	☒
10	70	81	Sand w/clay tan	☒	☐
10	81	85	Basalt w/clay	☐	☒
10	85	183	Basalt	☐	☒
10	183	185	Clay black w/silt	☐	☒
			5 Centralizers @ 65', 81', 120', 150', & 170'	☐	☐
				☐	☐

GRAVEL PACKED HOLE
W/ 3/8" PEA GRAVEL
FROM 183' UP TO
88'

SAND PACKED SCREEN
W/ 10-20 SILICA
SAND FROM 88'
UP TO 66'

Completed Depth 183 (Measurable)
Date: Started 3/15/01 Completed 3/19/01

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards
were complied with at the time the rig was removed.

Firm Name H2O WellService, Inc. Firm No. 448

Firm Official [Signature] Date 3-21-

and [Signature] Date 3-20-01

Supervisor or Operator [Signature] Date 3-20-01

(Sign Once if Firm Official and Operator)

Todd Morgan

52N 31W 29