

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

1. WELL TAG NO. D 0040184
DRILLING PERMIT NO. 833210
Water Right or Injection Well No. _____

2. OWNER:
Name Jerry Hollis
Address P.O. Box 118
City Kellogg State ID Zip 83831

3. LOCATION OF WELL by legal description:

You must provide address or Lot, Blk, Sub. or Directions to well.

Twp. 48 North ☒ or South ☐
Rge. 3 East ☐ or West ☐
Sec. 8 1/4 NE 1/4 NE 1/4
Gov't Lot _____ County Shoshone

Lat: _____ Long: _____
Address of Well Site 1018 Alhambra Rd
City Kellogg

(Give at least name of road - Distance to Road or Landmark)
Lt. _____ Blk. _____ Sub. Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD:

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

Seal Material	From	To	Weight / Volume	Seal Placement Method
Bentonite	0	20	500 LBS	POUR

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 130'

Was drive shoe seal tested? ☒ Y ☐ N How? Air

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6	42	130	250	Steel	☒	☐	☒	☐
4	10	325	16052	PVC	☐	☒	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

Packer ☐ Y ☒ N Type _____

9. PERFORATIONS/SCREENS PACKER TYPE

Perforation Method Drill

Screen Type & Method of Installation _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
265	325	1"	42	4	PVC	☐	☒

10. FILTER PACK

Filter Material	From	To	Weight / Volume	Placement Method

11. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

98' ft. below ground Artesian pressure _____ lb.
Depth flow encountered 225' ft. Describe access port or control devices: Cap

Office Use Only			
Well ID No.	_____		
Inspected by	_____		
Twp	Rge	Sec	
1/4	1/4	1/4	
Lat:	:	Long:	:

12. WELL TESTS:

☒ Pump ☐ Bailor ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
56 gpm			2 hrs

Water Temp. 47 Bottom hole temp. _____

Water Quality test or comments: Clear NO odor

Depth first Water Encounter 225'

13. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Y	N
8	0	30	Red Clay Gravel		
	30	32	Reddish Brown clay		
	32	35	Tan Clay / gravel		
	35	60	Red Clay		
	60	100	Rock / Tan clay		
	100	130	Med Hard Gravel		
6	130	140	Med Hard Gravel		
	140	325	Gray Blue Shale		

RECEIVED
JUL 15 2005
IDWR/North

Completed Depth 325 (Measurable)

Date: Started 6/2/05 Completed 6/3/05

14. DRILLER'S CERTIFICATION

I/we certify that all minimum well construction standards were complied with at the time the rig was removed.


Company Name Allways Drilling Inc Firm No. 570

Principal Driller Shawn K. Wells Date 7/12/05

and Driller or Operator II David R. Miller Date 7/10/05

Operator I _____ Date _____

Principal Driller and Rig Operator Required.
Operator I must have signature of Driller/Operator II.

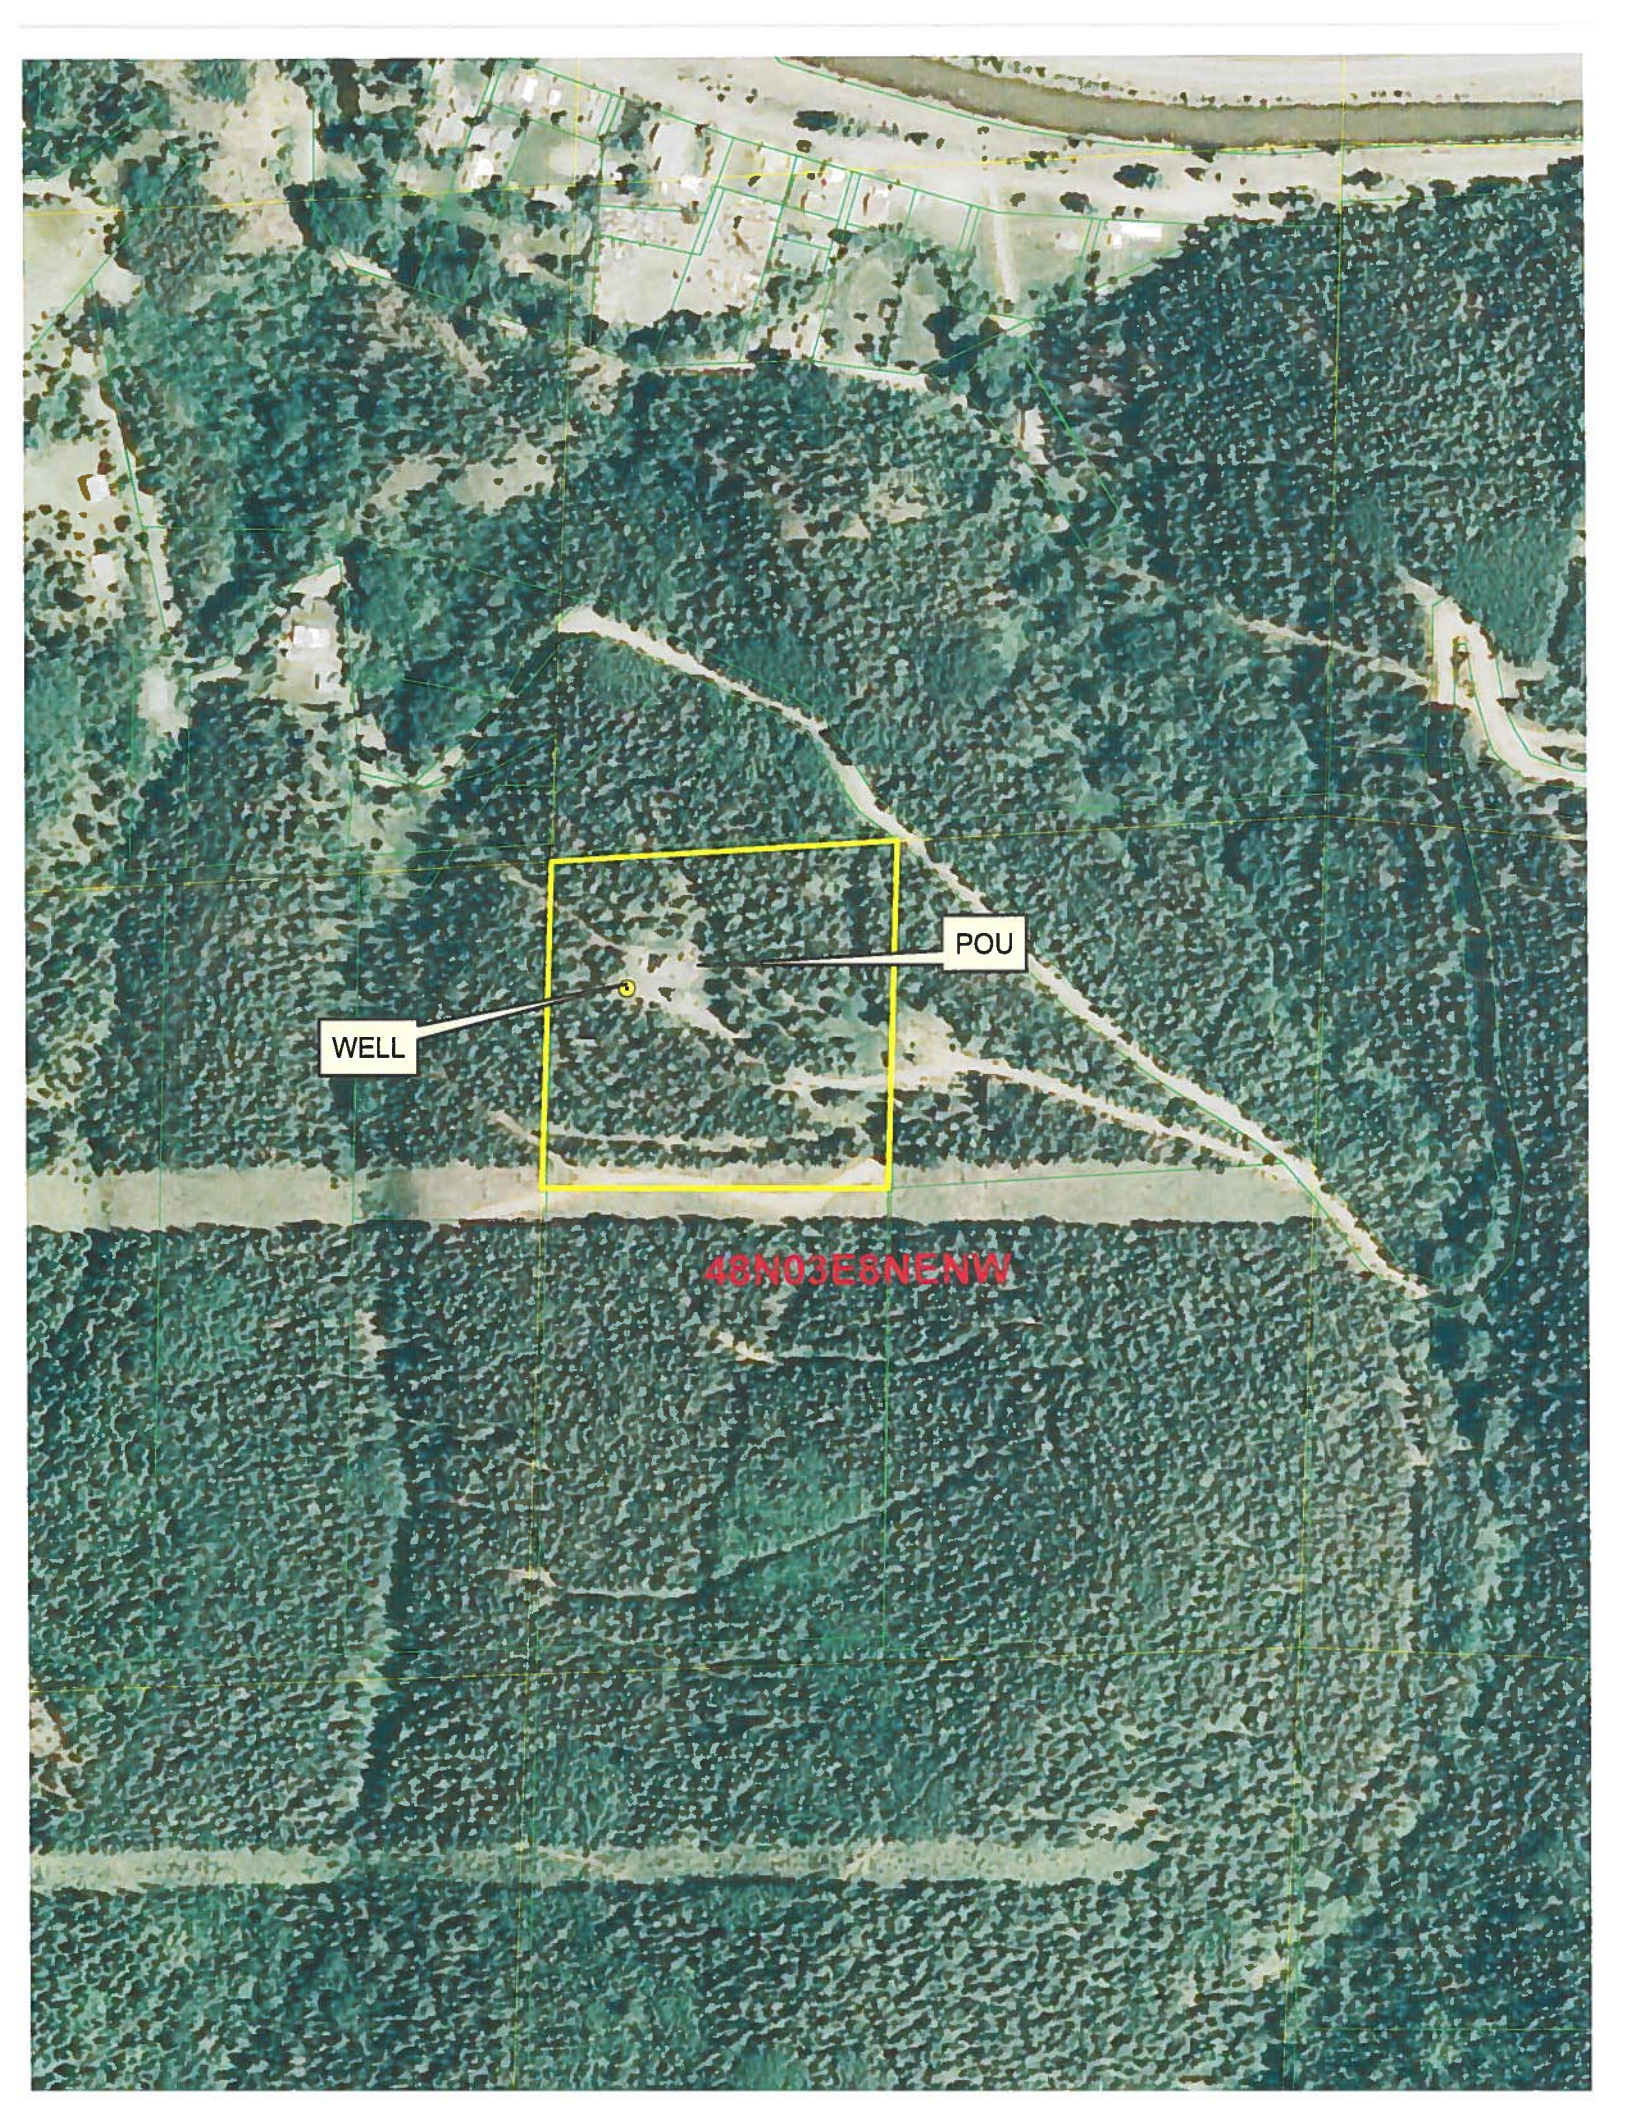

WELL

An aerial photograph of a rural landscape with a yellow rectangular boundary. A yellow dot is located within the boundary, with a line pointing to a label 'WELL'. Another line points from a label 'POU' to the right side of the boundary. The text '48N03E8NENW' is visible in red at the bottom of the image.

POU

48N03E8NENW