RECEIVED

JUL 28 1999

Form 38-2
11/97

IDWR/North

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT 076544

Office Use Only
Inspected by _____
Twp ____ Rge ____ Sec ____
____ 1/4 ____ 1/4 ____ 1/4
Lat: : : Long: : :

1. WELL TAG NO. D 10328

DRILLING PERMIT NO. 94-99-N-24

Other IDWR No.

2. OWNER:

Name James S. Norton

Address 30655 S. Flats Loop

City Harrison State Id Zip 83833

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

N / W / E / S — X

Twp. 47 North ☑ or South ☐

Rge. 3 East ☐ or West ☑

Sec. 26 ____ 1/4 (10 acres) N/E 1/4 (40 acres) N/E 1/4 (160 acres)

Gov't Lot ____ County Kootenai

Lat: : : Long: : :

Address of Well Site Flats Loop Rd.

Next to Kootenai School (Give at least name of road + Distance to Road or Landmark) City Harrison

Lt. ____ Blk. ____ Sub. Name ____

4. USE: ☑ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation ☐ Thermal ☐ Injection ☐ Other ____

5. TYPE OF WORK check all that apply (Replacement etc.) ☑ New Well ☐ Modify ☐ Abandonment ☐ Other ____

6. DRILL METHOD ☑ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other ____

7. SEALING PROCEDURES

SEAL/FILTER PACK Material	From	To	AMOUNT Sacks or Pounds	METHOD
Bentonite	0	75	400#	Pour Dry

Was drive shoe used? ☑ Y ☐ N Shoe Depth(s) 76'

Was drive shoe seal tested? ☑ Y ☐ N How? Air

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+2	76	.250	Steel	☑	☐	☑	☐
					☐	☐	☐	☐
4"	70	150	.160	PVC	☐	☑	☐	☐

Length of Headpipe N/A Length of Tailpipe N/A

9. PERFORATIONS/SCREENS

Perforations Method Drill

Screens Screen Type N/A

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
70	90	1/4"	30	4"	PVC	☐	☑
						☐	☐
130	150	1/4"	30	4"	PVC	☐	☑

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

42 ft. below ground Artesian pressure N/A lb.

Depth flow encountered 80 ft. Describe access port or control devices: Well cap

11. WELL TESTS: ☐ Pump ☐ Bailer ☑ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
30			1 hr

Water Temp. Cold Bottom hole temp. Cold

Water Quality test or comments: Clear

Depth first Water Encountered 80

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Water Y
8"	0	1	Overburden	
8"	1	23	Clay Brown	
8"	23	71	~~Basalt broken~~ Clay black	
8"	71	83	Basalt broken	✓
8"	83	85	Basalt soft	
6"	85	150	Basalt soft	

Completed Depth 150' (Measurable)

Date: Started 7-15-99 Completed 7-25-99

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name Allwest Drilling Inc. Firm No. 510

Firm Official Steve K Wolfe Date 7-26-99

and

Driller or Operator [signature] Date 7-25-99

(Sign once if Firm Official & Operator)

47N 3W 26

FORWARD WHITE COPY TO WATER RESOURCES

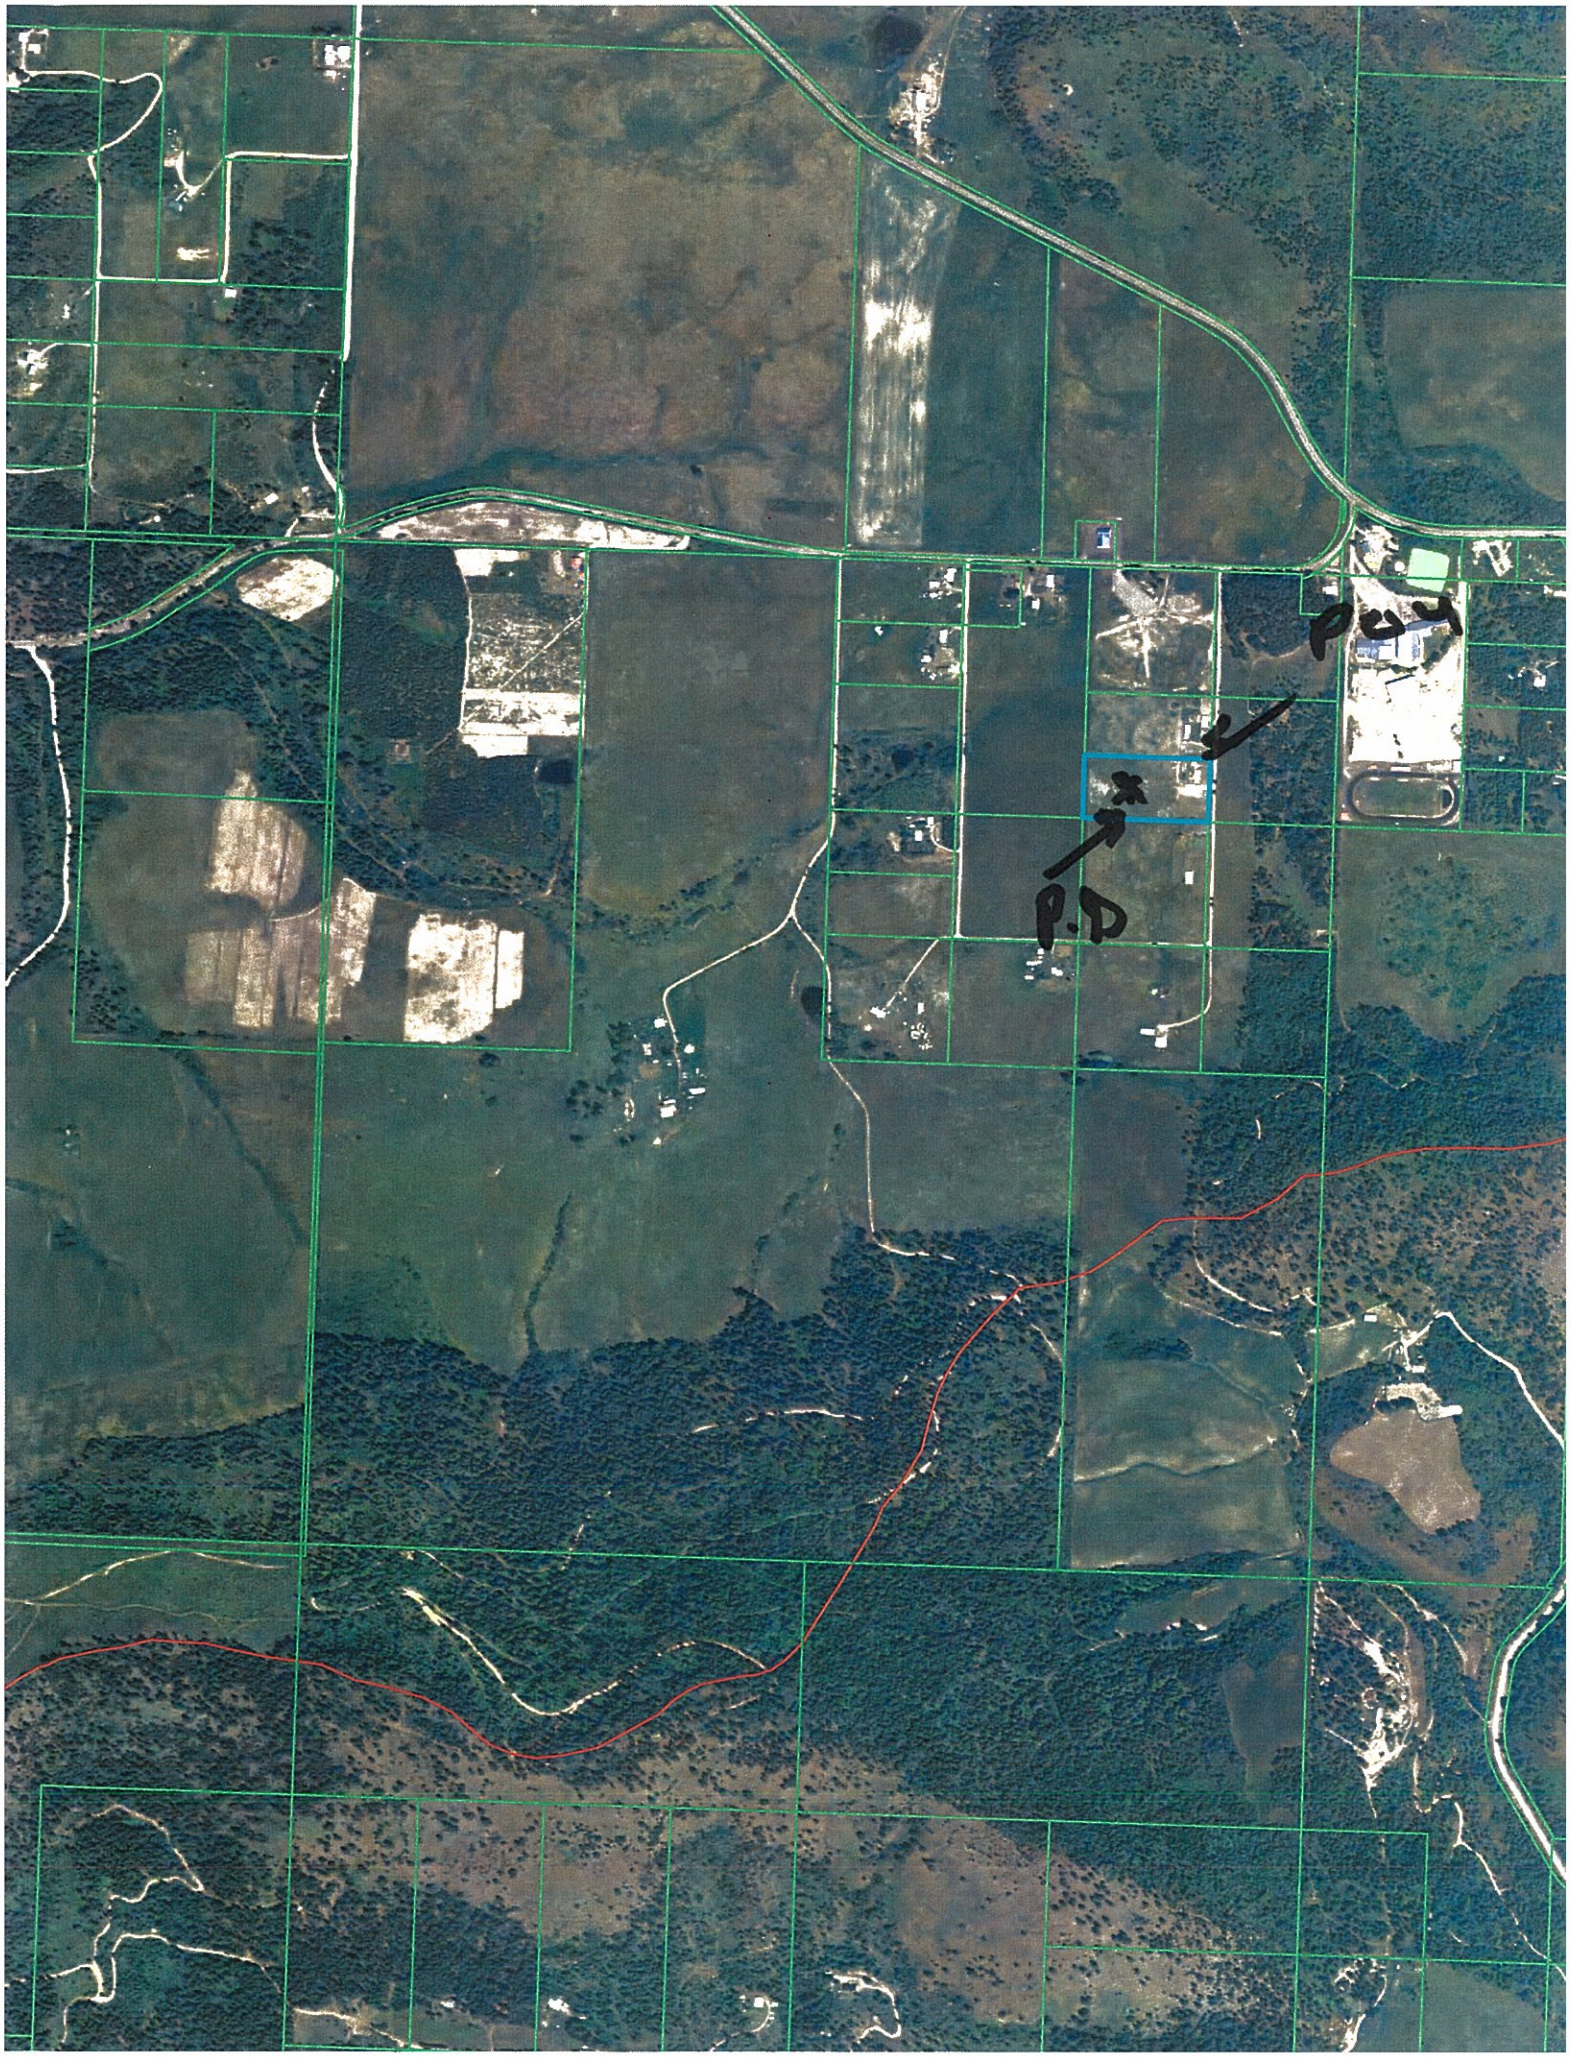
P.D
P.D