


(Sign once if Firm Official & Operator)

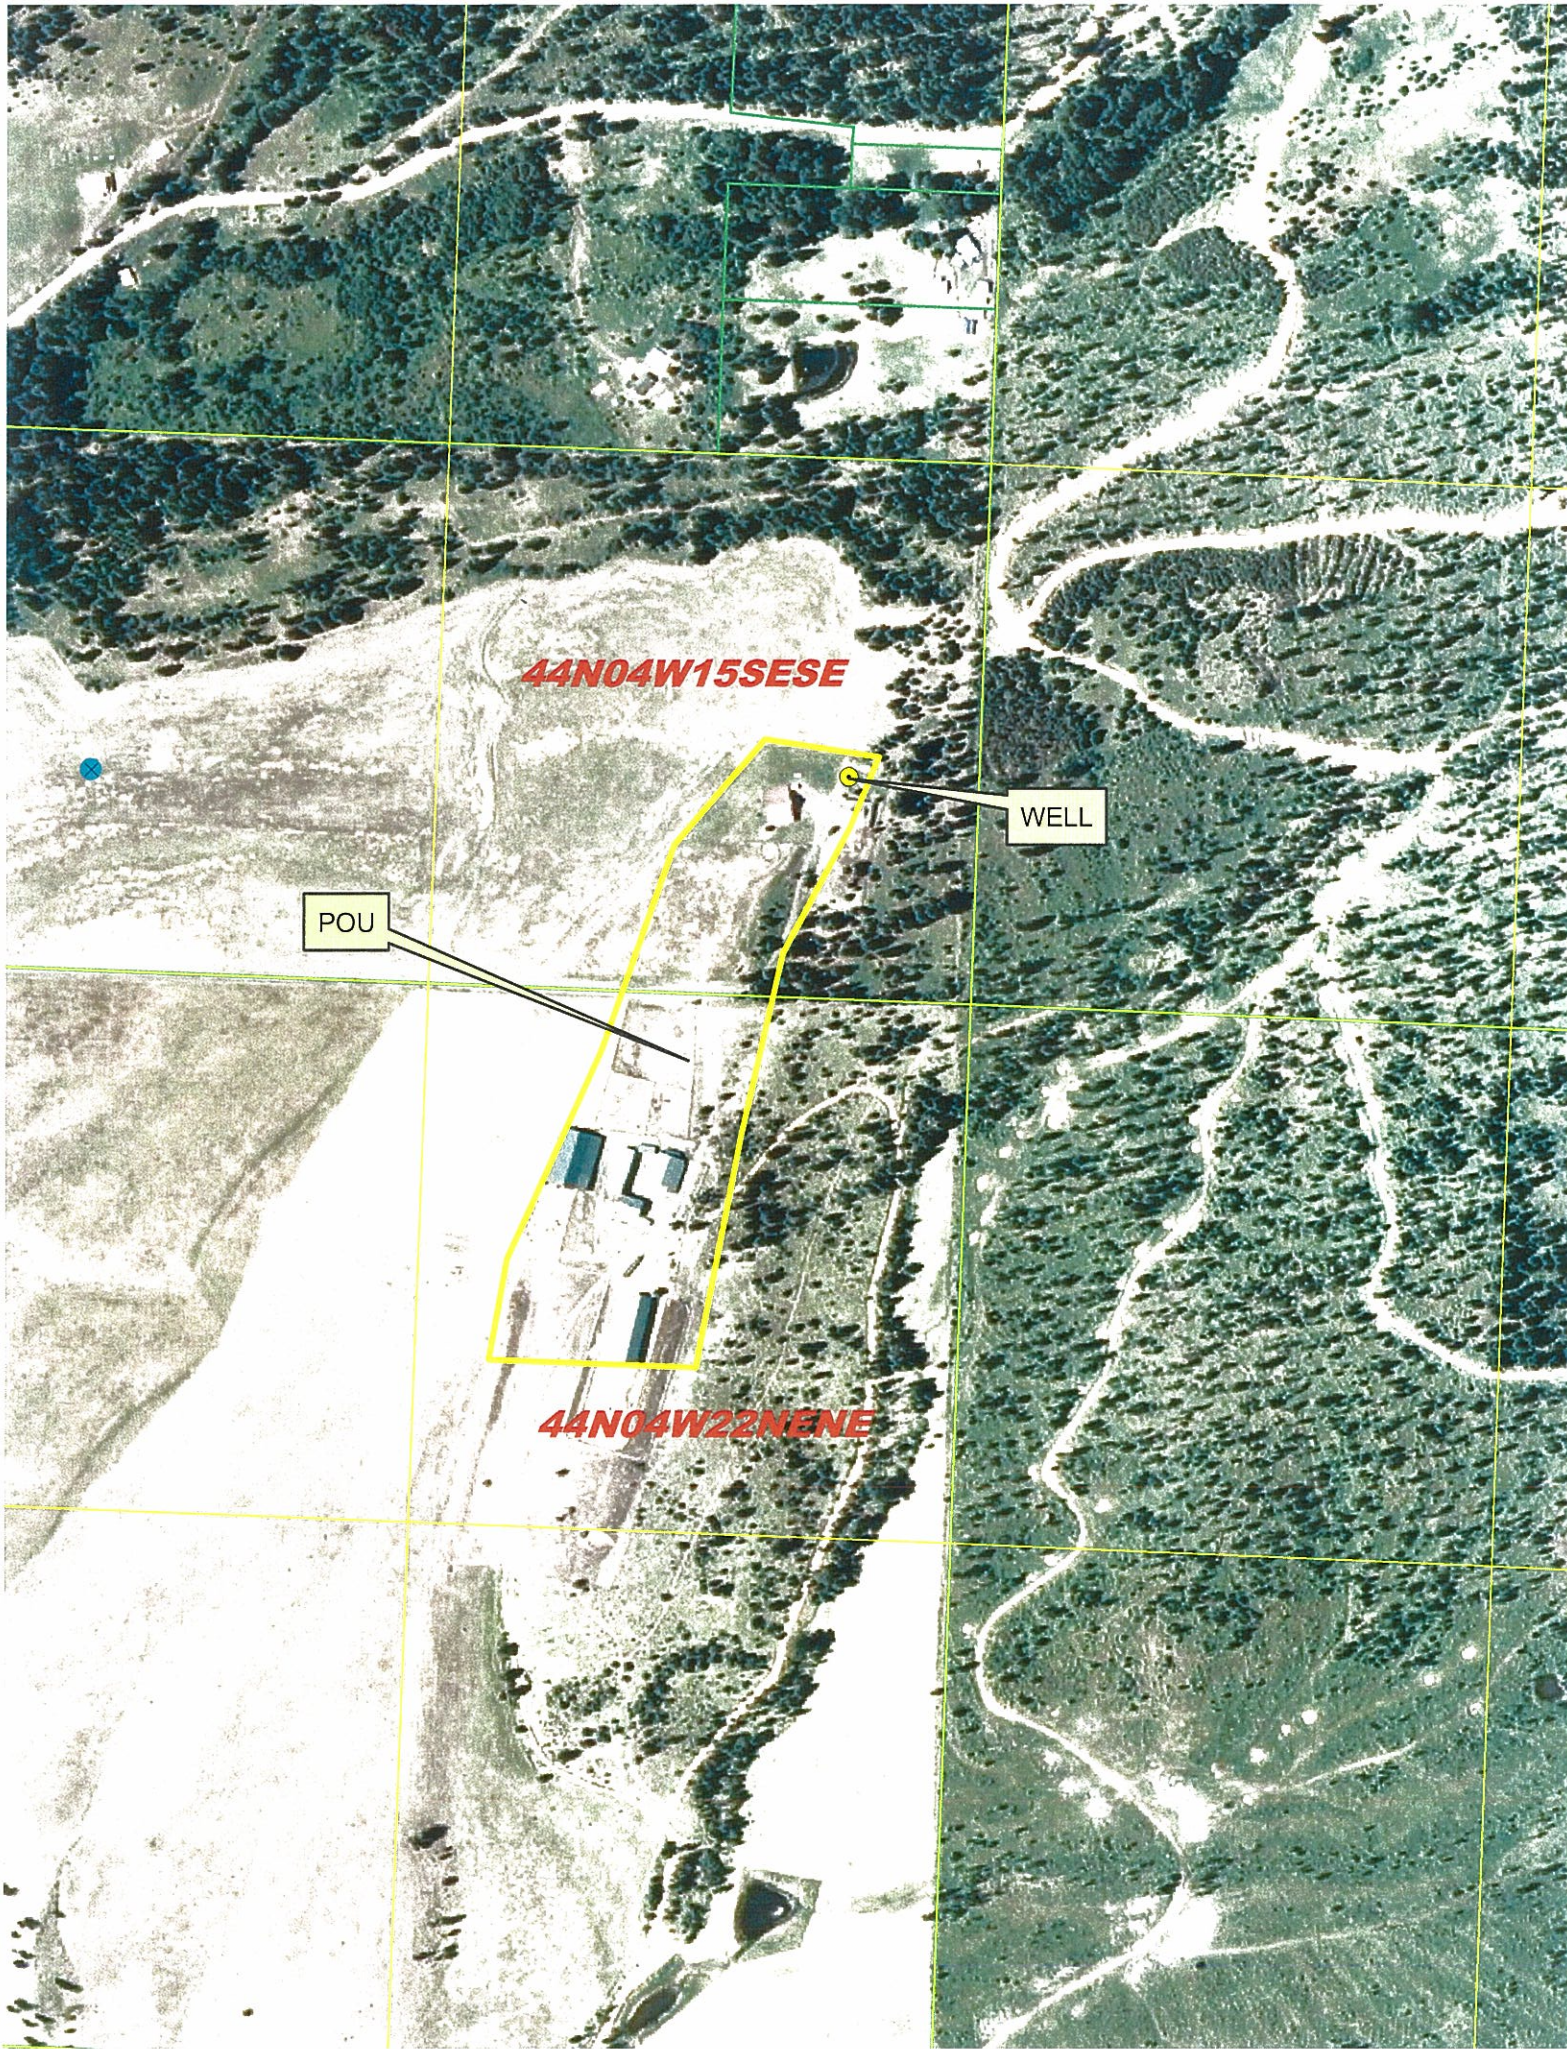

44N04W15SESE

WELL

POU

44N04W22NENE

IDAHO DEPARTMENT OF WATER RESOURCES WELL DRILLER'S REPORT

RECEIVED

SEP 24

Office Use Only
Inspected by _____
Twp _____ Rge _____ Sec _____
North 1/4 _____ 1/4 _____ 1/4 _____
Lat: _____ Long: _____

1. WELL TAG NO. D 0017586

DRILLING PERMIT NO. _____

Other IDWR No. 770779

2. OWNER:

Name Mike McCarver
Address 10668 Lynx Trail
City Coeur d'Alene State ID Zip 83814

POSTED

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

N
W
E
S
Twp. 44 North ☒ or South ☐
Rge. 4 East ☐ or West ☒
Sec. 15 1/4 SE 1/4 SE 1/4
Gov't Lot _____ County Benewah
Lat: _____ Long: _____
Address of Well Site Fox Rd
City Tensed

(Give at least name of road + Distance to Road or Landmark)

Lt. _____ Bk. _____ Sub. _____ Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK	AMOUNT	METHOD
Material	From To Sacks or Pounds	
<u>bentonite</u>	<u>0</u> <u>18</u> <u>8.5</u>	<u>overbore</u>

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) _____

Was drive shoe seal tested? ☐ Y ☐ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
<u>6</u>	<u>+3</u>	<u>291.5</u>	<u>250</u>	<u>steel</u>	☒	☐	☒	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

Perforations _____ Method _____

Screens _____ Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

16.6 ft. below ground Artesian pressure _____ lb.

Depth flow encountered _____ ft. Describe access port or control devices: cap

44 N 4 W 15

11. WELL TESTS:

☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal/min.	Drawdown	Pumping Level	Time
<u>10</u>		<u>280</u>	<u>4hrs</u>

Water Temp. cold Bottom hole temp. _____

Water Quality test or comments: little cloudy

Depth first Water Encounter 288

12. LITHOLOGIC LOG: (Describe repairs or abandonment) Water

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Y	N
<u>8</u>	<u>0</u>	<u>18</u>	<u>red&tan clay, some seams of gravel</u>		
<u>6</u>	<u>18</u>	<u>288</u>	<u>red&tan clay, some seams of gravel</u>		
	<u>288</u>	<u>293</u>	<u>red clay&gravel</u>	☒	
	<u>293</u>	<u>295</u>	<u>red clay</u>		

RECEIVED

SEP - 1 2002

Completed _____ Depth 294ft (Measurable)
Date: Started 8-23 Completed 8-27-01

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name Bronson Water Wells Firm No. 360

Firm Official Clint Bronson Date 9/3/01

and

Driller or Operator _____ Date _____

(Sign once if Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES