

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Office Use Only		
Inspected by		
Twp	Rge	Sec
1/4	1/4	1/4
Lat: : :	Long: : :	

1. WELL TAG NO. D0041340

Drilling Permit No: 838762

Other IDWR No.

2. OWNER

Name Brady, Terry

Well Number:

1125

Address PO Box 318

City Pinehurst

State ID Zip 83850

3. LOCATION OF WELL by legal description

sketch map location must agree with written location

N W E S					

Twp. 48

☒ North or ☐ South

Rge. 1

☒ East or ☐ West

Sec. 36

1/4 SE 1/4 SE 1/4

Gov't Lot

County

SHOSHONE

Lat: : :

Long: : :

Address of Well Site Pinehurst Rd.

City Pinehurst

(Give at least name of road + Distance to Road or Landmark)

Lt. Blk. Sub. Name

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other

5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other

7. SEALING PROCEDURES

SEAL/FILTER PACK		AMOUNT		METHOD
Material	From	To	Sacks or Pounds	
BENTONITE	0	18	350lbs	Overbore

Was drive shoe used? ☐ Y ☒ N Shoe Depth(s) RB

Was drive shoe seal tested? ☐ Y ☒ N How?

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6	+2	61	.250	Steel	☒	☐	☒	☐
4	-8	103	.200	PVC	☐	☒	☐	☐

Length of Headpipe

Length of Tailpipe

9. PERFORATIONS/SCREENS

☒ Perforations Method Skill Saw

☐ Screens Screen Type

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
83	103	1/8 x 4	60	4	PVC	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

10 ft. below ground Artesian pressure lb.

Depth flow encounter ft. Describe access port or control devices:

48N 1E 36

11. WELL TESTS:

☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
20+		100	1hr.

Water Temp. Cold Bottom Hole Temp

Water Quality test or comments: Little Brownish

Depth first Water encountered 40

12. LITHOLOGIC LOG:(Describe repairs or abandonment)

Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Water	
8	0	21	Clayish soil w/Cobbles	☐ Y	☒ N
8	21	24	Shale, Boulder	☐ Y	☒ N
8	24	47	Shale, Gravels cemented in clay, Brown	☒ Y	☐ N
8	47	55	Shale, Boulder	☐ Y	☒ N
8	55	61	Shale, Broken Grey	☐ Y	☒ N
8	61	83	Shale, Dark Grey	☐ Y	☒ N
8	83	89	Shale, Fractured w/w apx. 20+gpm	☒ Y	☐ N
6	89	103	Shale Grey	☐ Y	☒ N

RECEIVED

APR - 4 2006

IDWR/North

Completed Depth 103 (Measurable)
Date: Started 3/15/2006 Completed 3/15/2006

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name H2O Well Service, Inc. Firm No. 448


Firm Official Date 3-20-06

and

Supervisor or Operator Date 3/16/06

Louie Hanner

(Sign Once if Firm Official and Operator)

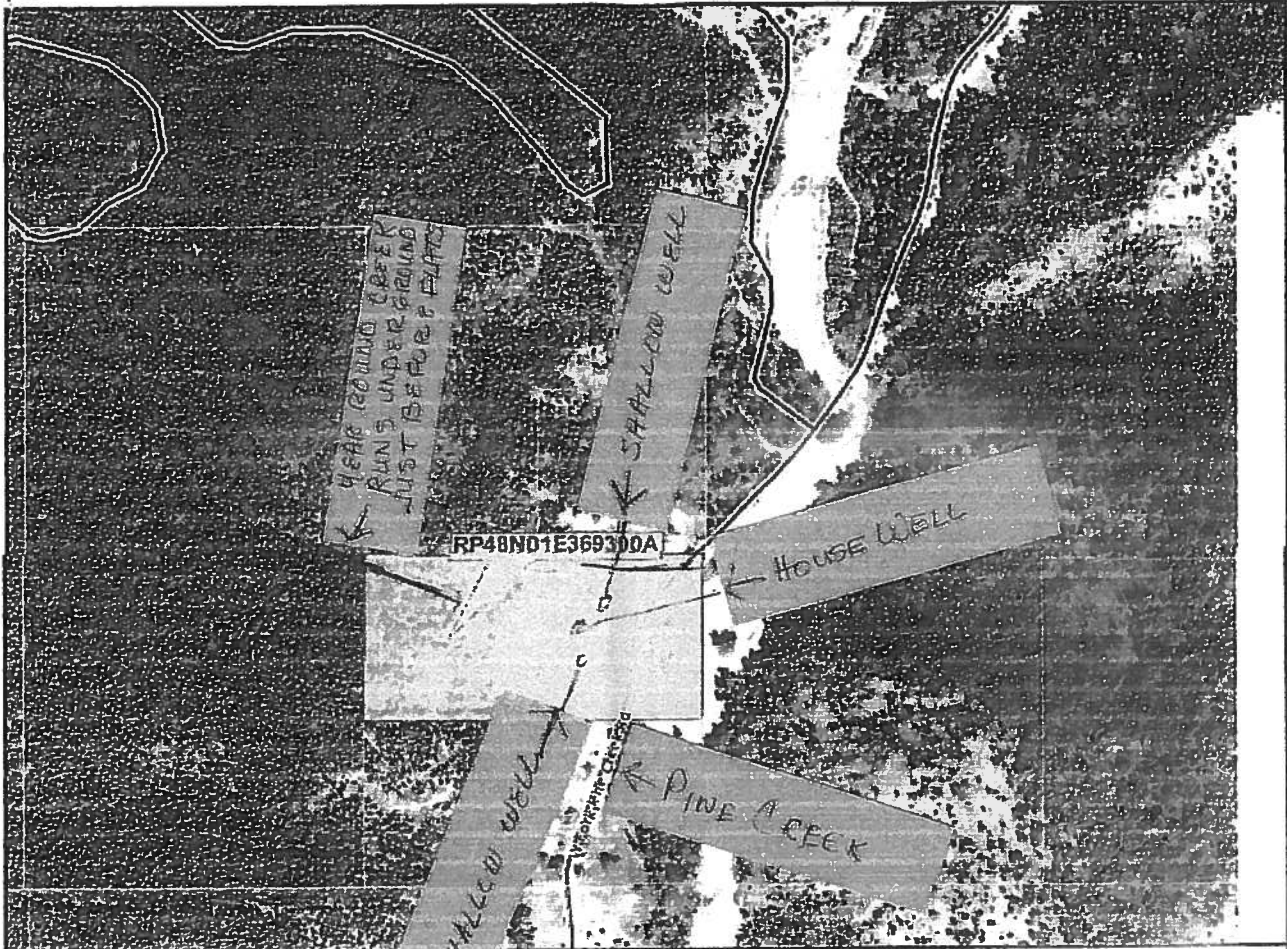

412
 Wallace, AL 36688
 Phone: 205-752-1157
 Fax: 205-752-3481
www.allianceale.com

Sentry Dynamics, Inc. and its customers make no representations, warranties or conditions, express or implied, as to the accuracy or completeness of information contained in this report.

geoAdvantage
www.geoadvantage.org 205.777.1252


Approximate location of wells & creek

See your site

IDAHO

Department of
Water Resources

Transfer Application Internet Mapping

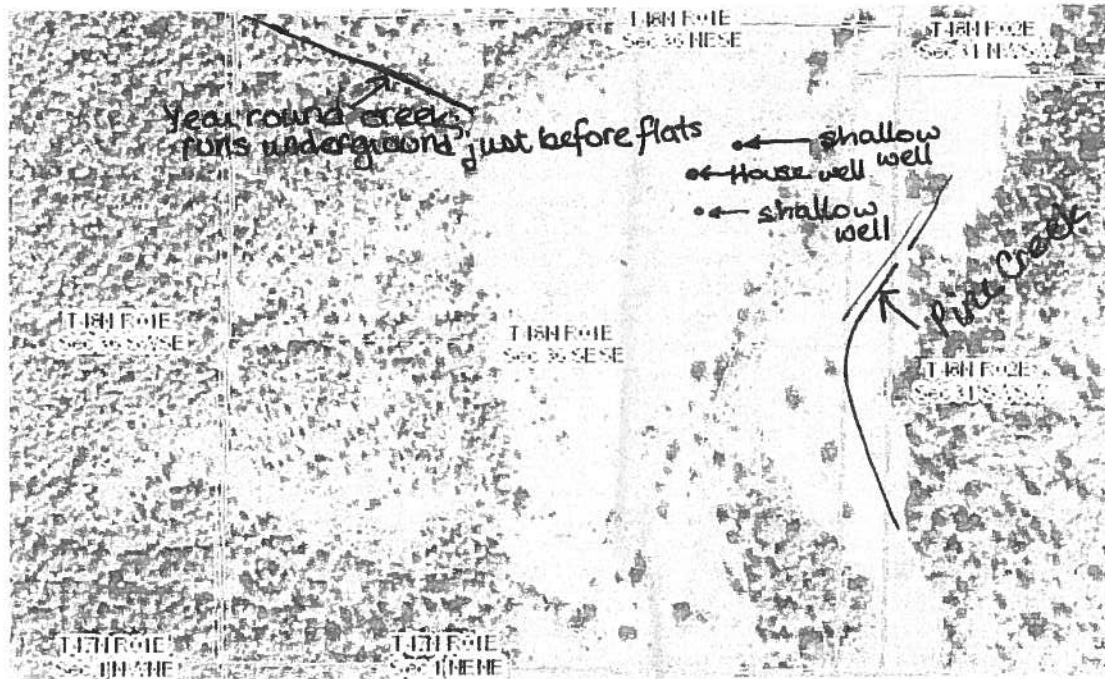

Map Layout

ESPA
Aerial Photo
Topographic
No Background

Refresh Map

Search

Approx. locations of wells & creeks