

RECEIVED
DEC 19 2011



THERE IS NO HOME. A LAWN HYDRANT PROVIDES WATER TO PEOPLE WHO USE THE PROPERTY. TO DATE THERE HAVE BEEN NO SALES OF LOTS.



THE WELL IS ABOUT 500' FROM THE SOUTH EAST CORNER OF THE PROPERTY AND 75'-100' FROM THE ST JOE RIVER RD (NATIONAL FOREST DEVELOPMENT RD 50

SCANNED
DEC 19 2011

91-7648 WELLS PIN RPO15650000250 (N028709)

DEC 19 2011

IDWR/NORTHERN

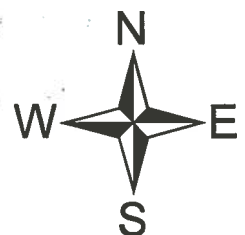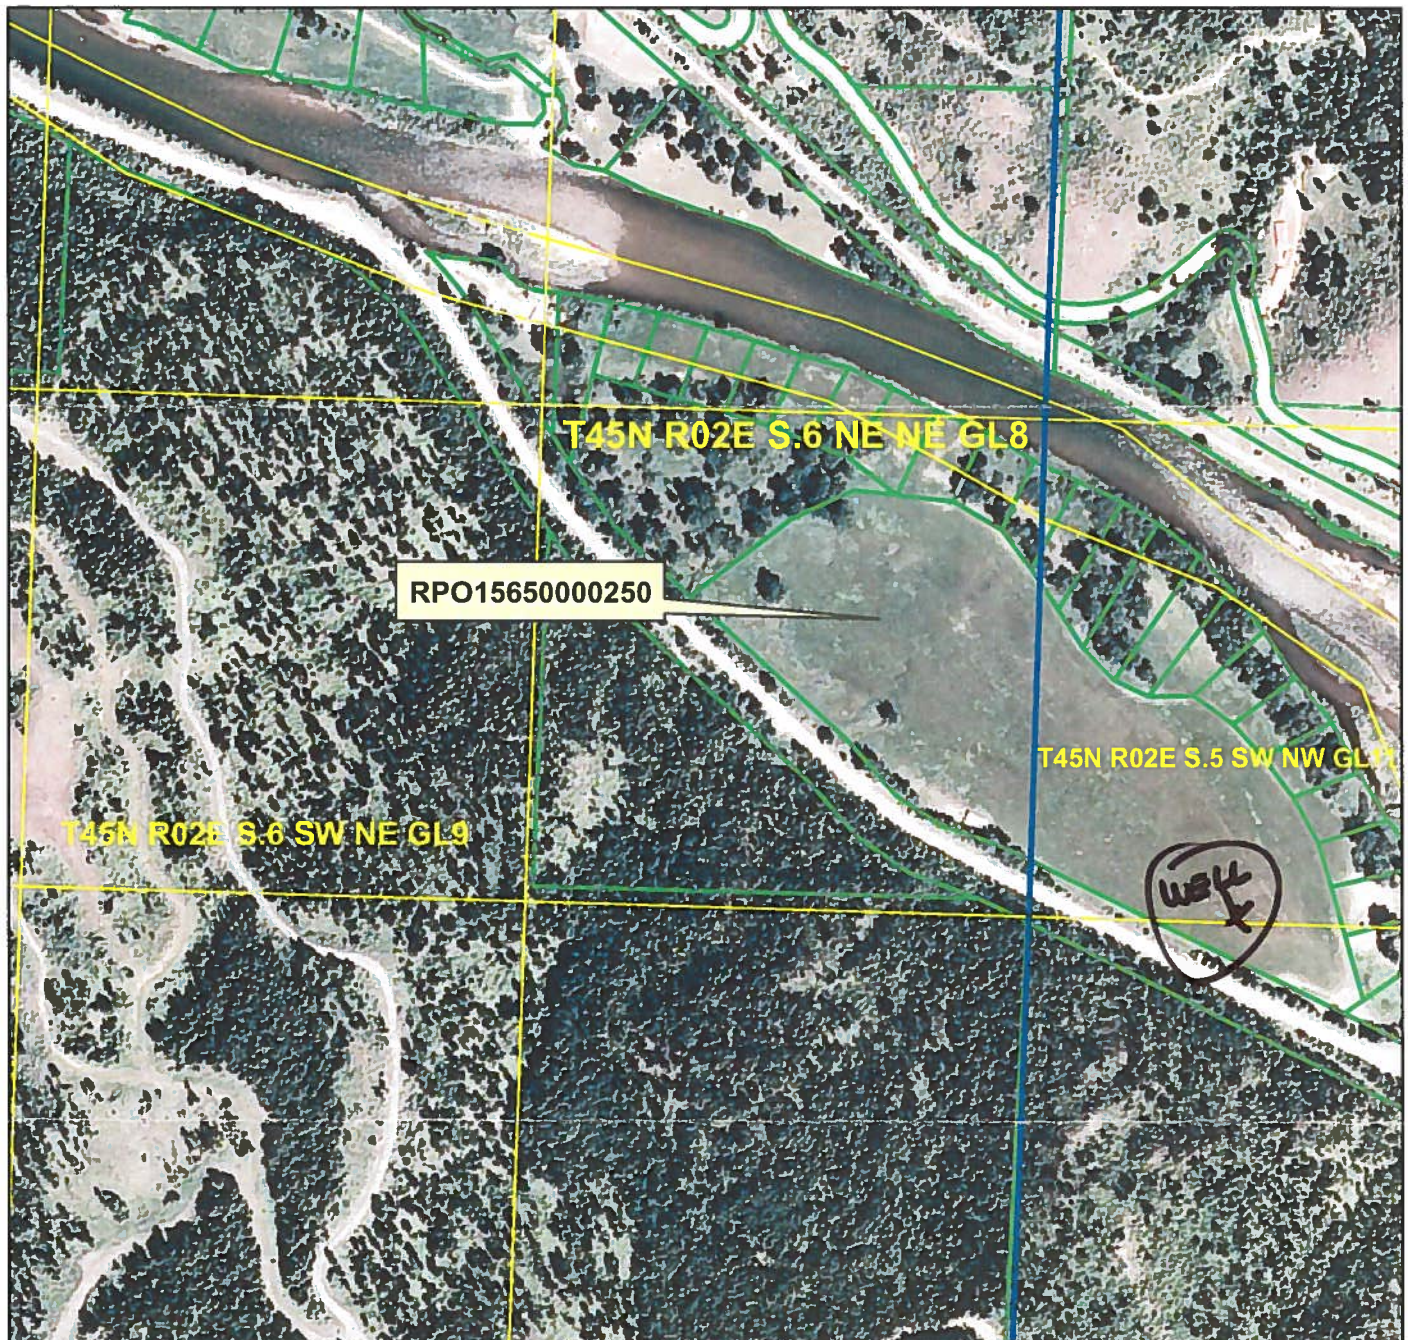

SCANNED
DEC 19 2011

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

1. WELL TAG NO.

D0054592

DRILLING PERMIT NO.

8521109

Water Right or Injection Well No.

2. OWNER:

Name:

John Wells

Address:

263 Stoneridge Road

City:

Blanchard

State:

ID

Zip:

83804

3. LOCATION OF WELL by legal description:

Twp.

45N

Rge.

2E

Sec.

5

SW

1/4

NE

1/4

Gov't Lot

County

Shoshone

Address of well site:

Mile Marker 21 on St. Joe Road

City: St. Maries

4. USE: Domestic

5. TYPE OF WORK:

New Well

6. DRILL METHOD:

Air Rotary

7. SEALING PROCEDURES:

Seal Placement

Seal Material	From	To	Wt/Volume	Method
Bentonite	0	77	1050 lbs.	Pour

Was drive shoe used?

yes

Shoe Depth

118

Was drive shoe seal tested?

yes

How?

air

8. CASING/LINER:

Diameter	From	To	Guage	Material	Casing or Liner	Welded or Threaded
6"	+8	118	250	Steel	casing	welded
4"	-2	177	160	PVC	Liner	glued

Packer?

No

9. PERFORATIONS/SCREENS PACKER TYPE:

Perforation Method

Drill

Screen Type & Method of Installation

Casing or

160	115	1"	40	4"	PVC	Liner
-----	-----	----	----	----	-----	-------

10. FILTER PACK NONE

Placement

Filter Material	From	To	Wt./Volume	Method
NONE				

11. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

10 ft. below ground

Artesian pressure

lb.

Depth flow encountered

158 ft.

Describe access port or control devices:

cap

Office Use Only

Well ID No.

Inspected by

Twp

Rge

Sec

1/4

1/4

1/4

Lat:

Long:

12. WELL TESTS:

☐ Pump	☐ Bailer	☒ Air	☐ Flowing Artesian
Yield gal./min	Drawdown	Pumping Level.	Time
30			2 hrs.

Water Temp:

49 deg.

Bottom Hole Temp:

Water Quality test comments:

good, clear, no odor

Depth first water encounter

14 (cased out)

13. LITHOLOGIC LOG:(Describe repairs or abandonment)

Bore Dia.	From	To	Remarks:(Lithology) (water quality, temp)	Water
				Y N
8"	0 ft	6 ft	Top soil & brown dirt	
8"	6 ft	14 ft	brown dirt & river rock	X
8"	14 ft	36 ft	river rock & brn. Sand	
8"	36 ft	77 ft	gray clay & mica silt	
8"	77 ft	86 ft	brown clay	
8"	86 ft	98 ft	brn. Clay & gravel	
8"	98 ft	110 ft	broken brn. & gray shale	
8"	110 ft	132 ft	hard gray shale	
6"	132 ft	158 ft	med. Broken shale	X
6"	158 ft	177 ft	hard gray shale	

RECEIVED

JUL 22 2008

IDWR/North

Completed Depth 177 (Measurable) 177

Date: Started 7/8/08 Completed 7/11/08

14: DRILLER'S CERTIFICATION

Company Name: ALL-WAYS DRILLING, INC

FIRM #: 510

Principal Driller

Date

Driller or Operator 2

Date

Operator

Date

45N 02E 05

COANNED
DEC 19 2011