RECEIVED
JUN 02 1997
POSTED

Form 238-7
3/95

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT
Use Typewriter or Ballpoint Pen

77530

Office Use Only
Inspected by _____
Twp____ Rge____ Sec____
____1/4____1/4____1/4
Lat: : : Long: : :

NORTHERN REGION

1. DRILLING PERMIT NO. 93- 97 - N 001 - 080
Other IDWR No._____

2. OWNER:
Name GARY SEATON
Address PO Box 32
City Tensed State ID Zip 83870

3. LOCATION OF WELL by legal description:
Sketch map location must agree with written location.

N / W / E / S

Twp. 44N North ☒ or South ☐
Rge. 4W East ☐ or West ☒
Sec. 26, ____1/4 N/W 1/4 N/W 1/4
(10 acres, 40 acres, 160 acres)
Gov't Lot ____ County BENEWAH
Lat: : : Long: : :
Address of Well Site 95 S. 1/2 MI S OF TENSED, OLD ROAD, 3 MI. MOSES RD,
City _____
(Give at least name of road + Distance to Road or Landmark)

Lt._____ Blk._____ Sub. Name_____

4. USE:
☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other_____

5. TYPE OF WORK check all that apply (Replacement etc.)
☒ New Well ☐ Modify ☐ Abandonment ☐ Other_____

6. DRILL METHOD
☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other_____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
Bentonite	0	-18	4 sacks	pour in

Was drive shoe used? ☐ Y ☐ N Shoe Depth(s)_____
Was drive shoe seal tested? ☐Y ☐N How?_____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+2	-278	.025	Steel	☒	☐	☒	☐
4"	-230	-310		PVC	☐	☒	☐	☐
					☐	☐	☐	☐

Length of Headpipe_____ Length of Tailpipe_____

9. PERFORATIONS/SCREENS
☒ Perforations Method Drill
☐ Screens Screen Type_____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
-230	-310		200		PVC	☐	☒
						☐	☐
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:
180 ft. below ground Artesian pressure _____ lb.
Depth flow encountered 180 ft. Describe access port or control devices: Steel cap welded

11. WELL TESTS:
☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
4-5	100%	310	1 hr.

Water Temp. cold Bottom hole temp. cold
Water Quality test or comments: slight trace of color,no smell
Depth first Water Encountered 180

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Water Y	Water N
8"	0	3	Top soil		X
8"	3	16	Clay, brown, soft		X
8"	16	33	Clay, Rust, medium		X
8"	33	50	Clay, red, hard		X
8"	50	70	Clay, red, some red shale		X
8"	70	180	Clay, red, soft		X
8"	180	240	Red shale & red clay, soft	X	
8"	240	250	Clay & shale - brown & yellow - soft		X
8"	250	278	Shale - brown & yellow - soft		X
6"	278	310	Shale - brown & yellow - medium		X
6"	310	340	Broken shale - yellow & brown - very broken	X	
6"	340	400	Blue-gray shale - medium		X

Completed Depth 310' (Measurable)
Date: Started 5/09/97 Completed 5/13/97

13. DRILLER'S CERTIFICATION
I/We certify that all minimum well construction standards were complied with a
the time the rig was removed.

Firm Name United Drilling Inc. Firm No. 414
Firm Official [signature] Date 5/20/97
and
Supervisor or Operator Jason C. Beckham Date 5/20/97
(Sign once if Firm Official & Operator)

NWNW 26 44N 4W

FORWARD WHITE COPY TO WATER RESOURCES

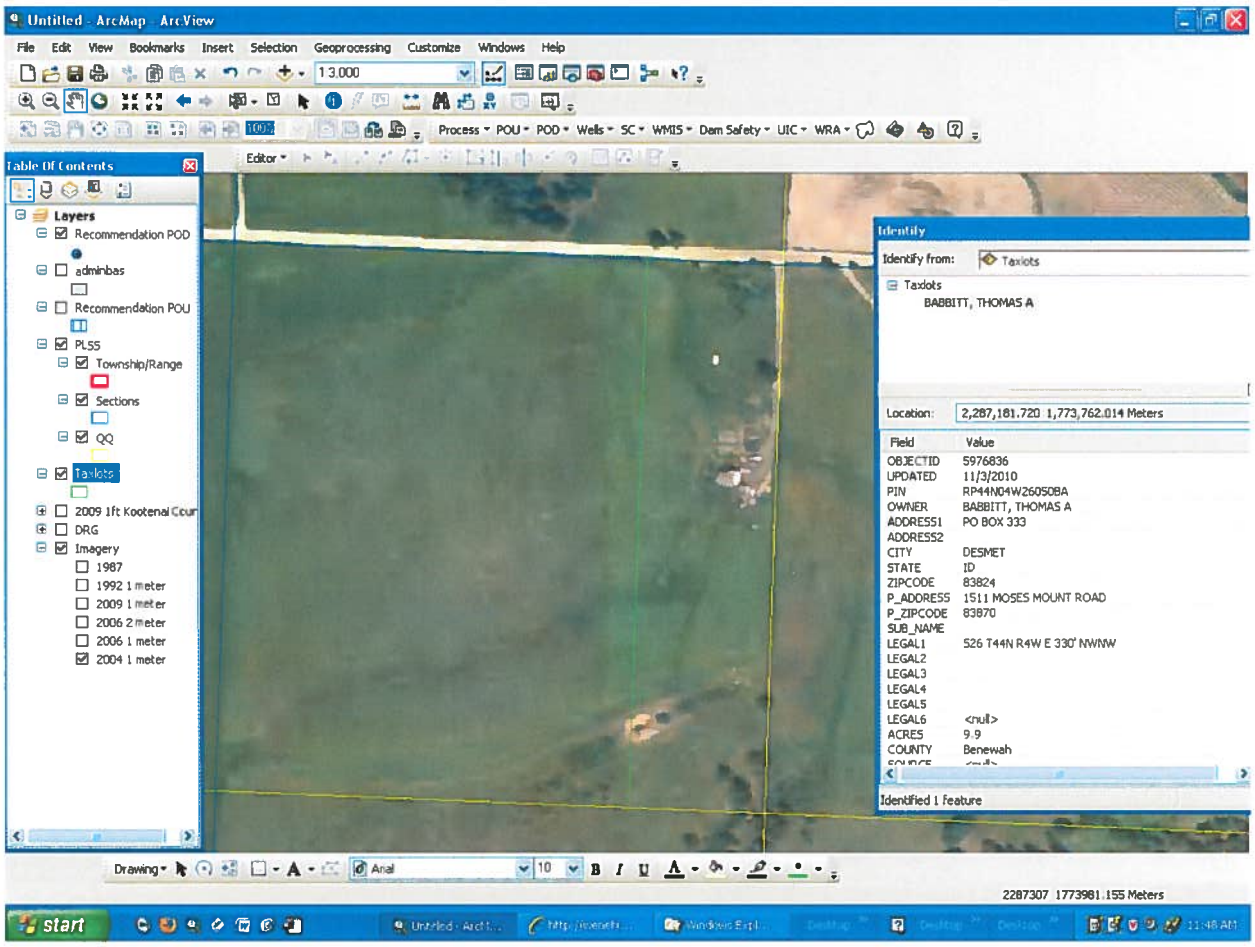
Untitled - ArcMap - ArcView
File Edit View Bookmarks Insert Selection Geoprocessing Customize Windows Help
13,000
Process POU POD Wells SC WMIS Dam Safety UIC WRA
Table Of Contents
Layers
Recommendation POD
adminbas
Recommendation POU
PLSS
Township/Range
Sections
QQ
Taxlots
2009 1ft Kootenai Cour
DRG
Imagery
1987
1992 1 meter
2009 1 meter
2006 2 meter
2006 1 meter
2004 1 meter
Identify
Identify from: Taxlots
Taxlots
BABBITT, THOMAS A
Location: 2,287,181.720 1,773,762.014 Meters
Field Value
OBJECTID 5976836
UPDATED 11/3/2010
PIN RP44N04W26050BA
OWNER BABBITT, THOMAS A
ADDRESS1 PO BOX 333
ADDRESS2
CITY DESMET
STATE ID
ZIPCODE 83824
P_ADDRESS 1511 MOSES MOUNT ROAD
P_ZIPCODE 83870
SUB_NAME
LEGAL1 S26 T44N R4W E 330' NWNW
LEGAL2
LEGAL3
LEGAL4
LEGAL5
LEGAL6 <null>
ACRES 9.9
COUNTY Benewah
Identified 1 feature
Drawing
Arial
10
2287307 1773981.155 Meters
start