

RECEIVED

Form 20 SEP 29 2000
11/97

IDAHO DEPARTMENT OF WATER RESOURCES

WELL DRILLER'S REPORT

IDWR/North

1. WELL TAG NO. D 00 13739 RECEIVED

DRILLING PERMIT NO. _____

Other IDWR No. 766817

OCT 11 2000

11. WELL TESTS:

☐ Pump ☐ Bailor

Office Use Only

Inspected by _____

Twp _____ Rge _____ Sec _____

_____ 1/4 _____ 1/4 _____ 1/4

Lat: _____ Long: _____


☒ Air ☐ Flowing Artesian

2. OWNER:

Name Lyle Smith IDWR/North 30
Address HC 66 Box 278
City Clearwater State ID Zip 83539

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

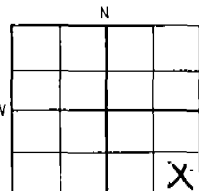

Twp. 31 North ☒ or South ☐
Rge. 4 East ☒ or West ☐
Sec. 13 1/4 SE 1/4 SE 1/4
Gov't Lot _____ County IDAHO 10 acres 40 acres 160 acres
Lat: _____ Long: _____

Address of Well Site Middle of Village of Clearwater
City Clearwater

Lt. _____ Blk. _____ Sub. _____ Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER	PACK	AMOUNT	METHOD
Material	From	To	Sacks or Pounds
Bentonite	0	18	300 #
			Top Pour

Was drive shoe used? ☐ Y ☒ N Shoe Depth(s) _____
Was drive shoe seal tested? ☒ Y ☐ N How? Air Pressure

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+2	-18	250	Steel	☒	☐	☒	☐
4 1/2"	-5	-195	160	PVC	☐	☒	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☒ Perforations Method SAW
Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
-180	-200	1/2 x 4	39	3 1/2"	PVC	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

124 ft. below ground Artesian pressure _____ lb.
Depth flow encountered _____ ft. Describe access port or control devices: Top of casing

Yield gal./min.	Drawdown	Pumping Level	Time
			<u>1.00</u>

Water Temp. 55° Bottom hole temp. _____
Water Quality test or comments: Good

Depth first Water Encounter 177'

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Y	N
8"	0	7	Brn. Clay		☒
8"	7	18	HARD Gray BSLT		☒
6"	18	48	" " "		☒
6"	48	97	Brn. Sticky Clay		☒
6"	97	145	Brn. w/ht. BSLT		☒
6"	145	177	BLK BSLT		☒
6"	177	200	Frac BLK BSLT	30	

Completed _____ Depth 200 ft (Measurable)
Date: Started 9-26-00 Completed 9-27-00

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name WHELENOH DRILLING Firm No. 125

Firm Official Don J. Wheeler Date 9-28-00

and Driller or Operator Don J. Wheeler Date 9-28-00

(Sign once if Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES