

## WELL DRILLER'S REPORT

0.113

State law requires that this report be filed with the State Reclamation Engineer  
within 30 days after completion or abandonment of the well.

## 1. WELL OWNER

Name NORMAN FURTH  
Address ST. MARIES IDAHO  
Owner's Permit No. \_\_\_\_\_

## 7. WATER LEVEL

Static water level 60 feet below land surface  
Flowing? ☐ Yes ☒ No G.P.M. flow \_\_\_\_\_  
Temperature \_\_\_\_\_ ° F. Quality \_\_\_\_\_  
Artesian closed-in pressure \_\_\_\_\_ p.s.i.  
Controlled by ☐ Valve ☐ Cap ☐ Plug

## 2. NATURE OF WORK

92-72-N-2☒ New well ☐ Deepened ☐ Replacement  
☐ Abandoned (describe method of abandoning)

## 8. WELL TEST DATA

☐ Pump ☐ Bailer ☒ Other AIR  
Discharge G.P.M. 12 GPM Draw Down \_\_\_\_\_ Hours Pumped \_\_\_\_\_

## 3. PROPOSED USE

☒ Domestic ☐ Irrigation ☐ Test  
☐ Municipal ☐ Industrial ☐ Stock

## 4. METHOD DRILLED

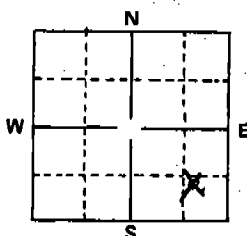
☐ Cable ☒ Rotary ☐ Dug ☐ Other

## 5. WELL CONSTRUCTION

Diameter of hole 8 inches Total depth 159 feet  
Casing schedule: ☒ Steel ☐ Concrete  
Thickness 1.250 inches Diameter 6 inches From 71 feet To 159 feet  
\_\_\_\_\_ inches \_\_\_\_\_ inches \_\_\_\_\_ feet \_\_\_\_\_ feet  
\_\_\_\_\_ inches \_\_\_\_\_ inches \_\_\_\_\_ feet \_\_\_\_\_ feet  
\_\_\_\_\_ inches \_\_\_\_\_ inches \_\_\_\_\_ feet \_\_\_\_\_ feet  
\_\_\_\_\_ inches \_\_\_\_\_ inches \_\_\_\_\_ feet \_\_\_\_\_ feetWas a packer or seal used? ☐ Yes ☒ No  
Perforated? ☒ Yes ☐ No  
How perforated? ☐ Factory ☐ Knife ☒ Torch  
Size of perforation 12 inches by 4 inches  
Number 30 From 144 feet To 159 feet  
\_\_\_\_\_ perforations \_\_\_\_\_ feet \_\_\_\_\_ feet  
\_\_\_\_\_ perforations \_\_\_\_\_ feet \_\_\_\_\_ feet  
\_\_\_\_\_ perforations \_\_\_\_\_ feet \_\_\_\_\_ feetWell screen installed? ☐ Yes ☒ No  
Manufacturer's name \_\_\_\_\_  
Type \_\_\_\_\_ Model No. \_\_\_\_\_  
Diameter \_\_\_\_\_ Slot size \_\_\_\_\_ Set from \_\_\_\_\_ feet to \_\_\_\_\_ feet  
Diameter \_\_\_\_\_ Slot size \_\_\_\_\_ Set from \_\_\_\_\_ feet to \_\_\_\_\_ feetGravel packed? ☐ Yes ☒ No Size of gravel \_\_\_\_\_  
Placed from \_\_\_\_\_ feet to \_\_\_\_\_ feetSurface seal? ☒ Yes ☐ No To what depth 19 feet  
Material used in seal ☐ Cement grout ☒ Puddling clay

## 6. LOCATION OF WELL

Sketch map location must agree with written location.

92  
County BENEFWAH  
SE 1/4 SE 1/4 Sec. 20, T. 46 N. R. 2 E/W

## 10.

Work started July 26 72 finished July 27 72

## 11. DRILLER'S CERTIFICATION

This well was drilled under my supervision and this report is  
true to the best of my knowledge.Agua Drilling & Development Inc Number 163  
P.O. Box 1002 CDA IDA  
Address 1002 CDA IDA  
Signed By David J. Smith Date Oct 8, 72