


91-7534 RODGERS 2004 PIN RP46N02W064121A

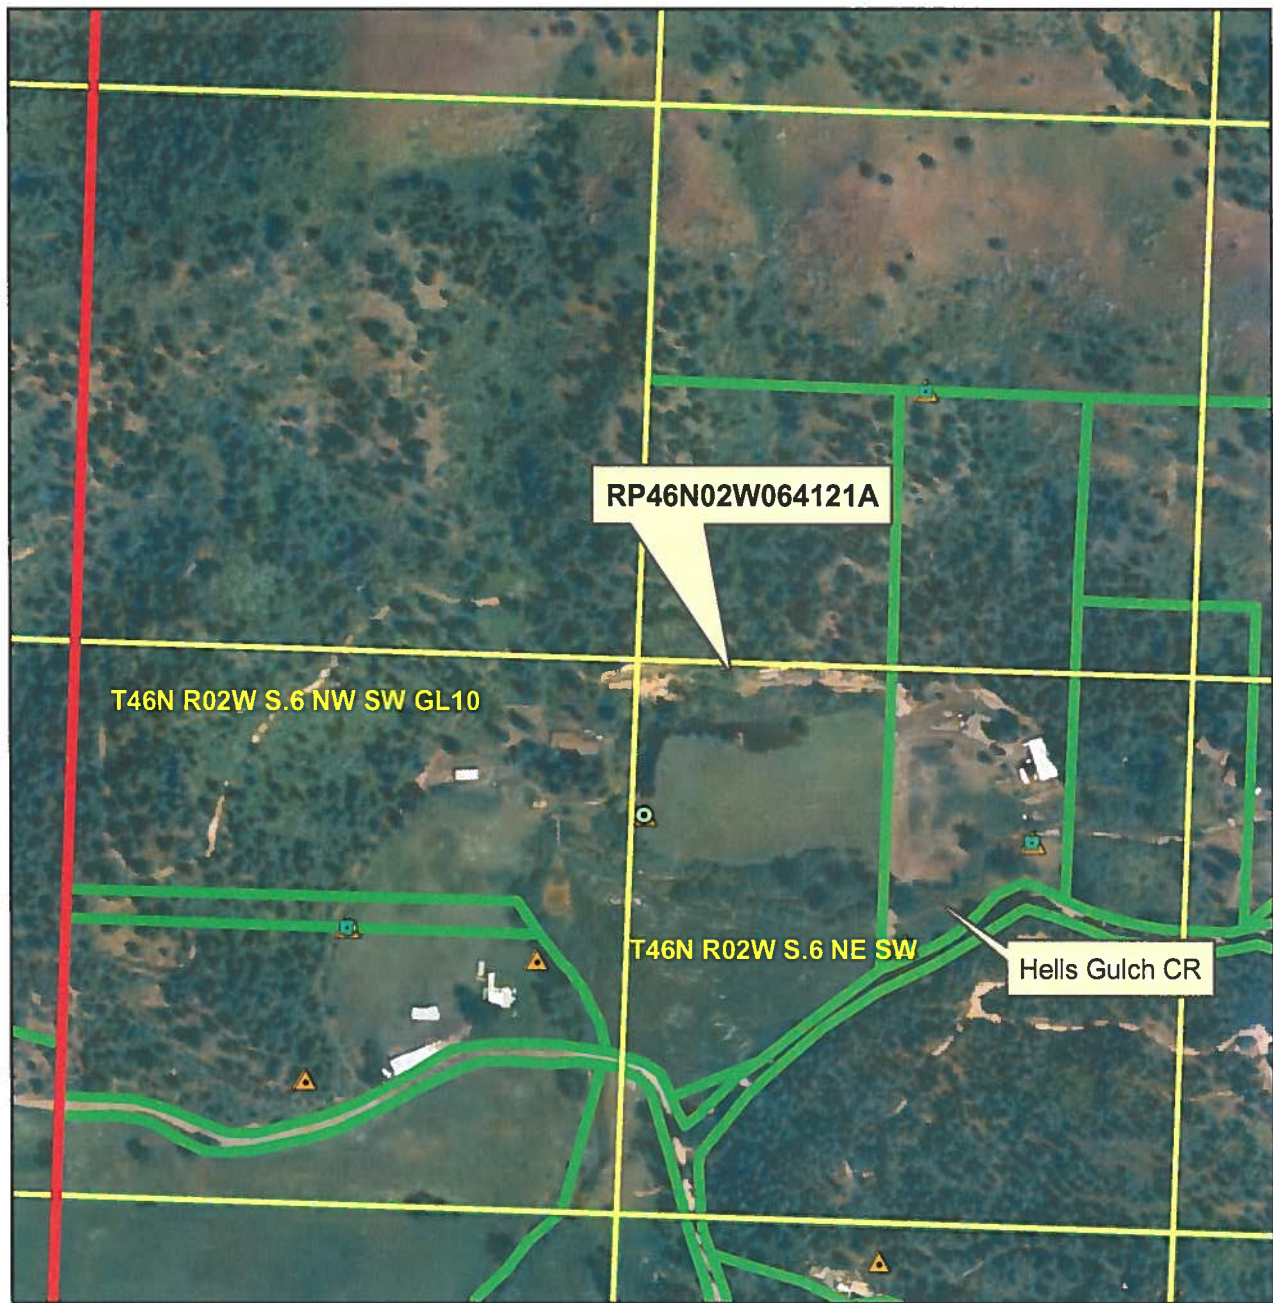

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Office Use Only
Inspected by _____
Twp _____ Rge _____ Sec _____
_____ 1/4 _____ 1/4 _____ 1/4
Lat: : : Long: : :

1. WELL TAG NO. D 00033928
 DRILLING PERMIT NO. 819.511
 Other IDWR No. _____

2. OWNER: Darrell Maher
Name
Address 1133 Goose Haven Rd.
City St. Maries State ID Zip 83861

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

N
 W E S
 Twp. 46 North ☒ or South ☐
 Rge. 2 East ☐ or West ☒
 Sec. 6 1/4 N/W 1/4 S/W 1/4
 Gov't Lot 10 10 acres 40 acres 160 acres
 County Benewah
 Lat. : : Long. : :
 Address of Well Site 1133 Goose
Haven Rd. City St. Maries
 (Give at least name of road + Distance to Road or Landmark)

Lt. Bk. Sub. Name_____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER		PACK		AMOUNT	METHOD
Material	From	To	Sacks or Pounds		
Bentonite	0	20	6.5x.	Pour Around Pipe	

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 29'
Was drive shoe seal tested? ☒ Y ☐ N How? Air

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+ 3	- 79	250	Steel	☒	☐	☒	☐
					☐	☐	☐	☐
					☐	☐	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

Perforations Method None
Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
						☐	☐
	None					☐	☐
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

8' ft. below ground Artesian pressure _____ lb.
Depth flow encountered 72' ft. Describe access port or
control devices: well cap

46 N 2W 6

11. WELL TESTS:

☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
30+	G.P.M. Air Lift from		80'

Water Temp. 52° Bottom hole temp. _____
Water Quality test or comments: clear no odor

Depth first Water Encounter 40

12. LITHOLOGIC LOG: (Describe repairs or abandonment) Water

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Y	N
8"	0	2	Top Soil		
	2	14	Clay Brown		
	14	40	Clay - Brown - silty		
	40	42	clay - Brown - silty w/water		
			2 g.p.m.		
	42	72	clay - Brown - silty		
	72	80	gravel w/water		
			30+ g.p.m.		

Completed Depth 80 (Measurable)
Date: Started 7-8-04 Completed 7-9-04

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name Action Drilling Firm No. 618

Firm Official Alvin Carriz Date 8-6-04

Driller or Operator _____ Date _____

(Sign once if Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES