

**WELL DRILLER'S REPORT
RECEIVED**

Office Use Only			
Inspected by _____			
Twp _____	Rge _____	Sec _____	
1/4	1/4	1/4	
Lat: _____	_____	Long: _____	_____

1. WELL TAG NO. D0674257 17257

Drilling Permit No: _____
Other IDWR No. 770311

JUN - 6 2001

2. OWNER


Name Michael Groves

Address 1451 SW 10th Avenue

City Oak Harbor State WA Zip 98277

3. LOCATION OF WELL by legal description

sketch map location must agree with written location

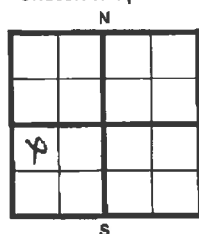

Twp. 48 ☒ North or ☐ South
Rge. 01 ☐ East or ☒ West
Sec. 03 1/4 NW 1/4 SW 1/4

Gov't Lot _____ County KOOTENAI

Lat: _____ Long: _____

Address of Well Site River Road
City Cataldo

(Give at least name of road + Distance to Road or Landmark)

Lt. _____ Blk. _____ Sub. Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
WELL SEAL				
BENTONITE	0	18	5 bags	overbore

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 18

Was drive shoe seal tested? ☐ Y ☐ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6	+2	-18	.250	steel	☒	☐	☒	☐
4	-5	-205	.160	PVC	☐	☒	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☒ Perforations Method skill saw
☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
-165	-205	1/8x4	140	4	pvc	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

10 ft. below ground Artesian pressure _____ lb.

Depth flow encountered _____ ft. Describe access port or control devices: _____

11. WELL TESTS:

☐ Pump ☐ Bailor ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
est 25-30		205	1 hour

Water Temp. cold Bottom Hole Temp cold

Water Quality test or comments: _____

Depth first Water encountered 121

12. LITHOLOGIC LOG:(Describe repairs or abandonment)

				Water	
Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Y	N
8	0	4	Soil w/broken shale	☐	☒
8	4	18	Shale tan medium soft	☐	☒
6	18	121	Shale tan w/brown streaks	☐	☒
6	121	128	Shale fractured w/H2O apx 5-8 gpm	☒	☐
6	128	175	Shale blue-green	☐	☒
6	175	185	Shale fractured w/H2O apx 20-30 gpm	☒	☐
6	185	205	Shale blue-green	☐	☒

Completed Depth 205 (Measurable)
Date: Started 6/1/01 Completed 6/1/01

RECEIVED

SEP 14 2001

Department of Water Resources

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name H2O WellService, Inc Firm No. 448

Firm Official [Signature] Date 6-5-01

and Supervisor or Operator [Signature] Date 6-3-01

(Sign Once if Firm Official and Operator)

Louie Hanner

SCANNED

JUL 11 2014

48N 1W 3