

RECEIVED

Form 238-11/97 OCT 22 2002

IDAHO DEPARTMENT OF WATER RESOURCES

WELL DRILLER'S REPORT

IDWR/North

1. WELL TAG NO. D 00022728

DRILLING PERMIT NO. 784888

Other IDWR No. _____

2. OWNER:


Name Larry Stogsdill

Address P.O. Box 77

City St. Maries State ID Zip 83861

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

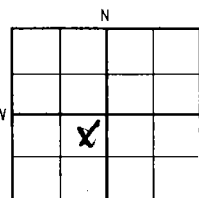

Twp. 47 North ☒ or South ☐
Rge. 2 East ☐ or West ☒
Sec. 33 1/4 N/E 1/4 S/W 1/4
Gov't Lot _____ County Beneah
Lat: _____ Long: _____

Address of Well Site Mile Post 8
Hells Gulch City St. Maries
(Give at least name of road + Distance to Road or Landmark)

Lt. _____ Blk. _____ Sub. Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT		METHOD
Material	From	To	Sacks or Pounds		
<u>Bentonite</u>	<u>0</u>	<u>25</u>	<u>85</u>		<u>Pour Around Pipe</u>

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 101

Was drive shoe seal tested? ☒ Y ☐ N How? Air

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
<u>6"</u>	<u>+1</u>	<u>-101</u>	<u>250</u>	<u>Steel</u>	☒	☐	☒	☐
<u>4"</u>	<u>-5</u>	<u>-302</u>	<u>160</u>	<u>PVC</u>	☐	☒	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

Perforations Method Drill
Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
<u>262</u>	<u>302</u>	<u>1"</u>	<u>40</u>	<u>4"</u>	<u>PVC</u>	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

38 ft. below ground Artesian pressure _____ lb.

Depth flow encountered 209 ft. Describe access port or

control devices: well cap

47N 2W 33



11. WELL TESTS:

☐ Pump ☐ Bailor ☐ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
<u>49 gpm</u>	<u>Air lift from 300'</u>		

Water Temp. 48° Bottom hole temp. _____

Water Quality test or comments: Clear no odor

Depth first Water Encounter 102

12. LITHOLOGIC LOG: (Describe repairs or abandonment) Water

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Y	N
<u>8"</u>	<u>0</u>	<u>102</u>	<u>Clay - Tan</u>		
<u>8"</u>	<u>102</u>	<u>107</u>	<u>Shale - Gray w/water</u>	☒	
			<u>1 gal</u>		
<u>6"</u>	<u>107</u>	<u>269</u>	<u>Shale - Gray</u>		
	<u>269</u>	<u>270</u>	<u>Shale - Gray - Broken</u>		
			<u>w/water 2 gal</u>	☒	
	<u>270</u>	<u>302</u>	<u>Shale gray</u>		

Completed Depth 302 (Measurable)
Date: Started 9-4-02 Completed 9-6-02

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name All-Ways Drilling Inc. Firm No. 510

Firm Official Stanley K. Rude Date 10-5-02

and _____

Driller or Operator Abin Garris Date 9-30-02

(Sign once if Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES