

IDAHO DEPARTMENT OF WATER RESOURCES

WELL DRILLER'S REPORT

Use Typewriter or Ballpoint Pen

Office Use Only			
Inspected by _____			
Twp _____	Rge _____	Sec _____	
1/4 _____		1/4 _____	
Lat: _____	_____	Long: _____	_____

1. DRILLING PERMIT NO. TAG#D3961

Other IDWR No. _____

95-98-N-97

2. OWNER

Well Number: _____

Name LAMPARD, WILLIAM

722

Address RT 2 BOX 73


City HARRISON

State ID Zip 83833

3. LOCATION OF WELL by legal description

sketch map location must agree with written location

POSTED

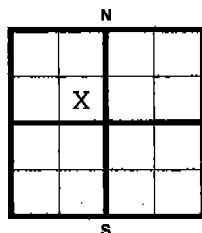

Twp. 49

North or ☐ South

Rge. 03

East or ☒ West

Sec. 31



1/4 SE 1/4 NW 1/4

Gov't Lot _____



County KOOTENAI

Lat: _____



Long: _____

Address of Well Site CARLIN BAY OFF H

City HARRISON

(Give at least name of road + Distance to Road or Landmark)

Blk. _____

Sub. Name _____

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
BENTONITE	0	30	8 BAGS	OVERBORE

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 58Was drive shoe seal tested? ☐ Y ☐ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner Welded	Threaded
6	+2	58	.250	STEEL	☒	☐	☒
4	-25	200	.160	PVC	☐	☒	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☒ Perforations Method SKILLSAW☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
160	200	1/8X4	170	4	PVC	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

60 ft. below ground Artesian pressure _____ lb.

Depth flow encountered _____ ft. Describe access port or control devices: _____

49N 3W 531

11. WELL TESTS:

☐ Pump ☐ Bailor ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
15+ GPM			

Water Temp. _____ Bottom Hole Temp _____

Water Quality test or comments: _____

Depth first Water encountered 75

12. LITHOLOGIC LOG:(Describe repairs or abandonment)

				Water	
Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Y	N
8	0	0		☐	☐
8	0	24	Soil W/Basalt Gravel	☐	☒
8	24	55	Basalt Cemented W/Clay	☐	☒
8	55	70	Shale Tan Soft	☐	☒
6	70	150	Shale Gray & Brown W/Water 3-4 gp	☒	☐
6	150	175	Shale Green Medium	☐	☒
6	175	180	Shale Green W/Water Approximately 1	☒	☐
6	180	200	Shale Green Medium Hard	☐	☒
RECEIVED JUL 06 1998 NORTHERN REGION IDWR					
Completed Depth 200' (Measurable)					
Date: Started 6/30/98 Completed 6/30/98					

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name H2O WellService, Inc. Firm No. 448

Firm Official John Whiting Date 6/30/98

and Supervisor or Operator Date 6/30/98

(Sign Once if Firm Official and Operator)
(Louie Hanner)