

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Office Use Only
Inspected by Bob Haynes
Twp 52N Rge 4W Sec 15
SW 1/4 NW 1/4 SW 1/4
Lat: : : Long: : :

1. WELL TAG NO. D0039812

Drilling Permit No: 827803

Other IDWR No. _____

CORRECTED REPORT

11. WELL TESTS:

☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
25+			

Water Temp. Cold Bottom Hole Temp Cold

Water Quality test or comments: Good & Clear

Depth first Water encountered 325

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Diam	From	To	Remarks: Lithology, Water Quality, Temperature	Water	
				Y	N
10	0	3	Top Soil	☐	☒
10	3	18	Gravel & sand course	☐	☒
8	18	109	Gravels & sand course	☐	☒
8	109	124	Boulders & gravels	☐	☒
8	124	300	Sand & Gravel	☐	☒
8	300	389	Sand Fine with Silt blueish gray	☒	☐
8	389	408	Sand some Gravel blue	☒	☐
8	408	415	Gravel & Sand Brown	☒	☐
8	415	415	No Screen Installed	☐	☐
8	415	415	Made good water in course gravels at 408	☐	☐

RECEIVED
JAN 20 2005
IDWR/North

Completed Depth 415 (Measurable)
Date: Started 12/30/2004 Completed 1/5/2005

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards
were complied with at the time the rig was removed.

Firm Name H2O WellService, Inc. Firm No. 448

Firm Official [Signature] Date 1-12-05

and
Supervisor or Operator [Signature] Date 01/06/05
Louie Hanner (Sign Once if Firm Official and Operator)

2. OWNER

Name Burlison, Rod Well #3

Well Number:

898


Address PO Box 2877

City CDA

State ID Zip 83816

3. LOCATION OF WELL by legal description

sketch map location must agree with written location

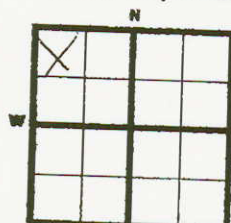

Twp. 53 ☒ North or ☐ South

Rge. 04 ☐ East or ☒ West

Sec. 36 1/4 NE 1/4 NW 1/4

Gov't Lot _____ County KOOTENAI

Lat: : : Long: : :

Address of Well Site Mary Lane

City Rathdrum

(Give at least name of road + Distance to Road or Landmark)

Lt. 4 Blk. 1 Sub. Name Mary's Acres

4. USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation

☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement, etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To		
BENTONITE	0	18	500 lbs	Overbore

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 415

Was drive shoe seal tested? ☐ Y ☒ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6	+2	415	.250	Steel	☒	☐	☒	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☐ Perforations Method _____

☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

310 ft. below ground Artesian pressure _____ lb.

Depth flow encountered _____ ft. Describe access port or control devices: _____

53N 4W 36