

REPORT OF WELL DRILLER
State of Idaho

RECEIVED

JUN 13 1969

ENTD

State law requires that this report shall be filed with the State Department of Reclamation Engineer within 30 days after completion or abandonment of the well.

WELL OWNER:

Name Hedlund Lumber Co.

Address 808 North Boyer

Sandpoint, Idaho 95-69-N-39

Owner's Permit No. 95-7033

NATURE OF WORK (check): Replacement well ☐

New well ☒ Deepened ☐ Abandoned ☐

Water is to be used for: Fire Protection

METHOD OF CONSTRUCTION: Rotary ☐ Cable ☒

Dug ☐ Other ☐

(explain)

CASING SCHEDULE: Threaded ☐ Welded ☒

12" "Diam. from 1 ft. to 170 ft.

"Diam. from ft. to ft.

"Diam. from ft. to ft.

"Diam. from ft. to ft.

Thickness of casing: 3/8 Material:

Steel ☒ concrete ☐ wood ☐ other ☐

(explain)

PERFORATED? Yes ☒ No ☐ Type of

perforator used: Mills Knife

Size of perforations: 3/8" " by 1/2"

276' perforations from 106' ft. to 129' ft.

perforations from ft. to ft.

perforations from ft. to ft.

perforations from ft. to ft.

WAS SCREEN INSTALLED? Yes ☐ No ☒

Manufacturer's name

Type Model No.

Diam. Slot size Set from ft. to ft.

Diam. Slot size Set from ft. to ft.

CONSTRUCTION: Well gravel packed? Yes ☐

No. ☒ size of gravel Gravel

placed from ft. to ft. Surface seal

provided? Yes ☒ No ☐ To what depth?

20' ft. Material used in seal: cement

Did any strata contain unusable water? Yes ☐

No. ☒ Type of water:

Depth of strata ft. Method of sealing


strata off: Clay layers of water material

& Barbed Shells

Surface casing used? Yes ☒ No ☐

Cemented in place? Yes ☒ No ☐

Locate well in section

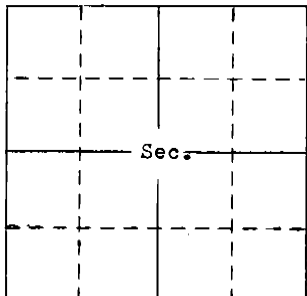

LOCATION OF WELL: County Kootenai

SW 1/4 SE 1/4 Sec. 37 T. 52 N. R. 3 W

Size of drilled hole: 12" Total

depth of well: 276 Standing water

level below ground: 85 Temp.

Fahr. Test delivery: gpm

or cfs Pump? ☒ Bail ☐

Size of pump and motor used to make test:

50hp 1200 8' 10" 10' 10"

Length of time of test: 8 Hrs. 0 Min. 0

Drawdown: 5 ft. Artesian pressure: ft.

above land surface Give flow cfs

or 1200 gpm. Shutoff pressure:

Controlled by: Valve ☐ Cap ☐ Plug ☐

No control ☐ Does well leak around casing?

Yes ☐ No ☒

DEPTH

MATERIAL

WATER

FROM TO

YES OR NO

FEET FEET

0'	38'	Large gravel & clay	no
38'	83'	Sand, gravel & clay	no
83'	129'	Sand & gravel	yes
129'	135'	Clay, sand & gravel	yes
135'	139'	Blue clay & gravel	no
139'	141'	Pea gravel & clay	water
141'	162'	Brown clay & gravel	no
162'	164'	Brown sand & water	water
164'	183'	Brown clay	no
183'	200'	Clay, grey	no
200'	200'	Sandy grey clay	no
220'	240'	Blue clay & sand	no
240'	253'	Blue clay	no
253'	270'	Granite band	no

Work started: 2/12/69

Work finished: 3/15/69

Well Driller's Statement: This well was drilled under my supervision and this report is true to the best of my knowledge.

Name E. A. Kalmann Drilling Co.

Address: 601 So. Dixon

Signed by: J. A. Kalmann Jr.

License No. 105 Date: 6-2-69

Use other side for additional remarks

95