RECEIVED
JUL 17 1996
NORTHERN REGION

Form 238-7
3/95

POSTED

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Use Typewriter or Ballpoint Pen


96186

Office Use Only
Inspected by _____
Twp____ Rge____ Sec ____
____1/4 ____1/4 ____1/4
Lat: : : Long: : :

1. DRILLING PERMIT NO. 87-96-N-0027-000
Other IDWR No. _____

2. OWNER: Ken Chamberlin PO Box 2325 CS Pullman Wa 99165
Name Lue Kuehner
Address PO Box 2325 CS
City Pullman State Wa Zip 99165

3. LOCATION OF WELL by legal description:
Sketch map location must agree with written location.

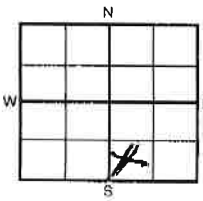

Twp. 39 North ☑ or South ☐
Rge. 5 East ☐ or West ☑
Sec. 16 , ____ 1/4 SW 1/4 SE 1/4
(10 acres, 40 acres, 160 acres)
Gov't Lot ____ County Latah
Lat: : : Long: : :
Address of Well Site _____
_____ City _____
(Give at least name of road + Distance to Road or Landmark)
Lt. _____ Blk. _____ Sub. Name _____

4. USE:
☑ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)
☑ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD
☑ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
Bentonite	-3	24	6 bags	Dry

Was drive shoe used? ☑Y ☐N Shoe Depth(s) _____
Was drive shoe seal tested? ☐Y ☐N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+2	76	250	Steel	☐	☐	☑	☐
4½"	-63	-128	160#	PVC	☐	☑	☐	☐
					☐	☐	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS
☐ Perforations Method _____
☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
						☐	☐
						☐	☐
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:
60 ft. below ground Artesian pressure _____ lb.
Depth flow encountered _____ ft. Describe access port or control devices: _____

SWSE 16 39N 5W

11. WELL TESTS:
☐ Pump ☐ Bailer ☑ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
40 to 60			

Water Temp. _____ Bottom hole temp. _____
Water Quality test or comments: good clear
Depth first Water Encountered _____

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Water Y	Water N
8	0	2	dirt		✓
8	2	5	clay		✓
8	5	38	sand		✓
8	38	69	clay		✓
6	69	108	mud soft basalt		✓
	108	111	clay		✓
	111	114	mud & gravel	✓	
	114	125	basalt soft	✓	

Completed Depth 125 (Measurable)
Date: Started July 9, 96 Completed July 9, 96

13. DRILLER'S CERTIFICATION
I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name Uhlenkott Drilling Firm No. 125
Firm Official Ray Uhlenkott Date July 13, 96
and
Supervisor or Operator Ray Uhlenkott Date July 13, 96
(Sign once if Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES