

IDAHO DEPARTMENT OF WATER RESOURCES 95340
WELL DRILLER'S REPORT

Office Use Only
Inspected by _____
Twp _____ Rge _____ Sec _____
1/4 _____ 1/4 _____ 1/4 _____
Lat: _____ Long: _____

1. WELL TAG NO. D 0008070

DRILLING PERMIT NO. 47-99-S-0053-000

Other IDWR No. WR 47-02306B

2. OWNER:


Name Hank C. Haflinger

Address 3772 N. 1700 E.

City Buhl State ID Zip 83316

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

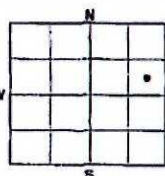

Twp. 11 North ☐ or South ☒
Rge. 16 East ☒ or West ☐
Sec. 6 1/4 SE 1/4 NE 1/4
Gov't Lot _____ County Twin Falls
Lat: _____ Long: _____

Address of Well Site 2200 E. 3490 N.

City Eller

(Give at least name of road + Distance to Road or Landmark)
Lt. _____ Blk. _____ Sub. Name _____

4. USE:

☐ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☒ Other commercial

5. TYPE OF WORK: check all that apply (Replacement etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other _____

6. DRILL METHOD:

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other _____

7. SEALING PROCEDURES:

Seal/Filter Pack			AMOUNT Sacks or Pounds	METHOD
Material	From	To		
Bentonite	0	19	200lbs.	dry pour

Was drive shoe used? ☐ Y ☒ N Shoe Depth(s) _____

Was drive shoe seal tested? ☐ Y ☒ N How? _____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
8	+1	19	.25	steel	☒	☐	☐	☐

Length of Headpipe 1' Length of Tailpipe _____

9. PERFORATIONS/SCREENS:

☐ Perforations ☐ Screens Method _____ Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

262 ft. below ground Artesian pressure _____ lb.
Depth flow encountered _____ ft. Describe access port or control devices: well cap

11. WELL TESTS:

Yield gal./min.	Drawdown	Pumping Level	Time

Water Temp. <85 Bottom hole temp. _____

Water Quality lost or comments: _____

Depth first Water Encounter 305'

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Water
10	0	14	top soil & clay	
10	14	19	med. lava	
8	19	100	med. lava	
8	100	106	red ash & red lava cinders	
8	106	124	med. lava	
8	124	131	soft lava cinders	
8	131	163	med. lava	
8	163	167	fractured & cinders	
8	167	187	med. lava	
8	187		soft lava cinders no	
			205 returns	
8	205	230	soft lava	
8	230	250	med. lava	
8	250	255	cinders	
8	255	305	med. to soft lava	X
8	305	322	med. lava	X
8	322	330	soft lava	X
8	330	355	soft lava	X

RECEIVED
JUN 29 1999
JUN 04 1999

Department of Water Resources
Southern Region

Completed Depth 355' (Measurable)
Date: Started 4/19/99 Completed 4/23/99

13. DRILLER'S CERTIFICATION:

We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name Eaton Drilling & Pump Service Inc. Firm No. 26
Firm Official [Signature] Date 5/26/99
and
Driller or Operator [Signature] Date 5/26/99
(Sign once if Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES

IDAHO DEPARTMENT OF WATER RESOURCES

WELL DRILLER'S REPORT 053781

1. WELL TAG NO. D 0008071

DRILLING PERMIT NO. 47-99-3-0054-000

Other IDWR No.

2. OWNER:

Name Henry C. Hafliker

Address 3772 N. 1700 E.

City Buhl State ID Zip 83316

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.

Sketch map location must agree with written location.

W Twp. 11 North ☐ or South ☒
Rge. 16 East ☒ or West ☐
Sec. 6 1/4 SE 1/4 NE 1/4
Gov't Lot County Twin Falls
Lat. Long.
Address of Well Site 2200 E. 3490 N.
City Filer

(Give at least name of road - Distance to Road or Landmark)
Lt. Bk. Sub. Name

4. USE:

☐ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☒ Other commercial

5. TYPE OF WORK: check all that apply

(Replacement etc.)

☒ New Well ☐ Modify ☐ Abandonment ☐ Other

6. DRILL METHOD:

☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other

7. SEALING PROCEDURES:

Seal/Filter Pack		AMOUNT		METHOD
Material	From To	From To	Sacks or Pounds	
Bentonite	0 19	200 lbs.		dry pour

Was drive shoe used? ☐ Y ☒ N Shoe Depth(s)

Was drive shoe seal tested? ☐ Y ☒ N How?

8. CASING/LINER:

Diameter	From To	Gauge	Material	Casing	Liner	Welded	Threaded
8	+1 19	.25	steel	☒	☐	☐	☐

Length of Headpipe 1' Length of Tailpipe

9. PERFORATIONS/SCREENS:

☐ Perforations Method
☐ Screens Screen Type

From To	Slot Size	Number	Diameter	Material	Casing	Liner
					☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

262 ft. below ground Artesian pressure lb.
Depth flow encountered ft. Describe access port or control devices: well cap

Office Use Only
Inspected by
Twp Rge Sec
1/4 1/4 1/4
Lat: : : Long: : :

11. WELL TESTS:

Yield gal./min.	Drawdown	Pumping Level	Time

Water Temp. <85

Bottom hole temp.

Water Quality test or comments:

Depth first Water Encounter 305'

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From To	Remarks: Lithology, Water Quality & Temperature	Water Y N
10	0 14	top soil clay	
10	14 19	med. lava	
8	19 37	med. lava	
8	37 40	cinders	
8	40 47	med. lava	
8	47 50	cinders no returns	
8	50 60	med. lava	
8	60 63	broken	
8	63 175	med. lava	
8	175 180	soft lava cinders	
8	180 298	soft lava	
8	298 305	soft lava cinders	X
8	305 330	soft lava fractured	X
8	330 355	soft lava fractured	X

RECEIVED

JUN 24 1999

Department of Water Resources

RECEIVED

JUL 15 1999

MICROFILMED

JUL 1 1999

Department of Water Resources

Completed Depth 355' (Measurable)
Date: Started 4/23/99 Completed 5/1/99

13. DRILLER'S CERTIFICATION:

We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name Eaton Drilling & Pump Service, Inc. Firm No. 26
Firm Official [Signature] Date 5/26/99
and [Signature]
Driller or Operator [Signature] Date 5/26/99
(Sign as Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES.