

IN-OFFICE BENEFICIAL USE EXAM REPORT

 Permit No. 63-33395 Prepared by SCurter Date 4/29/13

	Same as permit	Different than permit
Owner Name	☒	☐ _____
Owner Address	☒	☐ _____
Source	☒	☐ _____
Tributary	☒	☐ _____
POD	☒	☐ _____
POU	☒	☐ _____
Beneficial Use(s)	☒	☐ _____

Exam Fee Required for Permitted Rate \$ 50⁰⁰Exam Fee Paid \$ 50⁰⁰Overlaps ☐ Yes ☒ NoTechnical Confirmation Tools

ArcMap (Bing)



Govt Agency Records

Photo

GPS ☐

Taxlot

Photos ☐

Well Log

Diagrams ☐

Other

☐ explain: _____
 Conditions/Comments Taxlot data lot 6 matches addr. for HOA as listed on permit.
X01, X60, 103, X03, WB3 1-80 ft.
Exam Date Entered ☒Draft License Created ☒Shapes Updated ☒

IDAHO DEPARTMENT OF WATER RESOURCES WELL DRILLER'S REPORT

860853

1. WELL TAG NO. D 0057997

Drilling Permit No. **912203-860853**

Water right or injection well # _____

2. OWNER

Name **concord commons hoa,inc**

Address **1715 w.bannock**

City **boise** State **id** Zip **83702**

3. WELL LOCATION:

Twp. **3** North ☒ or South ☐ Rge. **2** East ☒ or West ☐

Sec. **7** **SE** 1/4 **SW** 1/4 **SE** 1/4
10 acres 40 acres 160 acres

Gov't Lot _____ County **ada**

Lat. **43 ° 36.379** (Deg. and Decimal minutes)

Long. **1116 ° 15.612** (Deg. and Decimal minutes)

Address of Well Site **158 n.seafury Ln**

City **boise**

(Give at least name of road or distance to road or landmark)

Lot. **1** Blk. **1** Sub. Name **concord commons sub**

4. USE:

☐ Domestic ☐ Municipal ☐ Monitor ☒ Irrigation ☐ Thermal ☐ Injection
☐ Other _____

5. TYPE OF WORK check all that apply (Replacement etc.)

☒ New Well ☐ Replacement well ☐ Modify existing well
☐ Abandonment ☐ Other _____

6. DRILL METHOD:

☐ Air Rotary ☐ Mud Rotary ☒ Cable ☐ Other _____

7. SEALING PROCEDURES

Seal material	From (ft)	To (ft)	Quantity (lbs or ft³)	Placement method/procedure
3/8bentonite	0	40	1200	pour

8. CASING/LINER:

Diameter (nominal)	From (ft)	To (ft)	Gauge/Schedule	Material	Casing	Liner	Threaded	Welded
6	+2	74	.250	steel	☒	☐	☐	☒
5	70	75	.250	steel	☐	☐	☐	☒

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) **73**

9. PERFORATIONS/SCREENS:

Perforations ☐ Y ☒ N Method _____
Manufactured screen ☒ Y ☐ N Type **john**
Method of installation **set in**

From (ft)	To (ft)	Slot size	Number/ft	Diameter (nominal)	Material	Gauge or Schedule
75	80	.20	5	5	ss	.250

Length of Headpipe **4'5"** Length of Tailpipe _____

Packer ☒ Y ☐ N Type **k-packer**

10. FILTER PACK:

Filter Material	From (ft)	To (ft)	Quantity (lbs or ft³)	Placement method
-----------------	-----------	---------	-----------------------	------------------

11. FLOWING ARTESIAN:

Flowing Artesian? ☐ Y ☒ N Artesian Pressure (PSIG) _____

Describe control device _____

12. STATIC WATER LEVEL and WELL TESTS:

Depth first water encountered (ft) **45** Static water level (ft) **42**

Water temp. (°F) **56** Bottom hole temp. (°F) _____

Describe access port **cap**

Well test:

Test method:

Drawdown (feet)	Discharge or yield (gpm)	Test duration (minutes)	Pump	Bailer	Air	Flowing artesian
38	25	2hr	☒	☐	☐	☐

Water Quality test or comments: _____

13. LITHOLOGIC LOG and/or repairs or abandonment:

Bore Dia. (in)	From (ft)	To (ft)	Remarks, lithology or description of repairs or abandonment, water temp.	Water	
				Y	N
10	0	6	top soil		x
10	6	40	gravel		x
6	40	45	gravel		x
6	45	80	gravel	x	

RECEIVED

APR 06 2011

WATER RESOURCES
WESTERN REGION

Completed Depth (Measurable) _____

80

Date: Started **3-28-11** Completed **4-1-11**

14. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name **Waterpro Well Drilling Inc.** Co. No. **626**

*Principal Driller **Monte Post** Date **4-1-11**

*Driller _____ Date _____


*Operator II _____ Date _____

Operator I _____ Date _____

* Signature of Principal Driller and rig operator are required.

34

PLAT OF
CONCORD COMMONS SUBDIVISION
A RESUBDIVISION OF LOT 50, BRIDGE FIRST SUBDIVISION
LYING ON THE SE 1/4, SECTION 7, T.1N., R.2E., B.1M.
BOISE, ADA COUNTY, IDAHO
2003

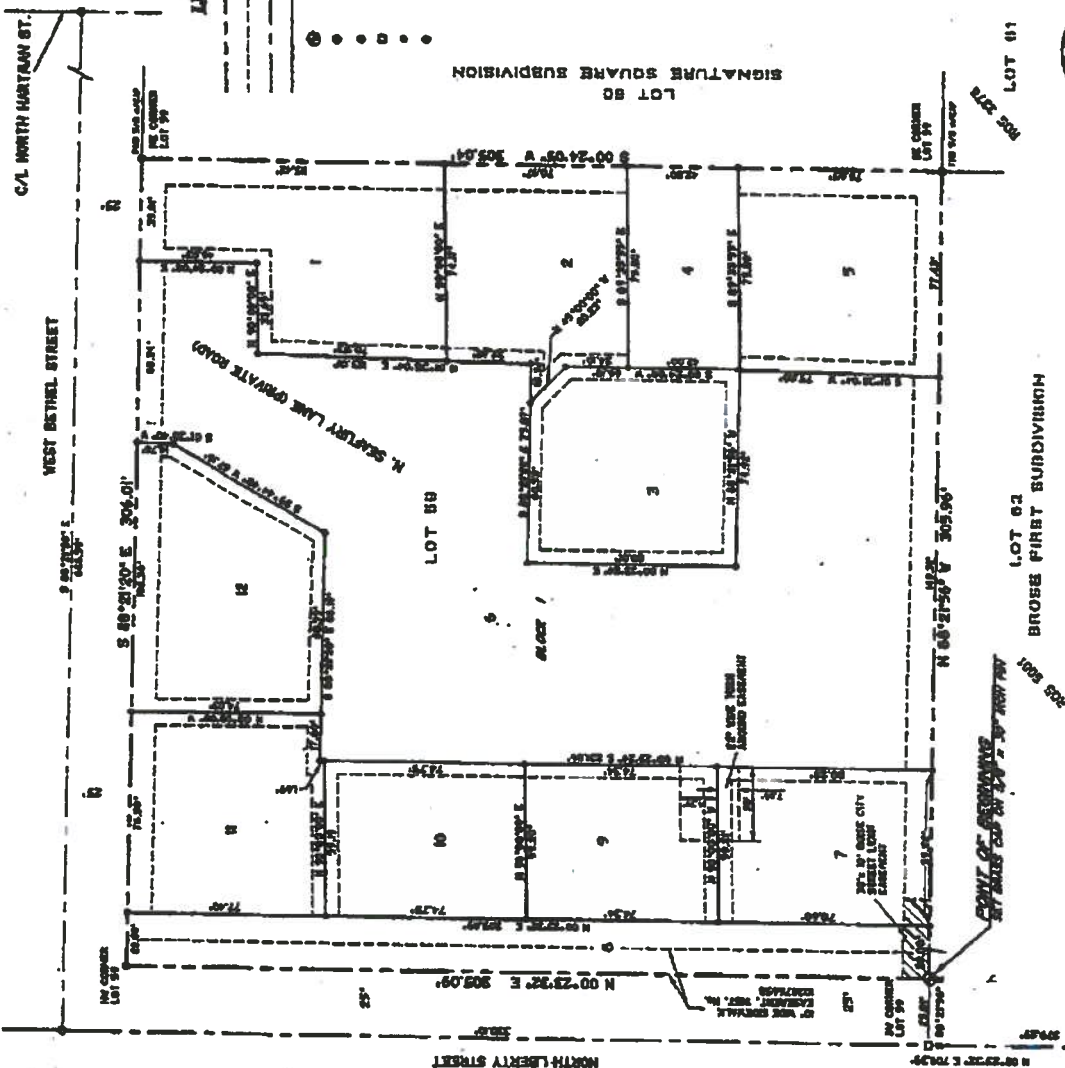

63-33345

L. 1-12, 86.1
Concerns Commons Sub.
Landscaping & building parking lot

NOTES:

- [illegible]

TEALEY'S LAND SURVEYING
2700 BROADWAY, SUITE 200, NEW YORK, NY 10008
212-691-1111

