

IDAHO DEPARTMENT OF WATER RESOURCES

WELL INSPECTION FORM

1. DRILLING PERMIT NO: NONE OTHER APPLICABLE NO: 47-08147
2. OWNER: MARILYN and DEALYN BAKER Phone: (208) 734-1845
Address: 3169 E 3500 N, TWIN FALLS, Idaho 83301
3. WELL LOCATION: Twp 11S, Rge. 17E, Sec. 02, SW 1/4 NE 1/4
County TWIN FALLS (Provide sketch map and photo on reverse.)
4. DRILLER: UNKNOWN Lic. No. UNKNOWN
When Drilled? UNKNOWN
5. WELL CONSTRUCTION:
Casing Diameter 6 inches Water tight cap? ☐ Yes ☒ No Access Port: ☒ Yes ☐ No
Casing $\geq$ 12 inches above ground? ☐ Yes ☒ No - Describe IT IS IN A WELL HOUSE 6" ABOVE FLOOR
Depth of Casing UNKNOWN ft. Method Drilled UNKNOWN
Condition of Well Casing: ☐ Good ☐ Fair ☒ Poor Describe IT LOOK VERY RUSTED AND CORRODED. I WASN'T USED.
Control Valve? ☐ Yes ☒ No Pressure Gauge: ☐ Yes ☒ No
Condition of Piping and Valving POOR VALVES WERE CORRODED SHUT.
Auger to a depth of 0 ft. Evidence of Annular Seal ☐ Yes ☒ No
Are there obvious construction problems that may be a source for contamination or waste of water?
☒ Yes ☐ No (Describe in Remarks and Attach Photo - On Reverse)
6. HYDROLOGIC INFORMATION:
Depth to Static Water UNKNOWN ft. Water Temperature UNKNOWN °F
Flowing Artesian ☐ Yes ☒ No Pressure: UNKNOWN (psi)
Water Sample Taken? ☐ Yes ☒ No If yes, describe purpose _____
Water Quality Measurements/Observations (Describe) _____
7. WELL USE:
☐ Domestic ☐ Irrigation ☒ Stock
☐ Test ☐ Municipal ☐ Industrial
☐ Abandoned ☐ Waste Disposal/Injection ☐ Not Used
☐ Other: _____

8. POSSIBLE CONTAMINATION SOURCES:

Is there evidence of Chemigation? ☐ Yes ☒ No

If yes, is there a check-valve present? ☐ Yes ☐ No

Is there a possible source of contamination nearby? ☒ Yes ☐ No

If yes, what Type? STOCK YARD


How far away from the well is this source? 75 FEET. (THE STOCK YARD IS DOWN HILL
GIL CONTAMINATION WOULD BE THROUGH
SEEPAGE.)

9. REMARKS: MY MAIN CONCERN IS THAT THIS WELL IS NO LONGER
CONNECTED TO A POWER SUPPLY YET THE ADJOINING
PRESSURE TANK SEEMS TO BE FILLED WITH WATER.
THIS WELL IS CONNECTED TO ~~THE~~ 3 OTHER WELLS.
I AM CONCERNED THAT WATER FROM THE OTHER WELLS IS
FILLING THE PRESSURE TANK WHICH COULD RELEASE
WATER BACK DOWN THE WELL.


Daniel A. Nelson, Summer Field Agent.
Signature of Dept. Representative & Title

4-10-97
Inspection Date

PHOTOS, DRAWINGS, OTHER ATTACHMENTS:

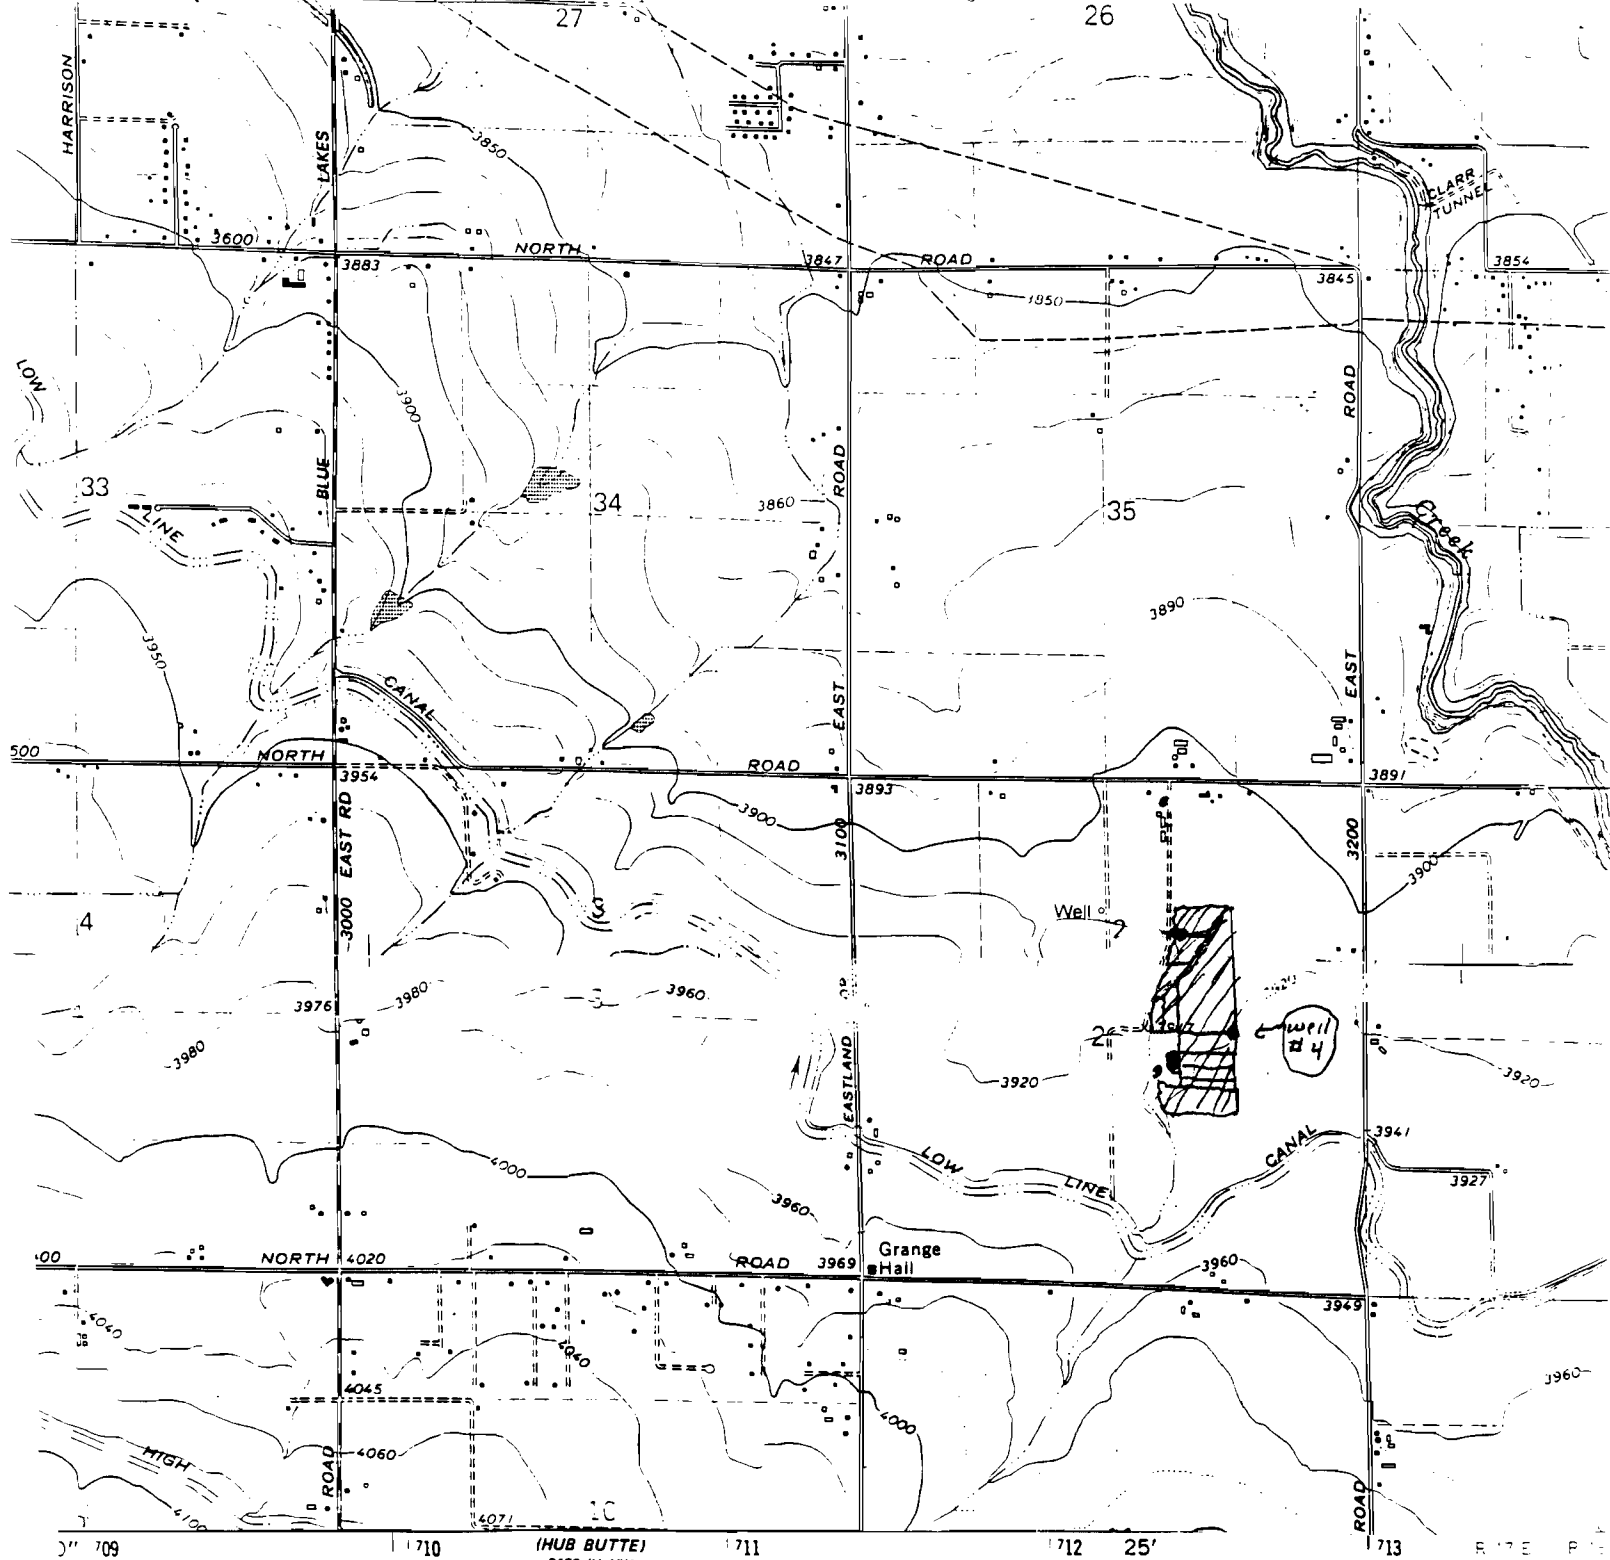

SCALE 1:24 000



CONTOUR INTERVAL 10 FEET
 DOTTED LINES REPRESENT 5-FOOT CONTOURS
 NATIONAL GEODETIC VERTICAL DATUM OF 1929

COMPLIES WITH U.S. GEOLOGICAL SURVEY STANDARDS FOR SPATIAL ACCURACY-CLASS 2
 FOR SALE BY U.S. GEOLOGICAL SURVEY
 DENVER, COLORADO 80225, OR RESTON, VIRGINIA 22092
 A FOLDER DESCRIBING TOPOGRAPHIC MAPS AND SYMBOLS IS AVAILABLE ON REQUEST



Prim
 har
 Sec
 har



This is the well head for
Well #4. It is not presently
connected to power.

The pressure tank seemed to
have water in it. I could not
tell for sure, it was sealed.