

IDAHO DEPARTMENT OF WATER RESOURCES

WELL INSPECTION FORM

1. DRILLING PERMIT NO: NONE FD. OTHER APPLICABLE NO: 47-08195

2. OWNER: BOKMA, HARRY & FLORA Phone: 543-4546
Address: 3919A NORTH 1000 EAST, BUHL, ID. 83316

3. WELL LOCATION: Twp 10S, Rge. 14E, Sec. 07, SE 1/4 SE 1/4
County TWIN FALLS (Provide sketch map and photo on reverse.)

4. DRILLER: EATON Lic. No. _____
When Drilled? 1984 JANUARY

5. WELL CONSTRUCTION:

Casing Diameter _____ inches Water tight cap? ☒ Yes ☐ No Access Port: ☒ Yes ☐ No
Casing $\geq$ 12 inches above ground? ☐ Yes ☒ No - Describe SEE PHOTO PG. 2/2
Depth of Casing _____ ft. Method Drilled _____
Condition of Well Casing: ☒ Good ☐ Fair ☐ Poor Describe _____
Control Valve? ☐ Yes ☐ No Pressure Gauge: ☒ Yes ☐ No
Condition of Piping and Valving _____
Auger to a depth of _____ ft. Evidence of Annular Seal ☐ Yes ☐ No
Are there obvious construction problems that may be a source for contamination or waste of water?
☐ Yes ☐ No (Describe in Remarks and Attach Photo - On Reverse)

6. HYDROLOGIC INFORMATION:

Depth to Static Water _____ ft. Water Temperature _____ °F
Flowing Artesian ☐ Yes ☐ No Pressure: 45 (psi)
Water Sample Taken? ☐ Yes ☒ No If yes, describe purpose _____
Water Quality Measurements/Observations (Describe) _____

7. WELL USE:

☐ Domestic ☐ Irrigation ☒ Stock
☐ Test ☐ Municipal ☐ Industrial
☐ Abandoned ☐ Waste Disposal/Injection ☐ Not Used
☒ Other: COMMERCIAL (DAIRY)



#47-08195 Bokma, Harry & Flora
Date: 30 Sept 1996

P/D=Section 7, T10S, R14E SE $\frac{1}{4}$ SE $\frac{1}{4}$

TO: Gary Funderberg
FROM: Georgia Satterlee
DATE: 08 November 1996
RE: Well Driller's Report

I have just completed a field examination for 47-08195. The well driller's report for Harry Bokma calls to Section 8, T10S, R14E SE $\frac{1}{4}$ SE $\frac{1}{4}$. Both of the wells for 47-08195 are located in Section 7, T10S, R14E, SE $\frac{1}{4}$ SE $\frac{1}{4}$. One well was drilled 1935 (photo page 1/2). Of course, no information found. According to Mr. Bokma, the newer well was drilled in 1983 $\pm$ (photo page 2/2).

I did a point of diversion search in the Section 8, T10S, R14E, SE $\frac{1}{4}$ SE $\frac{1}{4}$. The claims (47-04405 & 47-14274) are under the name of Severa. I did not find any well drilling reports and/or a drilling permit.

In conclusion, I believe the well driller's report has the incorrect section for Harry Bokma's newest well. I feel the report should have Section 7 instead Section 8.

9/82

STATE OF IDAHO
DEPARTMENT OF WATER RESOURCES

WELL DRILLER'S REPORT

State law requires that this report be filed with the Director, Department of Water Resources
within 30 days after the completion or abandonment of the well.USE TYPEWRITER OR
BALLPOINT PEN

JUN 29 1984

Department of Water Resources
Southwest District Office

1. WELL OWNER

Name HARRY BOKMA
Address BUTTE, IDA.
Owner's Permit No. _____

7. WATER LEVEL

Static water level 35 feet below land surface.Flowing? ☐ Yes ☒ No G.P.M. flow _____

Artesian closed-in pressure _____ p.s.i.

Controlled by: ☐ Valve ☐ Cap ☐ Plug

Temperature _____ °F. Quality _____

Describe artesian or temperature zones below.

2. NATURE OF WORK

☒ New well ☐ Deepened ☐ Replacement
☐ Abandoned (describe abandonment procedures such as materials, plug depths, etc. in lithologic log)

8. WELL TEST DATA

☐ Pump ☐ Bailor ☐ Air ☐ Other _____

Discharge G.P.M.	Pumping Level	Hours Pumped

3. PROPOSED USE

☒ Domestic ☐ Irrigation ☐ Test ☐ Municipal
☐ Industrial ☐ Stock ☐ Waste Disposal or Injection
☐ Other _____ (specify type)

9. LITHOLOGIC LOG

Bore Diam.	Depth		Material	Water Yes/No
	From	To		
8"	0	5	TOP SOIL	
6"	5	27	GREY LAVA	
↑	27	46	RED LAVA	
↓	46	73	GREY LAVA	
↓	73	87	RED LAVA	
6"	87	105	RED LAVA	

105 TOTAL DEPTH

5. WELL CONSTRUCTION

Casing schedule: ☒ Steel ☐ Concrete ☐ Other _____

Thickness	Diameter	From	To
250 inches	6 inches	1 feet	19 feet

Was casing drive shoe used? ☐ Yes ☒ NoWas a packer or seal used? ☐ Yes ☒ NoPerforated? ☐ Yes ☒ NoHow perforated? ☐ Factory ☐ Knife ☐ Torch

Size of perforation _____ inches by _____ inches

Number	From	To

Well screen installed? ☐ Yes ☒ No

Manufacturer's name _____

Type _____ Model No. _____

Diameter _____ Slot size _____ Set from _____ feet to _____ feet

Diameter _____ Slot size _____ Set from _____ feet to _____ feet

Gravel packed? ☐ Yes ☒ No ☐ Size of gravel _____

Placed from _____ feet to _____ feet

Surface seal depth 19 Material used in seal: ☐ Cement grout☒ Bentonite ☐ Puddling clay ☐ _____Sealing procedure used: ☐ Slurry pit ☐ Temp. surface casing☒ Overbore to seal depthMethod of joining casing: ☐ Threaded ☐ Welded ☐ Solvent

Weld _____


☐ Cemented between strata

Describe access port _____

10. Work started June, 1984 finished Jun 9, 1984

6. LOCATION OF WELL

Sketch map location must agree with written location.

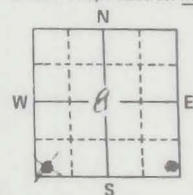

Subdivision Name _____

Lot No. _____ Block No. _____

County _____

T. 10 S. R. 14 E. Sec. 8

11. DRILLERS CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name C.B. FATH & SON'S Firm No. 26Address At 1, WEWDELL, IDA. Date 4/14/84Signed by (Firm Official) James L. Sisonand
(Operator) James L. Sison