RECEIVED 9/7/00 db

AUG 09 2000

IDWR/North

Form 238 11/97

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Office Use Only
Inspected by Per Assessor
Twp 57N Rge 4W Sec 30
1/4 NW 1/4 SE 1/4
Lat: : : Long: : :

1. WELL TAG NO. D0013322
DRILLING PERMIT NO. - - - -
Other IDWR No. 765513

2. OWNER:
Name Clayton C. Cabrinha
Address P.O. Box 804
City Priest River State ID Zip 83856

3. LOCATION OF WELL by legal description:
Sketch map location must agree with written location.

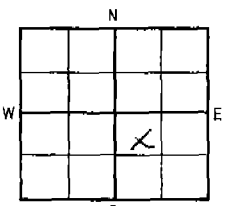

Twp. 57 North ☒ or South ☐
Rge. 04 East ☐ or West ☒
Sec. 30, 1/4 (10 acres) W 1/2 (NW) (40 acres) 1/4 SE 1/4 (160 acres)
Gov't Lot ____ County Bonner
Lat: : : Long: : :
Address of Well Site Peninsula Loop Rd City ____
(Give at least name of road + Distance to Road or Landmark)

Lt. ____ Blk. ____ Sub. Name ____

4. USE:
☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other ____

5. TYPE OF WORK check all that apply (Replacement etc.)
☒ New Well ☐ Modify ☐ Abandonment ☐ Other ____

6. DRILL METHOD
☒ Air Rotary ☐ Cable ☐ Mud Rotary ☐ Other ____

7. SEALING PROCEDURES

SEAL/FILTER PACK Material	From	To	AMOUNT Sacks or Pounds	METHOD
Bentonite	0	19	4 sck	Overbore

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) ____
Was drive shoe seal tested? ☐ Y ☐ N How? ____

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
6"	+1	304	250	steel	☒	☐	☒	☐
					☐	☐	☐	☐
					☐	☐	☐	☐

Length of Headpipe ____ Length of Tailpipe ____

9. PERFORATIONS/SCREENS
Perforations Method ____
Screens Screen Type ____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
						☐	☐
						☐	☐
						☐	☐

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:
257 ft. below ground Artesian pressure ____ lb.
Depth flow encountered 285 ft. Describe access port or control devices: welded well cap

11. WELL TESTS:
☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
8-10 gpm		257'	1 hr

Water Temp. 51 Bottom hole temp. ____
Water Quality test or comments: Clear
Depth first Water Encounter 285'

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Water Y	Water N
10	0	2	Topsoil		x
10	2	19	Clay - Brown		x
6	19	285	Clay - Brown		x
6	285	304	Broken Granite	x	

RECEIVED
OCT 20 2000
Department of Water Resources

Completed Depth 304' (Measurable)
Date: Started 7-03-00 Completed 7-13-00

13. DRILLER'S CERTIFICATION
I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Company Name Intermountain Drilling Devel Firm No. 513
Firm Official ____ Date 7-11-00
and
Driller or Operator Glen Frachiseur Date 7-11-00
(Sign once if Firm Official & Operator)

57N 4W 30 FORWARD WHITE COPY TO WATER RESOURCES