

RECEIVED

Form 238-7

7/94

AUG 02 1995

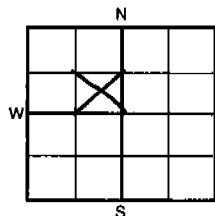
NORTHERN REGION
IDWRIDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORTUse Typewriter
or
Ball Point Pen1. DRILLING PERMIT NO. 97-95-N-40

Other IDWR No. _____

2. OWNER:

Name Donald & Teresa BrooksAddress P.O. Box 1846City Priest River State ID Zip 83856

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.Twp. 56 North ☒ or South ☐
Rge. 5 East ☐ or West ☒
Sec. 1 1/4 SE 1/4 NW 1/4
Gov't Lot _____ County Bonner

Address of Well Site _____

Above hill from Mill City Priest River
(Give at least name of road + Distance to Road or Landmark)Lt. 4 Blk. _____ Sub. Name Whispering Shadow

4. PROPOSED USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK

☒ New Well ☐ Modify or Repair ☐ Replacement ☐ Abandonment

6. DRILL METHOD

☐ Mud Rotary ☒ Air Rotary ☐ Cable ☐ Other _____

7. SEALING PROCEDURES

SEAL/FILTER PACK			AMOUNT	METHOD
Material	From	To	Sacks or Pounds	
<u>Bentonite casing seal</u>	<u>0</u>	<u>19</u>	<u>7</u>	<u>Overbore</u>

Was drive shoe used? ☒ Y ☐ N Shoe Depth(s) 19'Was drive shoe seal tested? ☒ Y ☐ N How? Air Pressure

8. CASING/LINER:

Diameter	From	To	Gauge	Material	Casing	Liner	Welded	Threaded
<u>6" +1</u>	<u>19'</u>	<u>250</u>	<u>Steel</u>	☒	☐	☒	☐	☐
<u>4" -7</u>	<u>160</u>	<u>160</u>	<u>PVC</u>	☐	☒	☒	☐	☐

Length of Headpipe _____ Length of Tailpipe _____

9. PERFORATIONS/SCREENS

☒ Perforations Method Sawcut (PVC only)
☐ Screens Screen Type _____

From	To	Slot Size	Number	Diameter	Material	Casing	Liner
<u>121</u>	<u>160</u>	<u>1/4" x 6"</u>	<u>32</u>	<u>4"</u>	<u>PVC</u>	☐	☒

10. STATIC WATER LEVEL OR ARTESIAN PRESSURE:

20 ft. below ground Artesian pressure _____ lb.

Depth flow encountered _____ ft. Describe access port or

control devices: Bolted well capSE NW 1 56N 5W

11. WELL TESTS:

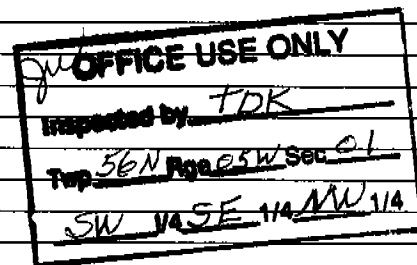
☐ Pump ☐ Bailer ☒ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Level	Time
<u>5+ GPM</u>			

Water Temp. Cold Bottom hole temp. CoolWater Quality test or comments: Good

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	Y	N
<u>8"</u>	<u>0</u>	<u>2</u>	<u>Top Soil</u>		
<u>"</u>	<u>2</u>	<u>10</u>	<u>Granite Boulders</u>		
<u>"</u>	<u>10</u>	<u>19</u>	<u>Granite w/ Fractures</u>		
<u>6"</u>	<u>19</u>	<u>160</u>	<u>Granite Hard w/ Fractures</u>	☒	

Completed Depth 160 (Measurable)
Date: Started 6-30-95 Completed 7-5-95

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name AQUA DRILLING & EXPLORATION INC. Firm No. 163Firm Official Scott M. Braum Pres. Date 7-5-95and Supervisor or Operator Scott M. Braum Date _____

(Sign once if Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES