

97-9653 – EVIDENCE OF PRIORITY
FROM BONNER COUNTY PARCEL DATA

Field	Value
ACRES	4.7
ADDRESS1	243 GROVES ADDITION
ADDRESS2	
CITY	OLDTOWN
COUNTY	Bonner
ID	15675730
LEGAL 1	14-56N-5W BODIE CANYON ACRES LOT 2
LEGAL2	<null>
LEGAL3	<null>
LEGAL4	<null>
LEGAL5	<null>
LEGAL6	<null>
OWNER	BUTLER TRUST
P_ADDRESS	1125 BODIE CANYON RD
P_ZIPCODE	83856
PIN	RP028040000020A
SOURCE	<null>
STATE	ID
SUB_NAME	BODIE CANYON ACRES
UPDATED	6/17/2023
YEAR_BUILT	1980
ZIPCODE	83822

IDAHO DEPARTMENT OF WATER RESOURCES
WELL DRILLER'S REPORT

Use Typewriter
or
Ball Point Pen

95683

1. DRILLING PERMIT NO. 97-94 N-59 .
Other IDWR No. _____

2. OWNER: Randy Butler
Name
Address
City Priest River State ID Zip 83856

3. LOCATION OF WELL by legal description:

Sketch map location must agree with written location.


 T. 56 North ☒ or South ☐
 R. 5 East ☐ or West ☒
 Sec. 14 $\frac{1}{4}$ $\frac{1}{4}$ $\frac{1}{4}$ $\frac{1}{4}$
 Gov't Lot _____ County Banner

Address of Well Site Bodie Canyon Rd.
on Priest River
(Give at least Direction + Distance to Road or Landmark)

Lot No. _____ Block No. _____ Subd. Name _____

4. PROPOSED USE:

☒ Domestic ☐ Municipal ☐ Monitor ☐ Irrigation
☐ Thermal ☐ Injection ☐ Other _____

5. TYPE OF WORK

☒ New Well ☐ Modify or Repair ☐ Replacement ☐ Abandonment

6. DRILL METHOD

☐ Mud Rotary ☐ Air Rotary ☒ Cable ☐ Other

7. SEALING PROCEDURES

[illegible]

Was drive shoe seal tested? Y ☐ N ☒ How?

8. CASING/LINER:

Diameter	From	To	Gauge	Casting	Liner	Steel	Plastic	Welded	Threaded
6	+1	180	250			☒	☐	☒	☐
						☐	☐	☐	☐
						☐	☐	☐	☐
						☐	☐	☐	☐
						☐	☐	☐	☐

Final location of shoes 107'
Top Packer or Headpipe _____ Bottom Tailpipe _____

9. PERFORATIONS/SCREENS

☐ Perforations Method Johnson
☒ Screens Type telescoping Material Steel

From	To	Slot Size	Number	Diameter	Teg/Pipe Size	Casting	Liner
108	110	20		6"		☐	☐
						☐	☐
						☐	☐
						☐	☐

SESW 14 56N SW

10. WELL TESTS:

☐ Pump ☒ Bailer ☐ Air ☐ Flowing Artesian

Yield gal./min.	Drawdown	Pumping Depth	Time
8	8'	100'	1 hr

Temperature of water _____ Was a water analysis done? Yes ☐ No ☒

By whom?

Water Quality (odor, etc.)

Bottom Hole Temperature

11. STATIC WATER LEVEL:


92' ft. below surface Depth artesian flow found _____


Artesian pressure _____ lb. Describe access port _____

Describe Controlling Devices: _____

12. LITHOLOGIC LOG: (Describe repairs or abandonment)

Bore Dia.	From	To	Remarks: Lithology, Water Quality & Temperature	GPM	SW
8	0	18	Sand Gravel		
6	18	26	Sand		
	26	45	Clay		
	45	65	Clay Blue in Color		
	65	108	Clay		
	108	110	Sand		
	110	150	Clay Blue		

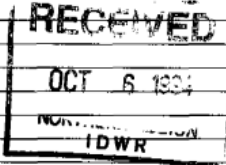

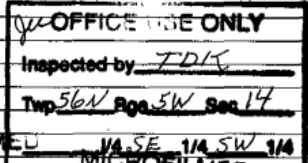

MICROFILMED

DEC 21 1998

AUG 25 1999

10 AUG 10 1994

Date: Started AUG 9 1994 Completed 10 AUG 10 1994

13. DRILLER'S CERTIFICATION

I/We certify that all minimum well construction standards were complied with at the time the rig was removed.

Firm Name Carl F. Hotz, Inc. Firm No. 601

Firm Official Carol D. Th... Date 8/18/91

and _____ Date 01/01/14

Supervisor or Operator *Steve P. Hs* Date *8/18/91*

(Sign once if Firm Official & Operator)

FORWARD WHITE COPY TO WATER RESOURCES